FINAL
Lead-Based Paint Inspection and Risk Assessment Report

U.S. Coast Guard Housing Units

250 to 390 Gulfstream Drive
380 to 394 Hercules Court
370 to 381 Mariner Court
340 to 350 Pelican Street
200 to 250 Albatross Street
Elizabeth City, North Carolina 27909

Contract No. GS-00P-08-CY-A-0045/Award No. GS-P-00-13-CY-5050

Prepared For:

United States General Services Administration
Office of Real Property Utilization and Disposal
1800 F Street, NW
Washington, DC 20405

Prepared By:

AMEC Environment & Infrastructure, Inc.
46850 Magellan Drive, Suite 190
Novi, Michigan 48377

April 2014

AMEC Project No: GSA1570024

Date of Site Visit: 03-06 September, 2013

Erica Geasler-Bromley, P.E.
Project Manager

John Maas
Environmental Scientist

TABLE OF CONTENTS

1.0 INTRODUCTION 1-1
2.0 LEAD-BASED PAINT 2-1
3.0 LEAD IN WATER 3-1
4.0 LEAD IN SOIL 4-1
5.0 LEAD HAZARD LEVELS 5-1
5.1 LEAD BASED PAINT 5-1
5.2 LEAD DUST HAZARD LEVELS 5-1
5.3 LEAD SOIL HAZARD LEVELS 5-1
5.4 WATER HAZARD LEVELS 5-1
6.0 LEAD HAZARD CONTROL METHODS 6-1
7.0 CONCLUSION AND RECOMMENDATIONS 7-1
7.1 CONCLUSION 7-1
7.2 RECOMMENDATIONS 7-1

TABLES

Table 1 Summary of Field Analysis for Lead-Based Paint

ATTACHMENTS

Attachment A LBP Inspector's Certification
Attachment B LBP Survey Maps
Attachment C LBP Survey Results Table

1.0 INTRODUCTION

Prior to the late 1970s many paints contained lead. When these paints become damaged, i.e., peeling or flaking, or the painted surface is renovated or demolished, lead can be released into the environment constituting an environmental and worker health hazard. Depending on the age of structures, lead-based paint (LBP) may potentially exist, either exposed or covered over with other paints or materials as a result of subsequent renovation. Flaking or peeling paint that could be lead-based should be removed or encapsulated appropriately.

Federal law, 20 CFR Part 35 and 40 CFR Part 745, requires sellers or lessors of residential units constructed prior to 1978, except housing for the elderly or persons with disabilities (unless any child who is less than six years of age resides or is expected to reside in such housing) or any zero-bedroom dwelling to disclose and provide a copy of a Lead Risk Assessment Report to new purchasers or lessees before they become obligated under a lease or sales contract. Property owners and sellers are also required to distribute an educational pamphlet approved by the US EPA and include standard warning language in sales contracts or in or attached to lease contracts to ensure that parents have the information they need to protect children from LBP hazards.

Based on the age of the Site, it is possible that LBP was used for painting the interior and exterior of the walls of the structures. As such, AMEC contracted Matrix Health & Safety Consultants, L.L.C. (Matrix) to conduct an LBP inspection and risk assessment at the housing units.

2.0 LEAD-BASED PAINT

AMEC subcontracted Matrix to perform an LBP inspection during the Environmental Compliance Due Diligence Activities. The objective of the LBP inspection was to determine if LBP exists on the property and if so, the locations and concentration of each painted surface.

An X-ray Fluorescence (XRF) lead analyzer was used to test the paint for lead. The analyzer is a nondestructive method of testing paint and provides immediate results for each test conducted. If paint contains lead equal to or greater than 1.0 milligram per square centimeter (mg/cm^2), as defined by the United States Environmental Protection Agency (USEPA)/Housing and Urban Development (HUD), it is considered to be lead-based paint. The higher the reading on the XRF, the higher the lead content of the paint. Reading greater than 9.9 (>9.9) are considered above the highest readout settings.

Matrix obtained 513 test readings on exterior coated surfaces and 3070 test readings on interior coated surfaces. This testing was conducted on 03-06 September 2013, by Britt Wester, Matt Dickent, and Gregg Heppert of Matrix using select portions of Chapter 7 of HUD *Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing* (1997 revision), to document whether lead-based coatings were present. A copy of inspectors' certifications are included in **Attachment A**.

The LBP inspection indicated that out of the 3583 tested locations several coated materials showed lead concentrations at or above the USEPA/HUD definition of lead-based paint (at or above 1.0 mg/cm^2). Coating materials exceeded the 1.0 mg/cm^2 are summarized in **Table 1** bellow. The LBP survey maps are included in **Attachment B**. The complete LBP survey table is included in **Attachment C.**

Table 1: Summary of Field Analysis for Lead-Based Paint

Exterior Component	Substrate	Color	Location	Lead Content (mg/cm^2)	Condition
Lintel	Metal	White	Mechanical Room Door Lintels	1.0 – 2.2	Intact - Deteriorated
Speed Bump	Concrete	Yellow	Throughout Where Present	1.0 - 3.1	Deteriorated
Curb	Concrete	White	Throughout Where Present	1.5 - 1.7	Deteriorated
Curb	Concrete	Red	Throughout Where Present	1.0	Deteriorated
Fire Hydrant	Metal	Yellow	Throughout Where Present	1.8	Deteriorated
Mail Box Post	Metal	Black	Throughout Where Present	1.0	Deteriorated
Playground Equipment	Metal	Yellow	Playground	1.0	Intact

Exterior Component	Substrate	Color	Location	Lead Content (mg/cm^2)	Condition
Ceramic Tile Wall	Ceramic	Tan white	Bathrooms – Throughout Complex	3.6 – 6.9	Intact
Bathtub	Metal Porcelain	White	Bathrooms – Throughout Complex Where Present	3.6 – 6.9	Intact
Sink	Porcelain	White	Bathrooms – Throughout Complex Where Present	3.6 – 6.9	Intact

3.0 LEAD IN WATER

Potable water at the housing units is provided by the City of Elizabeth City and there is no drinking water wells within the housing units. Hence, no water samples were taken and the lead in drinking water hazard of the LBP is not anticipated to occur.

4.0 LEAD IN SOIL

As part of the LBP inspection and risk assessment, and in accordance with the Scope of Work (SOW), AMEC collected two soil samples per exterior structure wall. Soil sample locations were within five feet (drip line) of each exterior wall. A total of 220 soil samples were collected. Two soil samples were collected at each location, at the surface (0 inches below ground surface [bgs]) and 6 inches bgs. The samples were containerized and shipped under standard chain of custody procedures to CT Laboratories, Inc. located in Baraboo, Wisconsin. The samples were submitted for total lead analysis by USEPA SW-846 Method 6010C. The sampling results, findings, and recommendations are included in the *Lead in Soil Sampling Report* prepared by AMEC dated April 2014.

5.0 LEAD HAZARD LEVELS

Lead is hazardous, especially for children who are six years of age or younger. Lead can reduce intelligence, cause behavior and learning problems, slow growth and impair hearing. Children can get lead in their bodies by breathing or swallowing lead dust, or by eating soil or paint chips with lead in them.

5.1 LEAD BASED PAINT

Lead-based paint is any paint or surface coating that contains lead equal to or in excess of 1.0 mg/cm^2 or equal to or in excess of 0.5% by weight. Lead-based paint is hazardous when it is:

- On a **friction surface**. The paint on surfaces like window sashes and jambs can break down during normal use and release lead dust. If dust levels on the nearest flat surface exceed acceptable levels, then the friction surface is a hazard.
- On a **chewable surface** that has evidence of teeth marks. These are surfaces, such as window sills, railings, door edges and stair edges that that a young child can mouth or chew.
- On an **impact surface** where there is damaged or otherwise deteriorated paint from impact from a related building component (such as a door and door frame banging together).
- **Deteriorated, e.g., peeling, chipping, chalking, or cracking**. When lead paint breaks down or is disturbed due to remodeling, renovating, dry scraping or water damage, paint chips and dust can be released that can contaminate the home and be easily ingested by young children through hand-to-mouth activity.

5.2 LEAD DUST HAZARD LEVELS

- 40 micrograms per square foot (µg/ft^2) on floors of interior or exterior living areas or on any horizontal surface other than a window sill or trough;
- 250 µg/ft^2 on interior window sills or exterior living area window sills; or,
- 400 µg/ft^2 for window troughs.

5.3 LEAD SOIL HAZARD LEVELS

- 400 mg/kg for bare soil in play areas; or,
- 1200 mg/kg (composite or average) in bare soil in non-play areas.

5.4 WATER HAZARD LEVELS

- 15 parts per billion (ppb) or microgram per liter (µg/L) for lead in drinking water.

6.0 LEAD HAZARD CONTROL METHODS

The methods of controlling lead hazards are listed below:

- **Deteriorated Lead-Based Paint on Non-friction or Non-impact Surfaces:** Examples include interior or exterior walls, ceilings, trim, casings, baseboards, etc.
  a. Removal of the lead-based painted component and replacement with a lead-free component;
  b. Paint removal by separation of the lead-based paint from the substrate using heat guns (operated below eleven hundred degrees Fahrenheit), chemicals, or certain abrasive measures either onsite or offsite;
  c. Enclosure of the lead-based painted component with durable materials. Durable materials include wallboard, drywall, paneling, siding, coil stock and the sealing or caulking of edges and joints so as to prevent or control chalking, flaking, peeling, scaling or loose lead-containing substances from becoming part of house dust or otherwise accessible to children;
  d. Encapsulation of the lead-based painted component by coating and sealing of the component with a durable surface coating approved in rule 3701-32-13 of the Administrative Code;
  e. Paint stabilization as defined in rule 3701-32-01 of the Administrative Code and a written ongoing maintenance and monitoring schedule; or
  f. Any other lead-safe method of permanently removing the lead hazard.
- **Deteriorated Lead-Based Paint on Friction or Impact Surfaces:** Examples include window systems, doors, floors, etc.
  a. Removal of the lead-based painted component and replacement with lead-free components;
  b. Lead-based paint removal by separation of the lead-based paint from the substrate using heat guns (operated below eleven hundred degrees Fahrenheit), chemicals or certain abrasive measures either onsite or offsite;
  c. Enclosure of the impact surfaces with durable materials. Durable materials include wallboard, drywall, paneling, a quarter inch or thicker plywood or other underlayment for floors, coil stock and the sealing or caulking of edges and joints so as to prevent or control chalking, flaking, peeling scaling, or loose lead-containing substances from becoming part of house dust or otherwise accessible to children. The underlayment for floors must be covered with a cleanable, impermeable surface;
  d. Elimination of the friction points or application of a treatment that will prevent abrasion of the friction surface and a written ongoing maintenance and monitoring schedule; or
  e. Any other lead-safe method of permanently removing the lead hazard.

- **Chewable Surfaces:** Examples include window sills, railings and other child-accessible surfaces that show evidence of teeth marks.
  a. **Removal** of the lead-based painted component and replacement with lead-free components;
  b. **Lead-based paint removal** by separation of the lead-based paint from the substrate using heat guns (operated below eleven hundred degrees Fahrenheit), chemicals or certain abrasive measures either onsite or offsite;
  c. **Enclosure** of the lead-based painted component with a material that cannot be penetrated by a child's teeth;
  d. **Encapsulation** of the lead-based painted component by coating and sealing of the component with a durable surface coating approved in rule 3701-32-13 of the Administrative Code; or
  e. Any other lead safe method of permanently removing the lead hazard.
- **Lead-contaminated Dust:**
  a. Elimination or control of the source creating the lead-contaminated dust using an appropriate control method listed above and followed specialized cleaning to eliminate the lead-contaminated dust. Specialized cleaning includes the use of high-efficiency particulate absorption (HEPA) vacuum, wet mopping and/or wet scrubbing; or
  b. Elimination of the lead-contaminated dust when the source creating the lead-contaminated dust cannot be identified through specialized cleaning and a written ongoing maintenance and monitoring schedule. Specialized cleaning includes the use of HEPA vacuum, wet mopping and/or wet scrubbing.
- **Lead-contaminated Soil:**
  a. **Covering** of the lead-contaminated bare soil with a permanent covering such as concrete or asphalt;
  b. **Removal** of the top six inches of lead-contaminated bare soil and replacing it with six inches of new soil having a lead concentration of less than two hundred parts per million;
  c. Covering of the lead-contaminated soil with an impermanent covering and a written ongoing maintenance and monitoring schedule. Impermanent covering includes sod and artificial turf. Gravel and mulch may be used as an impermanent covering if applied at a minimum of six inches in depth; or
  d. Any other lead safe method of permanently removing the lead hazard.

<u>The following practices are **PROHIBITED**:</u>

1. Open flame burning or torching;

2. Machine sanding or grinding without a HEPA local vacuum exhaust tool;
3. Abrasive blasting or sandblasting without a HEPA local vacuum exhaust tool;
4. Use of a heat gun operating above one thousand one hundred degrees Fahrenheit;
5. Charring paint;
6. Dry sanding;
7. Dry scraping, except when done as follows:
    a. In conjunction with a heat gun operating at not more than one thousand one hundred degrees Fahrenheit;
    b. Within one foot of an electrical outlet;
    c. To treat defective paint spots totaling not more than two square feet in an interior room or space or twenty square feet on an exterior surface.
8. Uncontained hydroblasting or high-pressure washing; and
9. Paint stripping in a poorly ventilated space using a volatile stripper that is considered a hazardous substance under 16 Code of Federal Regulations (CFR) 1500.3 or a hazardous chemical under 29 CFR 1910.1200 or 29 CFR 1926.59 in the type of work being performed.

<u>Important Notes:</u>

- Residents, especially children and pregnant women, must be kept away from the lead hazard control area. Proper and thorough cleanup is important so that dust and paint chips are not left behind at the end of the job.
- After lead hazard control work is done, the home must pass a clearance examination, which may include dust wipe samples, to ensure that no lead dust, debris or paint chips are left behind.
- Paint stabilization, interim window treatments and impermanent covering of lead-contaminated soil require a written ongoing maintenance and monitoring schedule and an annual clearance examination. It is recommended that a visual check of past repairs involving painted surfaces should be done annually and at unit turnover.
- Other surfaces that measured below hazard limits should also be addressed to prevent them from becoming hazardous. It is recommended that lead-safe work practices be used when such surfaces are repaired or replaced.

7.0 CONCLUSION AND RECOMMENDATIONS

7.1 CONCLUSION

Lead hazards were found in the locations listed below. The identified lead hazards are listed by type and location. The methods of control for the lead hazards are included in **Section 6.0**.

- LBP is found in poor condition and considered hazardous in the lintel in mechanical room, all speed bumps, all curbs, all fire hydrants, and mail box posts. All other interior and exterior paint that exceeded the USEPA HUD definition of LBP were in good condition and intact not causing any lead hazard.

7.2 RECOMMENDATIONS

The LBP inspection and risk assessment indicated that lead is present at or above the USEPA HUD definition of LBP on tested coatings at the Site. If renovation or demolition activities are planned for the Site, the disturbance of lead containing painted surfaces should be performed in accordance with USEPA-Lead; Renovation, Repair and Painting Program (40 CFR 745.80, Subpart E). Other actions may also be required under the USEPA/HUD Residential Lead-Based Paint Hazard Reduction Act of 1992 (Public Law 102-550), the HUD Lead Safe Housing Rule (24 CFR Part 35, Subparts B-R), and/or the Disclosure of Known Lead-Based Paint and/or Lead-Based Paint Hazards Upon Sale or Lease of Residential Property (24 CFR Part 35, Subpart A).

ATTACHMENT A

LBP INSPECTOR'S CERTIFICATION

NORTH CAROLINA
LEAD CERTIFICATION

Carl Britt Wester
2900 Yonkers Rd
Raleigh, NC 27604

DOB	SEX	HT	WT
03-18-1969	M	6'3"	240

DISCIPLINE	#	LAST COURSE	EXPIRATION
DESIGNER	140036	DE 08-10-2012 SU 08-09-2012	08-31-2014
RISK ASSESSOR	120173	INS 01-22-2013 RIS 01-23-2013	01-31-2015

NORTH CAROLINA
LEAD CERTIFICATION

Gregg E Heppert
47 Shelborne Dr
Clayton, NC 27527

DOB	SEX	HT	WT
09-12-1970	M	5'8"	180

DISCIPLINE	#	LAST COURSE	EXPIRATION
DESIGNER	140037	DE 09-18-2012 SU 08-22-2012	08-31-2014
RISK ASSESSOR	120151	INS 08-20-2012 RIS 08-21-2012	08-31-2014

NORTH CAROLINA
LEAD CERTIFICATION

Matthew Thomas Dickens
7805 River Dare Ave
Youngsville, NC 27596

DOB	SEX	HT	WT
07-05-1977	M	5'11"	195

DISCIPLINE	#	LAST COURSE	EXPIRATION
RISK ASSESSOR	120126	INS 01-22-2013 RIS 01-23-2013	01-31-2015

ATTACHMENT B

LBP SURVEY MAPS

Legend

⊕ Lead Based Paint Testing Location Exceeding Criteria

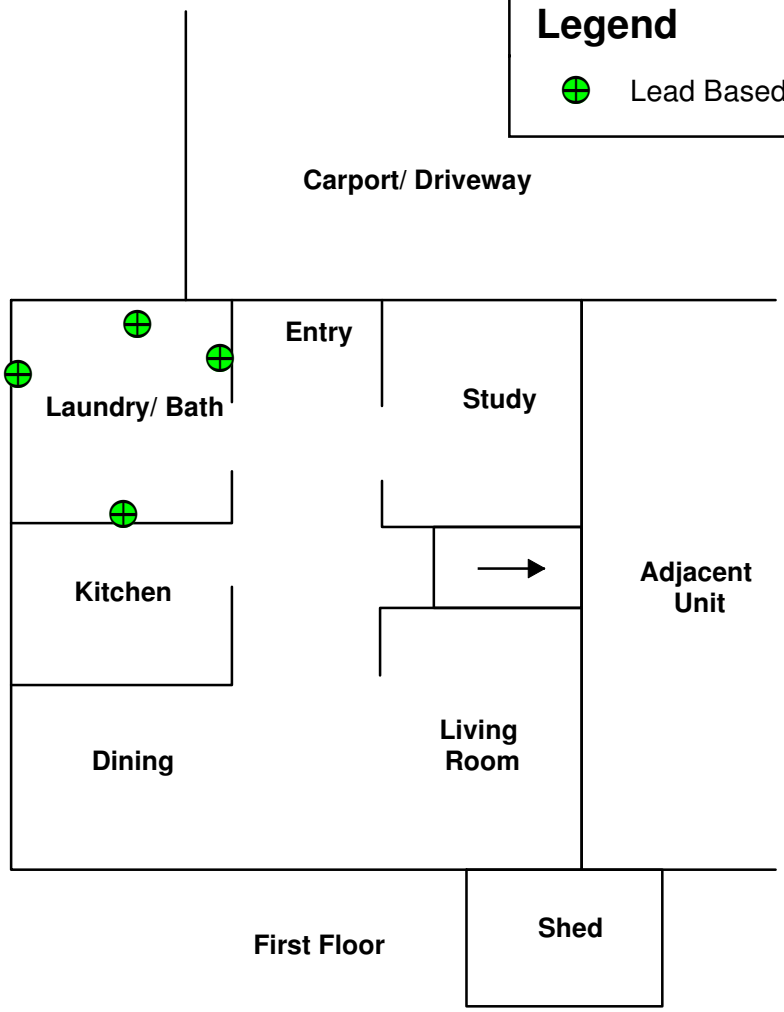

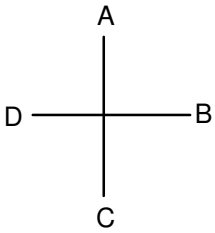

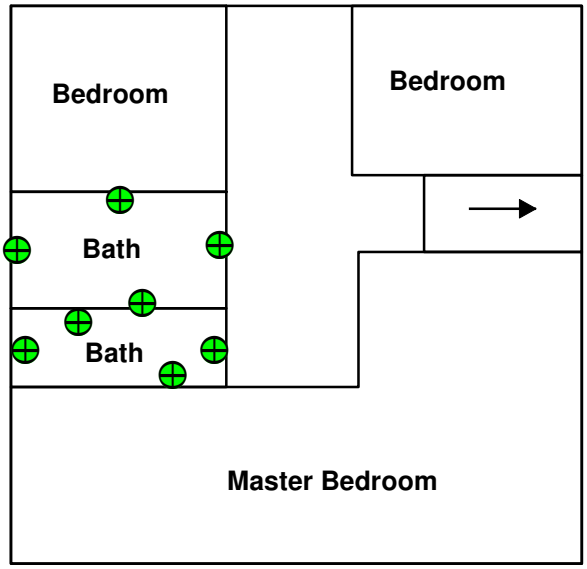

Second Floor

Notes:
1)Only those testing locations that exceeded applicable criteria are depicted.
2) A,B,C,D axis denotes perimeter walls for reference with testing location table.
3) One lead based paint testing location exceeding criteria is depicted on each wall within rooms that typically contained lead based paint exceedences throughout the 72 properties.

Typical Three Bedroom
LBP Survey Map
US Coast Guard Housing Units
Elizabeth City, NC 27909

United States Coast Guard
U.S. Department of Homeland Security
US Coast Guard

amec
46850 Magellan Drive
Novi, Michigan 48377
(248) 926-4008

PROJ: GSA-157-0026	Date: 4/2/2014

Path: N:\Federal\GSA\USCG Housing Due Diligence\Graphics\GIS\MXD\XRF- Elizabeth City - Three Bedroom.mxd

Legend

⊕ Lead Based Paint Testing Location Exceeding Criteria

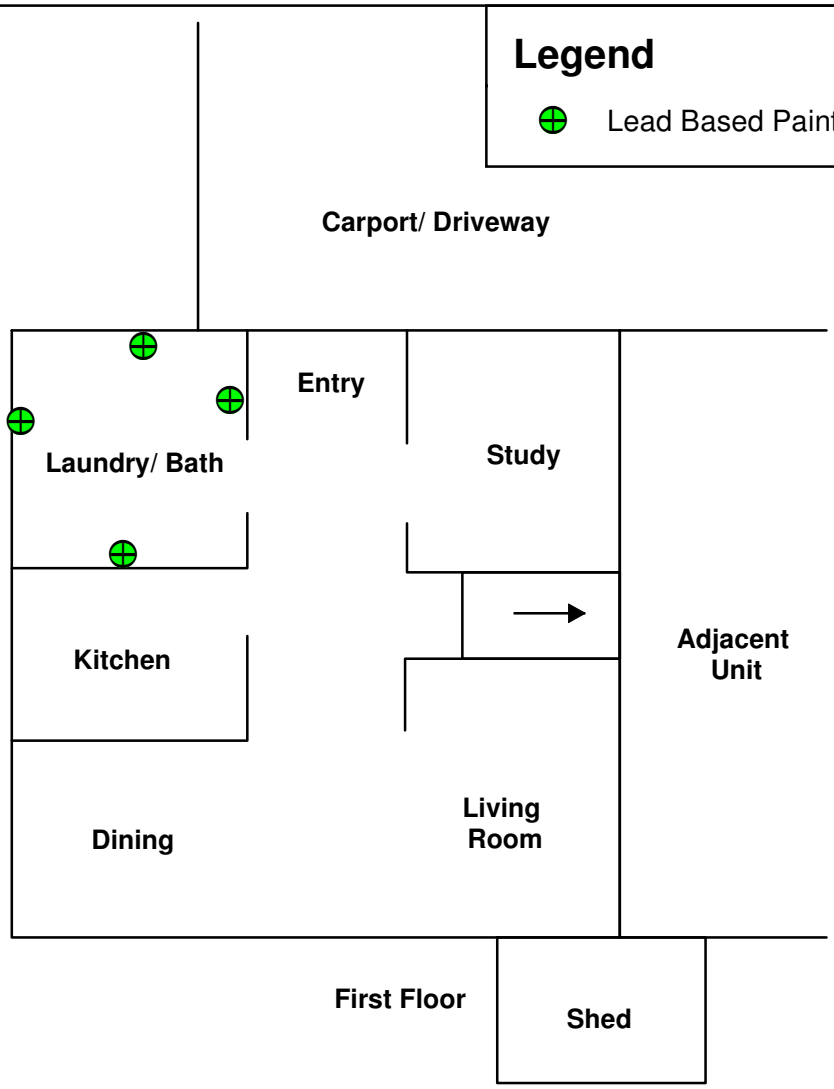

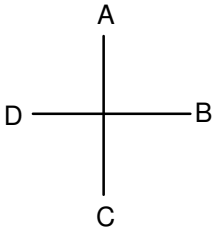

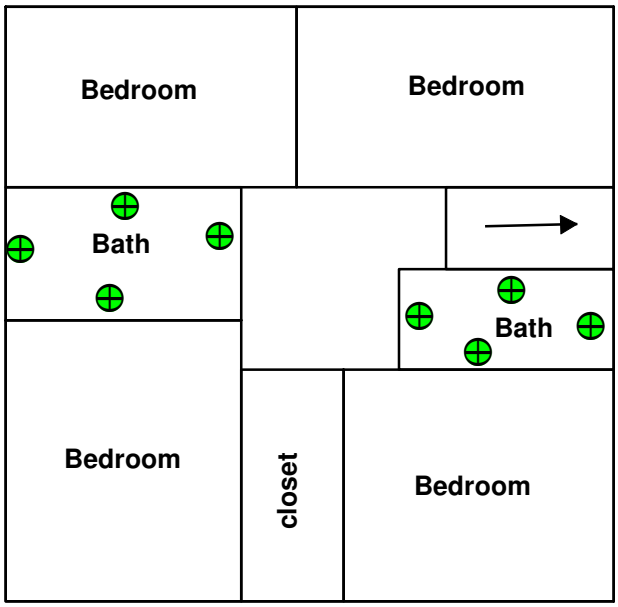

Second Floor

Notes:
1)Only those testing locations that exceeded applicable criteria are depicted.
2) A,B,C,D axis denotes perimeter walls for reference with testing location table.
3) One lead based paint testing location exceeding criteria is depicted on each wall within rooms that typically contained lead based paint exceedences throughout the 72 properties.

Typical Four Bedroom
LBP Survey Map
US Coast Guard Housing Units
Elizabeth City, NC 27909

United States Coast Guard
U.S. Department of Homeland Security
US Coast Guard

amec
46850 Magellan Drive
Novi, Michigan 48377
(248) 926-4008

PROJ: GSA-157-0026	Date: 4/2/2014

Path: N:\Federal\GSA\USCG Housing Due Diligence\Graphics\GIS\MXD\XRF- Elizabeth City - Four Bedroom.mxd

ATTACHMENT C

LBP INSPECTION RESULTS TABLE
(see attached CD)

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 10:47

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
270-276 Gulfstream Drive- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ Date: 9/11/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/10/2013	Housing Units
Abatement Level:	1.0	270-276 Gulfstream Drive- Exterior
Report No.	09/03/13 10:47	
Total Readings:	33 Actionable: 1	
Job Started:	09/03/13 10:47	
Job Finished:	09/03/13 11:05	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
011	A	Lintel	Ctr		P	Metal	White	1.0	QM
	Mechanical door.								

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/10/2013	Housing Units
Abatement Level:	1.0	270-276 Gulfstream Drive- Exterior
Report No.	09/03/13 10:47	
Total Readings:	33	
Job Started:	09/03/13 10:47	
Job Finished:	09/03/13 11:05	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.1	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	0.0	QM
3	001	Exterior	A	Gutter			I	Aluminum	White	0.0	QM
4	001	Exterior	A	Soffit			I	Aluminum	White	-0.2	QM
5	001	Exterior	A	Door	Ctr	Rgt casing	P	Wood	White	-0.1	QM
6	001	Exterior	A	Door	Ctr	Rgt jamb	I	Wood	White	0.0	QM
7	001	Exterior	A	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
8	001	Exterior	A	PorchCeiling	Ctr		I	Vinyl	White	-0.1	QM
9	001	Exterior	A	Door	Ctr	Rgt casing	P	Wood	White	-0.1	QM
		Mechanical room door.									
10	001	Exterior	A	Door	Ctr	U Ctr	P	Metal	White	-0.1	QM
11	001	Exterior	A	Lintel	Ctr		P	Metal	White	1.0	QM
		Mechanical door.									
12	001	Exterior	A	Window	Lft	Rgt casing	I	Vinyl	White	-0.2	QM
13	001	Exterior	A	Window	Lft	Sash	I	Wood	White	-0.1	QM
14	001	Exterior	A	Lintel	Lft		I	Metal	White	0.0	QM
15	001	Exterior	A	Fence	Lft		P	Wood	Brown	-0.2	QM
16	001	Exterior	A	Post	Lft		P	Metal	Brown	-0.1	QM
		Carport									
17	001	Exterior	A	Joist	Rgt		P	Wood	Brown	-0.2	QM
		Carport									
18	001	Exterior	A	Post	Rgt		P	Metal	Brown	-0.2	QM
		Carport									
19	001	Exterior	A	Window	Rgt	Sash	I	Wood	White	-0.2	QM
20	001	Exterior	A	Window	Rgt	Rgt casing	I	Vinyl	White	-0.2	QM
21	001	Exterior	A	Lintel	Rgt		I	Metal	White	-0.1	QM
22	001	Exterior	C	Wall	U Ctr		I	Vinyl	White	-0.2	QM
23	001	Exterior	C	Fascia			I	Aluminum	White	-0.2	QM
24	001	Exterior	C	Soffit			I	Aluminum	White	-0.1	QM
25	001	Exterior	C	Gutter			I	Aluminum	White	-0.2	QM
26	001	Exterior	C	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
27	001	Exterior	C	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
28	001	Exterior	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
29	001	Exterior	C	Window	Lft	Rgt casing	P	Wood	White	-0.2	QM
30	002	Shed	C	Wall	L Ctr		P	Wood	Brown	0.0	QM
31	001	Exterior	C	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
32	001	Exterior	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
33	001	Exterior	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/10/2013	Housing Units
Abatement Level:	1.0	270-276 Gulfstream Drive- Exterior
Report No.	09/03/13 10:47	
Total Readings:	33	
Job Started:	09/03/13 10:47	
Job Finished:	09/03/13 11:05	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	-0.1	QM
002	A	Fascia			I	Aluminum	White	0.0	QM
003	A	Gutter			I	Aluminum	White	0.0	QM
004	A	Soffit			I	Aluminum	White	-0.2	QM
012	A	Window	Lft	Rgt casing	I	Vinyl	White	-0.2	QM
013	A	Window	Lft	Sash	I	Wood	White	-0.1	QM
020	A	Window	Rgt	Rgt casing	I	Vinyl	White	-0.2	QM
019	A	Window	Rgt	Sash	I	Wood	White	-0.2	QM
006	A	Door	Ctr	Rgt jamb	I	Wood	White	0.0	QM
005	A	Door	Ctr	Rgt casing	P	Wood	White	-0.1	QM
009	A	Door	Ctr	Rgt casing	P	Wood	White	-0.1	QM
	Mechanical room door.								
007	A	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
010	A	Door	Ctr	U Ctr	P	Metal	White	-0.1	QM
014	A	Lintel	Lft		I	Metal	White	0.0	QM
015	A	Fence	Lft		P	Wood	Brown	-0.2	QM
016	A	Post	Lft		P	Metal	Brown	-0.1	QM
	Carport								
008	A	PorchCeiling	Ctr		I	Vinyl	White	-0.1	QM
011	A	Lintel	Ctr		P	Metal	White	1.0	QM
	Mechanical door.								
017	A	Joist	Rgt		P	Wood	Brown	-0.2	QM
	Carport								
018	A	Post	Rgt		P	Metal	Brown	-0.2	QM
	Carport								
021	A	Lintel	Rgt		I	Metal	White	-0.1	QM
022	C	Wall	U Ctr		I	Vinyl	White	-0.2	QM
023	C	Fascia			I	Aluminum	White	-0.2	QM
025	C	Gutter			I	Aluminum	White	-0.2	QM
024	C	Soffit			I	Aluminum	White	-0.1	QM
029	C	Window	Lft	Rgt casing	P	Wood	White	-0.2	QM
027	C	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
026	C	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
028	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
033	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
032	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
031	C	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
Exterior Room 002 Shed									
030	C	Wall	L Ctr		P	Wood	Brown	0.0	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/10/2013	Housing Units
Abatement Level:	1.0	270-276 Gulfstream Drive- Exterior
Report No.	09/03/13 10:47	
Total Reading Sets:	33	
Job Started:	09/03/13 10:47	
Job Finished:	09/03/13 11:05	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Lft casing	1	0	<0%>	1	<100%>	0	<0%>
Door Lft jamb	1	0	<0%>	1	<100%>	0	<0%>
Door Rgt casing	3	0	<0%>	3	<100%>	0	<0%>
Door Rgt jamb	2	0	<0%>	2	<100%>	0	<0%>
Door U Ctr	4	0	<0%>	4	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	1	0	<0%>	1	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joist	1	0	<0%>	1	<100%>	0	<0%>
Lintel	3	1	<33%>	2	<67%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Post	2	0	<0%>	2	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	3	0	<0%>	3	<100%>	0	<0%>
Window Rgt casing	3	0	<0%>	3	<100%>	0	<0%>
Window Sash	2	0	<0%>	2	<100%>	0	<0%>
Inspection Totals:	33	1	< 3%>	32	< 97%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 14:31

INSPECTION FOR: AMEC
2 Robbins Road
Westford, WA 01866

PERFORMED AT: USCG Elizabeth City
Housing/Maintenance Office- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ **Date:** 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing/Maintenance Office- Exterior
Abatement Level:	1.0	
Report No.	09/03/13 14:31	
Total Readings:	15 Actionable: 0	
Job Started:	09/03/13 14:31	
Job Finished:	09/03/13 14:39	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing/Maintenance Office- Exterior
Abatement Level:	1.0	
Report No.	09/03/13 14:31	
Total Readings:	15	
Job Started:	09/03/13 14:31	
Job Finished:	09/03/13 14:39	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	0.0	QM
3	001	Exterior	A	Gutter			I	Aluminum	White	-0.1	QM
4	001	Exterior	A	Soffit			I	Aluminum	White	-0.2	QM
5	001	Exterior	A	Door	Lft	Rgt casing	P	Metal	White	0.0	QM
6	001	Exterior	A	Door	Lft	U Ctr	P	Metal	White	0.0	QM
7	001	Exterior	A	Door	Ctr	Rgt casing	I	Cindrblock	White	0.0	QM
		Garage door casing.									
8	001	Exterior	A	Door	Ctr	Rgt casing	P	Wood	White	-0.1	QM
9	001	Exterior	A	Door	Ctr	U Lft	I	Metal	White	-0.1	QM
10	001	Exterior	A	Window	Ctr	Sash	I	Metal	Brown	-0.3	QM
11	001	Exterior	A	Barrier	Rgt		P	Metal	Yellow	-0.1	QM
12	001	Exterior	B	Wall	U Ctr		P	Vinyl	White	0.0	QM
13	001	Exterior	B	Window	Ctr	Sash	I	Metal	Brown	-0.2	QM
14	001	Exterior	D	Wall	U Ctr		I	Vinyl	White	0.0	QM
15	001	Exterior	D	Window	Lft	Sash	I	Metal	Brown	-0.2	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing/Maintenance Office- Exterior
Abatement Level:	1.0	
Report No.	09/03/13 14:31	
Total Readings:	15	
Job Started:	09/03/13 14:31	
Job Finished:	09/03/13 14:39	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
002	A	Fascia			I	Aluminum	White	0.0	QM
003	A	Gutter			I	Aluminum	White	-0.1	QM
004	A	Soffit			I	Aluminum	White	-0.2	QM
010	A	Window	Ctr	Sash	I	Metal	Brown	-0.3	QM
005	A	Door	Lft	Rgt casing	P	Metal	White	0.0	QM
006	A	Door	Lft	U Ctr	P	Metal	White	0.0	QM
007	A	Door	Ctr	Rgt casing	I	Cindrblock	White	0.0	QM
	Garage door casing.								
008	A	Door	Ctr	Rgt casing	P	Wood	White	-0.1	QM
009	A	Door	Ctr	U Lft	I	Metal	White	-0.1	QM
011	A	Barrier	Rgt		P	Metal	Yellow	-0.1	QM
012	B	Wall	U Ctr		P	Vinyl	White	0.0	QM
013	B	Window	Ctr	Sash	I	Metal	Brown	-0.2	QM
014	D	Wall	U Ctr		I	Vinyl	White	0.0	QM
015	D	Window	Lft	Sash	I	Metal	Brown	-0.2	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing/Maintenance Office- Exterior
Abatement Level:	1.0	
Report No.	09/03/13 14:31	
Total Reading Sets:	15	
Job Started:	09/03/13 14:31	
Job Finished:	09/03/13 14:39	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Barrier	1	0	<0%>	1	<100%>	0	<0%>
Door Rgt casing	3	0	<0%>	3	<100%>	0	<0%>
Door U Ctr	1	0	<0%>	1	<100%>	0	<0%>
Door U Lft	1	0	<0%>	1	<100%>	0	<0%>
Fascia	1	0	<0%>	1	<100%>	0	<0%>
Gutter	1	0	<0%>	1	<100%>	0	<0%>
Soffit	1	0	<0%>	1	<100%>	0	<0%>
Wall	3	0	<0%>	3	<100%>	0	<0%>
Window Sash	3	0	<0%>	3	<100%>	0	<0%>
Inspection Totals:	15	0	< 0%>	15	<100%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 10:32

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
250-260 Gulfstream Drive- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ Date: 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	250-260 Gulfstream Drive
Report No.	09/03/13 10:32	
Total Readings:	28 Actionable: 1	
Job Started:	09/03/13 10:32	
Job Finished:	09/03/13 10:45	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
014	A	Lintel	Lft		I	Metal	White	1.5	QM
Mechanical room door.									

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	250-260 Gulfstream Drive
Report No.	09/03/13 10:32	
Total Readings:	28	
Job Started:	09/03/13 10:32	
Job Finished:	09/03/13 10:45	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	L Ctr		I	Vinyl	White	-0.1	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	-0.2	QM
3	001	Exterior	A	Soffit			I	Aluminum	White	-0.2	QM
4	001	Exterior	A	Gutter			I	Aluminum	White	-0.2	QM
5	001	Exterior	A	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
6	001	Exterior	A	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
7	001	Exterior	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
8	001	Exterior	A	PorchCeiling	Lft		I	Vinyl	White	-0.2	QM
9	001	Exterior	A	Window	Lft	Rgt casing	I	Metal	White	-0.2	QM
10	001	Exterior	A	Window	Lft	Sash	I	Wood	White	0.0	QM
11	001	Exterior	A	Lintel	Lft		I	Metal	White	0.0	QM
12	001	Exterior	A	Door	Lft	Rgt casing	P	Wood	White	0.0	QM
13	001	Exterior	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
14	001	Exterior Mechanical room door.	A	Lintel	Lft		I	Metal	White	1.5	QM
15	001	Exterior	A	Fence	Lft		P	Wood	Brown	-0.2	QM
16	001	Exterior Carport	A	Joists	Lft		P	Wood	Brown	-0.1	QM
17	001	Exterior Carport	A	Posts	Lft		P	Metal	Brown	-0.1	QM
18	001	Exterior Carport	A	Supports	Rgt		P	Metal	Brown	-0.1	QM
19	001	Exterior	C	Wall	U Ctr		I	Vinyl	White	-0.1	QM
20	001	Exterior	C	Gutter			I	Aluminum	White	0.0	QM
21	001	Exterior	C	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
22	001	Exterior	C	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
23	001	Exterior	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
24	001	Exterior	C	Window	Lft	Rgt casing	I	Vinyl	White	-0.2	QM
25	001	Exterior	C	Window	Lft	Sash	I	Vinyl	White	-0.1	QM
26	002	Shed	C	Wall	L Ctr		P	Wood	Brown	0.2	QM
27	001	Exterior	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
28	002	Shed	C	Wall	L Rgt		P	Wood	Brown	0.0	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	250-260 Gulfstream Drive
Report No.	09/03/13 10:32	
Total Readings:	28	
Job Started:	09/03/13 10:32	
Job Finished:	09/03/13 10:45	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	L Ctr		I	Vinyl	White	-0.1	QM
002	A	Fascia			I	Aluminum	White	-0.2	QM
004	A	Gutter			I	Aluminum	White	-0.2	QM
003	A	Soffit			I	Aluminum	White	-0.2	QM
009	A	Window	Lft	Rgt casing	I	Metal	White	-0.2	QM
010	A	Window	Lft	Sash	I	Wood	White	0.0	QM
006	A	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
005	A	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
012	A	Door	Lft	Rgt casing	P	Wood	White	0.0	QM
007	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
013	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
008	A	PorchCeiling	Lft		I	Vinyl	White	-0.2	QM
011	A	Lintel	Lft		I	Metal	White	0.0	QM
014	A	Lintel	Lft		I	Metal	White	1.5	QM
	Mechanical room door.								
015	A	Fence	Lft		P	Wood	Brown	-0.2	QM
016	A	Joists	Lft		P	Wood	Brown	-0.1	QM
	Carport								
017	A	Posts	Lft		P	Metal	Brown	-0.1	QM
	Carport								
018	A	Supports	Rgt		P	Metal	Brown	-0.1	QM
	Carport								
019	C	Wall	U Ctr		I	Vinyl	White	-0.1	QM
020	C	Gutter			I	Aluminum	White	0.0	QM
024	C	Window	Lft	Rgt casing	I	Vinyl	White	-0.2	QM
025	C	Window	Lft	Sash	I	Vinyl	White	-0.1	QM
027	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
022	C	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
021	C	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
023	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
Exterior Room 002 Shed									
026	C	Wall	L Ctr		P	Wood	Brown	0.2	QM
028	C	Wall	L Rgt		P	Wood	Brown	0.0	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/9/2013
Abatement Level: 1.0
Report No. 09/03/13 10:32
Total Reading Sets: 28
Job Started: 09/03/13 10:32
Job Finished: 09/03/13 10:45

USCG Elizabeth City
Housing Units
250-260 Gulfstream Drive

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	3	0	<0%>	3	<100%>	0	<0%>
Door Rgt jamb	2	0	<0%>	2	<100%>	0	<0%>
Door U Ctr	3	0	<0%>	3	<100%>	0	<0%>
Fascia	1	0	<0%>	1	<100%>	0	<0%>
Fence	1	0	<0%>	1	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joists	1	0	<0%>	1	<100%>	0	<0%>
Lintel	2	1	<50%>	1	<50%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Posts	1	0	<0%>	1	<100%>	0	<0%>
Soffit	1	0	<0%>	1	<100%>	0	<0%>
Supports	1	0	<0%>	1	<100%>	0	<0%>
Wall	4	0	<0%>	4	<100%>	0	<0%>
Window Rgt casing	3	0	<0%>	3	<100%>	0	<0%>
Window Sash	2	0	<0%>	2	<100%>	0	<0%>
Inspection Totals:	28	1	< 4%>	27	< 96%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 10:05

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
251-261 Gulfstream Drive- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ **Date:** 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	251-261 Gulfstream Drive- Exterior
Report No.	09/03/13 10:05	
Total Readings:	38 Actionable: 1	
Job Started:	09/03/13 10:05	
Job Finished:	09/03/13 10:30	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
016	A	Lintel	Ctr		I	Metal	White	2.2	QM
	Mechanical room door.								
Calibration Readings									

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/9/2013
Abatement Level: 1.0
Report No. 09/03/13 10:05
Total Readings: 38
Job Started: 09/03/13 10:05
Job Finished: 09/03/13 10:30

USCG Elizabeth City
Housing Units
251-261 Gulfstream Drive- Exterior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1		CALIBRATION								1.0	QM
2		CALIBRATION								1.0	QM
3		CALIBRATION								1.0	QM
4		CALIBRATION								0.2	QM
5		CALIBRATION								-0.1	QM
6		CALIBRATION								0.0	QM
7	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.1	QM
8	001	Exterior	A	Fascia			I	Aluminum	White	0.0	QM
9	001	Exterior	A	Soffit			I	Aluminum	White	-0.2	QM
10	001	Exterior	A	Gutter			I	Aluminum	White	-0.3	QM
11	001	Exterior	A	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
12	001	Exterior	A	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
13	001	Exterior	A	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
14	001	Exterior	A	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
15	001	Exterior	A	Door	Ctr	U Ctr	I	Metal	White	0.0	QM
16	001	Exterior Mechanical room door.	A	Lintel	Ctr		I	Metal	White	2.2	QM
17	001	Exterior	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
18	001	Exterior	A	Window	Ctr	Sash	I	Vinyl	White	-0.2	QM
19	001	Exterior	A	Lintel	Ctr		I	Metal	White	-0.1	QM
20	001	Exterior Carport	A	Fence	Ctr		P	Wood	Red	0.2	QM
21	001	Exterior Carport	A	Joists	Ctr		P	Wood	Red	0.1	QM
22	001	Exterior Carport	A	Posts	Ctr		P	Metal	Red	0.0	QM
23	001	Exterior	C	Wall	U Ctr		I	Vinyl	White	-0.1	QM
24	001	Exterior	C	Fascia			I	Aluminum	White	0.2	QM
25	001	Exterior	C	Soffit			I	Aluminum	White	0.1	QM
26	001	Exterior	C	Gutter			I	Aluminum	White	-0.1	QM
27	001	Exterior	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
28	001	Exterior	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
29	001	Exterior	C	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
30	001	Exterior	C	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
31	001	Exterior	C	Window	Rgt	Sash	I	Wood	White	0.1	QM
32	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
33	001	Exterior	C	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
34	001	Exterior	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
35	001	Exterior	C	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
36	001	Exterior	C	Window	Lft	Rgt casing	I	Vinyl	White	-0.1	QM
37	001	Exterior	C	Window	Lft	Sash	I	Vinyl	White	0.1	QM
38	001	Exterior	A	PorchCeiling	Ctr		I	Vinyl	White	-0.1	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	251-261 Gulfstream Drive- Exterior
Report No.	09/03/13 10:05	
Total Readings:	38	
Job Started:	09/03/13 10:05	
Job Finished:	09/03/13 10:30	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
007	A	Wall	U Ctr		I	Vinyl	White	-0.1	QM
008	A	Fascia			I	Aluminum	White	0.0	QM
010	A	Gutter			I	Aluminum	White	-0.3	QM
009	A	Soffit			I	Aluminum	White	-0.2	QM
017	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
018	A	Window	Ctr	Sash	I	Vinyl	White	-0.2	QM
013	A	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
011	A	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
014	A	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
012	A	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
015	A	Door	Ctr	U Ctr	I	Metal	White	0.0	QM
016	A	Lintel	Ctr		I	Metal	White	2.2	QM
	Mechanical room door.								
019	A	Lintel	Ctr		I	Metal	White	-0.1	QM
020	A	Fence	Ctr		P	Wood	Red	0.2	QM
	Carport								
021	A	Joists	Ctr		P	Wood	Red	0.1	QM
	Carport								
022	A	Posts	Ctr		P	Metal	Red	0.0	QM
	Carport								
038	A	PorchCeiling	Ctr		I	Vinyl	White	-0.1	QM
023	C	Wall	U Ctr		I	Vinyl	White	-0.1	QM
024	C	Fascia			I	Aluminum	White	0.2	QM
026	C	Gutter			I	Aluminum	White	-0.1	QM
025	C	Soffit			I	Aluminum	White	0.1	QM
036	C	Window	Lft	Rgt casing	I	Vinyl	White	-0.1	QM
037	C	Window	Lft	Sash	I	Vinyl	White	0.1	QM
030	C	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
031	C	Window	Rgt	Sash	I	Wood	White	0.1	QM
035	C	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
033	C	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
034	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
028	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
027	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
029	C	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
Exterior Room 002 Shed									
032	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
Calibration Readings									
001								1.0	QM
002								1.0	QM
003								1.0	QM
004								0.2	QM
005								-0.1	QM
006								0.0	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	251-261 Gulfstream Drive- Exterior
Report No.	09/03/13 10:05	
Total Reading Sets:	32	
Job Started:	09/03/13 10:05	
Job Finished:	09/03/13 10:30	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	4	0	<0%>	4	<100%>	0	<0%>
Door Rgt jamb	3	0	<0%>	3	<100%>	0	<0%>
Door U Ctr	4	0	<0%>	4	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	1	0	<0%>	1	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joists	1	0	<0%>	1	<100%>	0	<0%>
Lintel	2	1	<50%>	1	<50%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Posts	1	0	<0%>	1	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	3	0	<0%>	3	<100%>	0	<0%>
Window Rgt casing	3	0	<0%>	3	<100%>	0	<0%>
Window Sash	3	0	<0%>	3	<100%>	0	<0%>
Inspection Totals:	32	1	< 3%>	31	< 97%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 11:06

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
271-281 Gulfstream Drive- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 120126

SIGNED: _____ Date: _____

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	271-281 Gulfstream Drive- Exterior
Report No.	09/03/13 11:06	
Total Readings:	41 Actionable: 2	
Job Started:	09/03/13 11:06	
Job Finished:	09/03/13 11:26	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
027	A	Lintel	Lft		I	Metal	White	1.0	QM
Mechanical room door.									
014	A	Lintel	Rgt		P	Metal	White	1.0	QM
Mechanical door.									

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/9/2013
Abatement Level: 1.0
Report No. 09/03/13 11:06
Total Readings: 41
Job Started: 09/03/13 11:06
Job Finished: 09/03/13 11:26

USCG Elizabeth City
Housing Units
271-281 Gulfstream Drive- Exterior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.1	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	-0.1	QM
3	001	Exterior	A	Soffit			I	Aluminum	White	-0.2	QM
4	001	Exterior	A	Gutter			I	Aluminum	White	-0.4	QM
5	001	Exterior	A	Door	Ctr	Rgt casing	P	Wood	White	-0.3	QM
6	001	Exterior	A	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
7	001	Exterior	A	Door	Ctr	U Ctr	I	Wood	White	0.0	QM
8	001	Exterior	A	StormDoor	Ctr		I	Metal	White	-0.2	QM
9	001	Exterior	A	PorchCeiling	Ctr		I	Vinyl	White	-0.1	QM
10	001	Exterior	A	Window	Ctr	Sash	I	Wood	White	-0.3	QM
11	001	Exterior	A	Window	Ctr	Rgt casing	I	Vinyl	White	-0.3	QM
12	001	Exterior	A	Lintel	Ctr		P	Metal	White	-0.1	QM
13	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	-0.1	QM
14	001	Exterior	A	Lintel	Rgt		P	Metal	White	1.0	QM
		Mechanical door.									
15	001	Exterior	A	Door	Rgt	Rgt casing	P	Wood	White	0.0	QM
16	001	Exterior	A	Fence	Rgt		P	Wood	Brown	0.0	QM
17	001	Exterior	A	Joists	Rgt		P	Wood	Brown	-0.1	QM
		Carport									
18	001	Exterior	A	Posts	Rgt		P	Metal	Brown	-0.2	QM
		Carport									
19	001	Exterior	A	Fence	Rgt		P	Wood	Brown	0.1	QM
20	001	Exterior	A	Joists	Rgt		P	Wood	Brown	-0.1	QM
		Carport									
21	001	Exterior	A	Posts	Rgt		P	Metal	Brown	-0.2	QM
		Carport									
22	001	Exterior	A	Fence	Lft		P	Wood	Brown	-0.2	QM
23	001	Exterior	A	Posts	Lft		P	Metal	Brown	0.0	QM
		Carport									
24	001	Exterior	A	Window	Lft	Sash	I	Wood	White	-0.1	QM
25	001	Exterior	A	Window	Lft	Well	I	Vinyl	White	-0.2	QM
26	001	Exterior	A	Door	Lft	U Ctr	I	Metal	White	-0.2	QM
27	001	Exterior	A	Lintel	Lft		I	Metal	White	1.0	QM
		Mechanical room door.									
28	001	Exterior	C	Wall	U Ctr		I	Vinyl	White	-0.1	QM
29	001	Exterior	C	Gutter			I	Aluminum	White	0.0	QM
30	001	Exterior	C	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
31	001	Exterior	C	Door	Rgt	Rgt jamb	I	Wood	White	0.2	QM
32	001	Exterior	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
33	001	Exterior	C	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
34	002	Shed	C	Wall	L Ctr		P	Wood	Brown	0.0	QM
35	001	Exterior	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
36	001	Exterior	C	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
37	001	Exterior	C	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
38	001	Exterior	C	Window	Lft	Rgt casing	P	Wood	White	0.0	QM
39	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
40	002	Shed	C	Wall	L Ctr		P	Wood	Brown	0.0	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
41	002	Shed	C	Window	Lft	Rgt casing	P	Wood	White	0.0	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/9/2013
Abatement Level: 1.0
Report No. 09/03/13 11:06
Total Readings: 41
Job Started: 09/03/13 11:06
Job Finished: 09/03/13 11:26

USCG Elizabeth City
Housing Units
271-281 Gulfstream Drive- Exterior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	-0.1	QM
002	A	Fascia			I	Aluminum	White	-0.1	QM
004	A	Gutter			I	Aluminum	White	-0.4	QM
003	A	Soffit			I	Aluminum	White	-0.2	QM
024	A	Window	Lft	Sash	I	Wood	White	-0.1	QM
025	A	Window	Lft	Well	I	Vinyl	White	-0.2	QM
011	A	Window	Ctr	Rgt casing	I	Vinyl	White	-0.3	QM
010	A	Window	Ctr	Sash	I	Wood	White	-0.3	QM
026	A	Door	Lft	U Ctr	I	Metal	White	-0.2	QM
006	A	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
005	A	Door	Ctr	Rgt casing	P	Wood	White	-0.3	QM
007	A	Door	Ctr	U Ctr	I	Wood	White	0.0	QM
015	A	Door	Rgt	Rgt casing	P	Wood	White	0.0	QM
013	A	Door	Rgt	U Ctr	I	Metal	White	-0.1	QM
022	A	Fence	Lft		P	Wood	Brown	-0.2	QM
023	A	Posts	Lft		P	Metal	Brown	0.0	QM
	Carport								
027	A	Lintel	Lft		I	Metal	White	1.0	QM
	Mechanical room door.								
008	A	StormDoor	Ctr		I	Metal	White	-0.2	QM
009	A	PorchCeiling	Ctr		I	Vinyl	White	-0.1	QM
012	A	Lintel	Ctr		P	Metal	White	-0.1	QM
014	A	Lintel	Rgt		P	Metal	White	1.0	QM
	Mechanical door.								
016	A	Fence	Rgt		P	Wood	Brown	0.0	QM
017	A	Joists	Rgt		P	Wood	Brown	-0.1	QM
	Carport								
018	A	Posts	Rgt		P	Metal	Brown	-0.2	QM
	Carport								
019	A	Fence	Rgt		P	Wood	Brown	0.1	QM
020	A	Joists	Rgt		P	Wood	Brown	-0.1	QM
	Carport								
021	A	Posts	Rgt		P	Metal	Brown	-0.2	QM
	Carport								
028	C	Wall	U Ctr		I	Vinyl	White	-0.1	QM
029	C	Gutter			I	Aluminum	White	0.0	QM
038	C	Window	Lft	Rgt casing	P	Wood	White	0.0	QM
033	C	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
036	C	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
037	C	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
035	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
031	C	Door	Rgt	Rgt jamb	I	Wood	White	0.2	QM
032	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
030	C	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
Exterior Room 002 Shed									
034	C	Wall	L Ctr		P	Wood	Brown	0.0	QM
039	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
040	C	Wall	L Ctr		P	Wood	Brown	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
041	C	Window	Lft	Rgt casing	P	Wood	White	0.0	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	271-281 Gulfstream Drive- Exterior
Report No.	09/03/13 11:06	
Total Reading Sets:	41	
Job Started:	09/03/13 11:06	
Job Finished:	09/03/13 11:26	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	4	0	<0%>	4	<100%>	0	<0%>
Door Rgt jamb	3	0	<0%>	3	<100%>	0	<0%>
Door U Ctr	5	0	<0%>	5	<100%>	0	<0%>
Fascia	1	0	<0%>	1	<100%>	0	<0%>
Fence	3	0	<0%>	3	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joists	2	0	<0%>	2	<100%>	0	<0%>
Lintel	3	2	<67%>	1	<33%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Posts	3	0	<0%>	3	<100%>	0	<0%>
Soffit	1	0	<0%>	1	<100%>	0	<0%>
StormDoor	1	0	<0%>	1	<100%>	0	<0%>
Wall	5	0	<0%>	5	<100%>	0	<0%>
Window Rgt casing	4	0	<0%>	4	<100%>	0	<0%>
Window Sash	2	0	<0%>	2	<100%>	0	<0%>
Window Well	1	0	<0%>	1	<100%>	0	<0%>
Inspection Totals:	41	2	< 5%>	39	< 95%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 11:29

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
280-290 Gulfstream Drive- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ Date: 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	280-290 Gulfstream Drive- Exterior
Report No.	09/03/13 11:29	
Total Readings:	43 Actionable: 1	
Job Started:	09/03/13 11:29	
Job Finished:	09/03/13 12:08	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
012	A	Lintel	Lft		I	Metal	White	1.0	QM
	Mechanical room door.								

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/9/2013
Abatement Level: 1.0
Report No. 09/03/13 11:29
Total Readings: 43
Job Started: 09/03/13 11:29
Job Finished: 09/03/13 12:08

USCG Elizabeth City
Housing Units
280-290 Gulfstream Drive- Exterior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	-0.3	QM
3	001	Exterior	A	Soffit			I	Aluminum	White	-0.3	QM
4	001	Exterior	A	Gutter			I	Aluminum	White	-0.2	QM
5	001	Exterior	A	Door	Lft	Rgt casing	I	Wood	White	-0.3	QM
6	001	Exterior	A	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
7	001	Exterior	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
8	001	Exterior	A	PorchCeiling	Lft		I	Vinyl	White	-0.1	QM
9	001	Exterior	A	Window	Lft	Sash	I	Wood	White	-0.2	QM
10	001	Exterior	A	Lintel	Lft		P	Metal	White	0.0	QM
11	001	Exterior	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
12	001	Exterior Mechanical room door.	A	Lintel	Lft		I	Metal	White	1.0	QM
13	001	Exterior	A	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
14	001	Exterior	A	Fence	Lft		I	Wood	Brown	-0.2	QM
15	001	Exterior Carport	A	Joists	Lft		I	Wood	Brown	-0.1	QM
16	001	Exterior	A	Posts	Lft		I	Metal	Brown	0.0	QM
17	001	Exterior	A	Fence	Ctr		P	Wood	Brown	-0.1	QM
18	001	Exterior Carport	A	Joist	Ctr		P	Wood	Brown	-0.1	QM
19	001	Exterior Carport	A	Posts	Ctr		P	Metal	Brown	-0.1	QM
20	001	Exterior	A	Window	Ctr	Sash	P	Wood	White	-0.1	QM
21	001	Exterior	A	Lintel	Ctr		P	Metal	White	-0.1	QM
22	001	Exterior	A	Lintel	Ctr		P	Metal	White	0.0	QM
23	001	Exterior	A	Lintel	Ctr		I	Metal	White	0.0	QM
24	001	Exterior	A	Fence	Rgt		I	Wood	Brown	-0.1	QM
25	001	Exterior Carport	A	Joist	Rgt		I	Wood	Brown	-0.1	QM
26	001	Exterior Carport	A	Posts	Rgt		I	Metal	Brown	-0.3	QM
27	001	Exterior	A	Window	Rgt	Sash	P	Wood	White	-0.2	QM
28	001	Exterior	A	Lintel	Rgt		P	Metal	White	-0.2	QM
29	001	Exterior	C	Wall	U Ctr		I	Vinyl	White	0.0	QM
30	001	Exterior	C	Fascia			I	Aluminum	White	-0.2	QM
31	001	Exterior	C	Soffit			I	Aluminum	White	0.0	QM
32	001	Exterior	C	Gutter			I	Aluminum	White	-0.1	QM
33	001	Exterior	C	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
34	001	Exterior	C	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
35	001	Exterior	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
36	001	Exterior	C	Window	Lft	Rgt casing	P	Wood	White	-0.1	QM
37	001	Exterior	C	Window	Lft	Sash	I	Vinyl	White	-0.2	QM
38	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.2	QM
39	002	Shed	C	Wall	U Ctr		P	Wood	Brown	-0.3	QM
40	002	Shed	C	Door	Ctr	U Ctr	P	Wood	White	-0.1	QM
41	002	Shed	C	Door	Ctr	Rgt casing	P	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
42	002	Shed	C	Door	Ctr	Rgt jamb	P	Wood	White	-0.2	QM
43	002	Shed	C	Window	Ctr	Rgt casing	P	Wood	White	-0.3	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	280-290 Gulfstream Drive- Exterior
Report No.	09/03/13 11:29	
Total Readings:	43	
Job Started:	09/03/13 11:29	
Job Finished:	09/03/13 12:08	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
002	A	Fascia			I	Aluminum	White	-0.3	QM
004	A	Gutter			I	Aluminum	White	-0.2	QM
003	A	Soffit			I	Aluminum	White	-0.3	QM
009	A	Window	Lft	Sash	I	Wood	White	-0.2	QM
020	A	Window	Ctr	Sash	P	Wood	White	-0.1	QM
027	A	Window	Rgt	Sash	P	Wood	White	-0.2	QM
006	A	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
005	A	Door	Lft	Rgt casing	I	Wood	White	-0.3	QM
013	A	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
007	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
011	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
008	A	PorchCeiling	Lft		I	Vinyl	White	-0.1	QM
010	A	Lintel	Lft		P	Metal	White	0.0	QM
012	A	Lintel	Lft		I	Metal	White	1.0	QM
	Mechanical room door.								
014	A	Fence	Lft		I	Wood	Brown	-0.2	QM
015	A	Joists	Lft		I	Wood	Brown	-0.1	QM
	Carport								
016	A	Posts	Lft		I	Metal	Brown	0.0	QM
017	A	Fence	Ctr		P	Wood	Brown	-0.1	QM
018	A	Joist	Ctr		P	Wood	Brown	-0.1	QM
	Carport								
019	A	Posts	Ctr		P	Metal	Brown	-0.1	QM
	Carport								
021	A	Lintel	Ctr		P	Metal	White	-0.1	QM
022	A	Lintel	Ctr		P	Metal	White	0.0	QM
023	A	Lintel	Ctr		I	Metal	White	0.0	QM
024	A	Fence	Rgt		I	Wood	Brown	-0.1	QM
025	A	Joist	Rgt		I	Wood	Brown	-0.1	QM
	Carport								
026	A	Posts	Rgt		I	Metal	Brown	-0.3	QM
	Carport								
028	A	Lintel	Rgt		P	Metal	White	-0.2	QM
029	C	Wall	U Ctr		I	Vinyl	White	0.0	QM
030	C	Fascia			I	Aluminum	White	-0.2	QM
032	C	Gutter			I	Aluminum	White	-0.1	QM
031	C	Soffit			I	Aluminum	White	0.0	QM
036	C	Window	Lft	Rgt casing	P	Wood	White	-0.1	QM
037	C	Window	Lft	Sash	I	Vinyl	White	-0.2	QM
034	C	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
033	C	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
035	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
Exterior Room 002 Shed									
038	C	Wall	L Ctr		P	Wood	Brown	-0.2	QM
039	C	Wall	U Ctr		P	Wood	Brown	-0.3	QM
043	C	Window	Ctr	Rgt casing	P	Wood	White	-0.3	QM
042	C	Door	Ctr	Rgt jamb	P	Wood	White	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
041	C	Door	Ctr	Rgt casing	P	Wood	White	-0.1	QM
040	C	Door	Ctr	U Ctr	P	Wood	White	-0.1	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	280-290 Gulfstream Drive- Exterior
Report No.	09/03/13 11:29	
Total Reading Sets:	43	
Job Started:	09/03/13 11:29	
Job Finished:	09/03/13 12:08	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	4	0	<0%>	4	<100%>	0	<0%>
Door Rgt jamb	3	0	<0%>	3	<100%>	0	<0%>
Door U Ctr	4	0	<0%>	4	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	3	0	<0%>	3	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joist	2	0	<0%>	2	<100%>	0	<0%>
Joists	1	0	<0%>	1	<100%>	0	<0%>
Lintel	6	1	<17%>	5	<83%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Posts	3	0	<0%>	3	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	4	0	<0%>	4	<100%>	0	<0%>
Window Rgt casing	2	0	<0%>	2	<100%>	0	<0%>
Window Sash	4	0	<0%>	4	<100%>	0	<0%>
Inspection Totals:	43	1	< 2%>	42	< 98%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 12:08

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
283-289 Gulfstream Drive- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ Date: 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	283-289 Gulfstream Drive- Exterior
Report No.	09/03/13 12:08	
Total Readings:	42 Actionable: 0	
Job Started:	09/03/13 12:08	
Job Finished:	09/03/13 12:30	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/9/2013
Abatement Level: 1.0
Report No. 09/03/13 12:08
Total Readings: 42
Job Started: 09/03/13 12:08
Job Finished: 09/03/13 12:30

USCG Elizabeth City
Housing Units
283-289 Gulfstream Drive- Exterior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	-0.2	QM
3	001	Exterior	A	Soffit			I	Aluminum	White	-0.2	QM
4	001	Exterior	A	Gutter			I	Aluminum	White	-0.1	QM
5	001	Exterior	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
6	001	Exterior	A	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
7	001	Exterior	A	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
8	001	Exterior	A	PorchCeiling	Rgt		I	Vinyl	White	-0.1	QM
9	001	Exterior	A	Window	Rgt	Sash	I	Wood	White	-0.1	QM
10	001	Exterior	A	Window	Rgt	Well	I	Vinyl	White	-0.1	QM
11	001	Exterior	A	Lintel	Rgt		P	Metal	White	0.0	QM
12	001	Exterior Mechanical room door.	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
13	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	-0.1	QM
14	001	Exterior	A	Lintel	Rgt		P	Metal	White	0.2	QM
15	001	Exterior	A	Fence	Rgt		P	Wood	Brown	-0.1	QM
16	001	Exterior Carport	A	Joist	Rgt		P	Wood	Brown	-0.1	QM
17	001	Exterior Carport	A	Posts	Rgt		P	Metal	Brown	-0.1	QM
18	001	Exterior	A	Window	Lft	Sash	I	Wood	White	-0.2	QM
19	001	Exterior	A	Lintel	Lft		P	Metal	White	0.0	QM
20	001	Exterior Mechanical room door.	A	Door	Lft	U Ctr	I	Metal	White	-0.1	QM
21	001	Exterior	A	Lintel	Lft		P	Metal	White	0.0	QM
22	001	Exterior	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
23	001	Exterior	A	Fence	Lft		P	Wood	Brown	-0.1	QM
24	001	Exterior Carport	A	Joist	Lft		P	Wood	Brown	-0.2	QM
25	001	Exterior Carport	A	Posts	Lft		P	Metal	Brown	-0.1	QM
26	001	Exterior Mechanical room door.	A	Door	Ctr	U Ctr	P	Metal	White	-0.1	QM
27	001	Exterior	A	Lintel	Ctr		P	Metal	White	0.2	QM
28	001	Exterior	A	Window	Lft	Sash	P	Wood	White	-0.2	QM
29	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
30	001	Exterior	A	Fascia			I	Aluminum	White	-0.1	QM
31	001	Exterior	A	Soffit			I	Aluminum	White	-0.1	QM
32	001	Exterior	A	Gutter			I	Aluminum	White	-0.1	QM
33	001	Exterior	C	Door	Rgt	Rgt casing	P	Wood	White	0.1	QM
34	001	Exterior	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
35	001	Exterior	C	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
36	001	Exterior	C	Window	Rgt	Rgt casing	P	Wood	White	-0.1	QM
37	002	Shed	C	Wall	L Ctr		P	Wood	Tan	-0.1	QM
38	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
39	001	Exterior	C	Window	Ctr	Rgt casing	P	Wood	White	0.0	QM
40	001	Exterior	C	Door	Lft	U Ctr	P	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
41	001	Exterior	C	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
42	001	Exterior	C	Door	Lft	Rgt jamb	P	Wood	White	-0.1	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	283-289 Gulfstream Drive- Exterior
Report No.	09/03/13 12:08	
Total Readings:	42	
Job Started:	09/03/13 12:08	
Job Finished:	09/03/13 12:30	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
029	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
002	A	Fascia			I	Aluminum	White	-0.2	QM
030	A	Fascia			I	Aluminum	White	-0.1	QM
004	A	Gutter			I	Aluminum	White	-0.1	QM
032	A	Gutter			I	Aluminum	White	-0.1	QM
003	A	Soffit			I	Aluminum	White	-0.2	QM
031	A	Soffit			I	Aluminum	White	-0.1	QM
018	A	Window	Lft	Sash	I	Wood	White	-0.2	QM
028	A	Window	Lft	Sash	P	Wood	White	-0.2	QM
009	A	Window	Rgt	Sash	I	Wood	White	-0.1	QM
010	A	Window	Rgt	Well	I	Vinyl	White	-0.1	QM
022	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
020	A	Door	Lft	U Ctr	I	Metal	White	-0.1	QM
	Mechanical room door.								
026	A	Door	Ctr	U Ctr	P	Metal	White	-0.1	QM
	Mechanical room door.								
006	A	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
005	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
012	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
	Mechanical room door.								
007	A	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
013	A	Door	Rgt	U Ctr	I	Metal	White	-0.1	QM
019	A	Lintel	Lft		P	Metal	White	0.0	QM
021	A	Lintel	Lft		P	Metal	White	0.0	QM
023	A	Fence	Lft		P	Wood	Brown	-0.1	QM
024	A	Joist	Lft		P	Wood	Brown	-0.2	QM
	Carport								
025	A	Posts	Lft		P	Metal	Brown	-0.1	QM
	Carport								
027	A	Lintel	Ctr		P	Metal	White	0.2	QM
008	A	PorchCeiling	Rgt		I	Vinyl	White	-0.1	QM
011	A	Lintel	Rgt		P	Metal	White	0.0	QM
014	A	Lintel	Rgt		P	Metal	White	0.2	QM
015	A	Fence	Rgt		P	Wood	Brown	-0.1	QM
016	A	Joist	Rgt		P	Wood	Brown	-0.1	QM
	Carport								
017	A	Posts	Rgt		P	Metal	Brown	-0.1	QM
	Carport								
039	C	Window	Ctr	Rgt casing	P	Wood	White	0.0	QM
036	C	Window	Rgt	Rgt casing	P	Wood	White	-0.1	QM
042	C	Door	Lft	Rgt jamb	P	Wood	White	-0.1	QM
041	C	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
040	C	Door	Lft	U Ctr	P	Wood	White	-0.1	QM
034	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
033	C	Door	Rgt	Rgt casing	P	Wood	White	0.1	QM
035	C	Door	Rgt	U Ctr	I	Wood	White	0.0	QM

Exterior Room 002 Shed

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
037	C	Wall	L Ctr		P	Wood	Tan	-0.1	QM
038	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	283-289 Gulfstream Drive- Exterior
Report No.	09/03/13 12:08	
Total Reading Sets:	42	
Job Started:	09/03/13 12:08	
Job Finished:	09/03/13 12:30	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	5	0	<0%>	5	<100%>	0	<0%>
Door Rgt jamb	3	0	<0%>	3	<100%>	0	<0%>
Door U Ctr	6	0	<0%>	6	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	2	0	<0%>	2	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joist	2	0	<0%>	2	<100%>	0	<0%>
Lintel	5	0	<0%>	5	<100%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Posts	2	0	<0%>	2	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	4	0	<0%>	4	<100%>	0	<0%>
Window Rgt casing	2	0	<0%>	2	<100%>	0	<0%>
Window Sash	3	0	<0%>	3	<100%>	0	<0%>
Window Well	1	0	<0%>	1	<100%>	0	<0%>
Inspection Totals:	42	0	< 0%>	42	<100%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 12:30

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
380-386 Hercules Court- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ **Date:** 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	380-386 Hercules Court- Exterior
Report No.	09/03/13 12:30	
Total Readings:	43 Actionable: 1	
Job Started:	09/03/13 12:30	
Job Finished:	09/03/13 12:56	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
016	A	Lintel	Lft		I	Metal	White	1.0	QM
	Mechanical room door.								

Calibration Readings

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/9/2013
Abatement Level: 1.0
Report No. 09/03/13 12:30
Total Readings: 43
Job Started: 09/03/13 12:30
Job Finished: 09/03/13 12:56

USCG Elizabeth City
Housing Units
380-386 Hercules Court- Exterior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	-0.1	QM
3	001	Exterior	A	Soffit			I	Aluminum	White	-0.2	QM
4	001	Exterior	A	Gutter			I	Aluminum	White	-0.2	QM
5	001	Exterior	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
6	001	Exterior	A	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
7	001	Exterior	A	Door	Lft	U Ctr	I	Metal	White	-0.2	QM
8	001	Exterior	A	Side Lite	Lft		I	Wood	White	-0.2	QM
9	001	Exterior	A	Window	Lft	Sash	I	Wood	White	-0.1	QM
10	001	Exterior	A	Window	Lft	Rgt casing	I	Vinyl	White	-0.1	QM
11	001	Exterior Mechanical room door.	A	Lintel	Lft		I	Metal	White	-0.2	QM
12	001	Exterior	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
13	001	Exterior	A	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
14	001	Exterior	A	Fence	Lft		P	Wood	Yellow	-0.1	QM
15	001	Exterior Carport	A	Post	Lft		P	Metal	Yellow	-0.2	QM
16	001	Exterior Mechanical room door.	A	Lintel	Lft		I	Metal	White	1.0	QM
17	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	-0.3	QM
18	001	Exterior	A	Door	Rgt	Rgt casing	I	Metal	White	-0.2	QM
19	001	Exterior	A	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
20	001	Exterior	A	Fence	Rgt		I	Wood	Brown	-0.2	QM
21	001	Exterior Carport	A	Joist	Rgt		I	Wood	Brown	-0.1	QM
22	001	Exterior Carport	A	Posts	Rgt		I	Metal	Brown	-0.2	QM
23	001	Exterior	C	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
24	001	Exterior	C	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
25	001	Exterior	C	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
26	001	Exterior	C	Window	Lft	Sash	I	Wood	White	-0.2	QM
27	001	Exterior	C	Window	Lft	Well	I	Vinyl	White	-0.1	QM
28	002	Shed	C	Wall	L Ctr		I	Wood	Yellow	-0.1	QM
29	001	Exterior	C	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
30	001	Exterior	C	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
31	001	Exterior	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
32	001	Exterior	C	Window	Ctr	Sash	P	Wood	White	-0.2	QM
33	001	Exterior	C	Fascia			I	Aluminum	White	-0.1	QM
34	001	Exterior	C	Soffit			I	Aluminum	White	-0.1	QM
35	001	Exterior	C	Gutter			I	Aluminum	White	-0.1	QM
36	002	Shed	C	Wall	L Ctr		I	Wood	Yellow	-0.2	QM
37	001	Exterior	C	Window	Ctr	Sash	P	Wood	White	-0.1	QM
38		CALIBRATION								1.0	QM
39		CALIBRATION								1.0	QM
40		CALIBRATION								1.0	QM
41		CALIBRATION								0.0	QM
42		CALIBRATION								-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
43		CALIBRATION								-0.1	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/9/2013
Abatement Level: 1.0
Report No. 09/03/13 12:30
Total Readings: 43
Job Started: 09/03/13 12:30
Job Finished: 09/03/13 12:56

USCG Elizabeth City
Housing Units
380-386 Hercules Court- Exterior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
002	A	Fascia			I	Aluminum	White	-0.1	QM
004	A	Gutter			I	Aluminum	White	-0.2	QM
003	A	Soffit			I	Aluminum	White	-0.2	QM
010	A	Window	Lft	Rgt casing	I	Vinyl	White	-0.1	QM
009	A	Window	Lft	Sash	I	Wood	White	-0.1	QM
019	A	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
006	A	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
005	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
013	A	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
007	A	Door	Lft	U Ctr	I	Metal	White	-0.2	QM
012	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
018	A	Door	Rgt	Rgt casing	I	Metal	White	-0.2	QM
017	A	Door	Rgt	U Ctr	I	Metal	White	-0.3	QM
008	A	Side Lite	Lft		I	Wood	White	-0.2	QM
011	A	Lintel	Lft		I	Metal	White	-0.2	QM
	Mechanical room door.								
014	A	Fence	Lft		P	Wood	Yellow	-0.1	QM
015	A	Post	Lft		P	Metal	Yellow	-0.2	QM
	Carport								
016	A	Lintel	Lft		I	Metal	White	1.0	QM
	Mechanical room door.								
020	A	Fence	Rgt		I	Wood	Brown	-0.2	QM
021	A	Joist	Rgt		I	Wood	Brown	-0.1	QM
	Carport								
022	A	Posts	Rgt		I	Metal	Brown	-0.2	QM
	Carport								
033	C	Fascia			I	Aluminum	White	-0.1	QM
035	C	Gutter			I	Aluminum	White	-0.1	QM
034	C	Soffit			I	Aluminum	White	-0.1	QM
026	C	Window	Lft	Sash	I	Wood	White	-0.2	QM
027	C	Window	Lft	Well	I	Vinyl	White	-0.1	QM
032	C	Window	Ctr	Sash	P	Wood	White	-0.2	QM
037	C	Window	Ctr	Sash	P	Wood	White	-0.1	QM
023	C	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
024	C	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
025	C	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
031	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
030	C	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
029	C	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
Exterior Room 002 Shed									
028	C	Wall	L Ctr		I	Wood	Yellow	-0.1	QM
036	C	Wall	L Ctr		I	Wood	Yellow	-0.2	QM
Calibration Readings									
038								1.0	QM
039								1.0	QM
040								1.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
041								0.0	QM
042								-0.1	QM
043								-0.1	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	380-386 Hercules Court- Exterior
Report No.	09/03/13 12:30	
Total Reading Sets:	37	
Job Started:	09/03/13 12:30	
Job Finished:	09/03/13 12:56	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	5	0	<0%>	5	<100%>	0	<0%>
Door Rgt jamb	2	0	<0%>	2	<100%>	0	<0%>
Door U Ctr	6	0	<0%>	6	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	2	0	<0%>	2	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joist	1	0	<0%>	1	<100%>	0	<0%>
Lintel	2	1	<50%>	1	<50%>	0	<0%>
Post	1	0	<0%>	1	<100%>	0	<0%>
Posts	1	0	<0%>	1	<100%>	0	<0%>
Side Lite	1	0	<0%>	1	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	3	0	<0%>	3	<100%>	0	<0%>
Window Rgt casing	2	0	<0%>	2	<100%>	0	<0%>
Window Sash	4	0	<0%>	4	<100%>	0	<0%>
Window Well	1	0	<0%>	1	<100%>	0	<0%>
Inspection Totals:	37	1	< 3%>	36	< 97%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 08:07

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
200-210 Albatross Street- Exterior

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ Date: 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	380-386 Hercules Court- Exterior
Report No.	09/04/13 08:07	
Total Readings:	57 Actionable: 2	
Job Started:	09/04/13 08:07	
Job Finished:	09/04/13 08:34	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
026	A	Lintel	Ctr		I	Metal	White	1.0	QM
	Mechanical room door.								
033	A	Lintel	Rgt		I	Metal	White	1.0	QM
	Mechanical room door.								

Calibration Readings

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	380-386 Hercules Court- Exterior
Report No.	09/04/13 08:07	
Total Readings:	57	
Job Started:	09/04/13 08:07	
Job Finished:	09/04/13 08:34	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1		CALIBRATION								1.0	QM
2		CALIBRATION								1.0	QM
3		CALIBRATION								1.0	QM
4		CALIBRATION								0.1	QM
5		CALIBRATION								-0.1	QM
6		CALIBRATION								0.0	QM
7	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
8	001	Exterior	A	Fascia			I	Aluminum	White	-0.1	QM
9	001	Exterior	A	Soffit			I	Aluminum	White	-0.2	QM
10	001	Exterior	A	Gutter			I	Aluminum	White	-0.1	QM
11	001	Exterior	A	Door	Lft	Lft casing	I	Wood	White	0.1	QM
12	001	Exterior	A	Door	Lft	Lft jamb	I	Wood	White	0.1	QM
13	001	Exterior	A	Door	Lft	U Ctr	I	Wood	White	0.0	QM
14	001	Exterior	A	PorchCeiling	Lft		I	Vinyl	White	-0.1	QM
15	001	Exterior	A	Window	Lft	Sash	I	Wood	White	-0.2	QM
16	001	Exterior	A	Window	Lft	Well	I	Vinyl	White	-0.1	QM
17	001	Exterior	A	Lintel	Lft		P	Metal	White	-0.1	QM
18	001	Exterior Mechanical room door.	A	Lintel	Lft		I	Metal	White	-0.1	QM
19	001	Exterior	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
20	001	Exterior	A	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
21	001	Exterior	A	Fence	Lft		P	Wood	Brown	-0.2	QM
22	001	Exterior Carport	A	Joist	Lft		P	Wood	Brown	0.0	QM
23	001	Exterior Carport	A	Post	Lft		P	Metal	Brown	0.1	QM
24	001	Exterior Mechanical room door.	A	Lintel	Lft		I	Metal	White	0.3	QM
25	001	Exterior	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
26	001	Exterior Mechanical room door.	A	Lintel	Ctr		I	Metal	White	1.0	QM
27	001	Exterior	A	Door	Ctr	U Ctr	I	Metal	White	0.0	QM
28	001	Exterior	A	Fence	Ctr		P	Wood	Brown	0.1	QM
29	001	Exterior Carport	A	Joist	Ctr		P	Wood	Brown	-0.1	QM
30	001	Exterior Carport	A	Post	Ctr		P	Metal	Brown	-0.1	QM
31	001	Exterior	A	Window	Ctr	Sash	I	Wood	White	0.1	QM
32	001	Exterior	A	Lintel	Ctr		P	Metal	White	0.0	QM
33	001	Exterior Mechanical room door.	A	Lintel	Rgt		I	Metal	White	1.0	QM
34	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	-0.2	QM
35	001	Exterior	A	Fence	Rgt		P	Wood	Brown	0.0	QM
36	001	Exterior Carport	A	Joist	Rgt		P	Wood	Brown	0.0	QM
37	001	Exterior Carport	A	Posts	Rgt		P	Metal	Brown	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
38	001	Exterior Mechanical room door.	A	Lintel	Rgt		I	Metal	White	0.0	QM
39	001	Exterior	A	Door	Rgt	U Lft	I	Metal	White	0.1	QM
40	001	Exterior	C	Wall	U Ctr		I	Vinyl	White	-0.1	QM
41	001	Exterior	C	Fascia			I	Aluminum	White	-0.1	QM
42	001	Exterior	C	Soffit			I	Aluminum	White	-0.1	QM
43	001	Exterior	C	Gutter			I	Aluminum	White	0.1	QM
44	001	Exterior	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
45	001	Exterior	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
46	001	Exterior	C	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
47	001	Exterior	C	Window	Rgt	Rgt casing	P	Wood	White	-0.1	QM
48	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
49	001	Exterior	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
50	001	Exterior	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
51	001	Exterior	C	Door	Ctr	U Ctr	I	Wood	White	0.0	QM
52	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.2	QM
53	001	Exterior	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
54	001	Exterior	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
55	001	Exterior	C	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
56	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
57	002	Shed	C	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	380-386 Hercules Court- Exterior
Report No.	09/04/13 08:07	
Total Readings:	57	
Job Started:	09/04/13 08:07	
Job Finished:	09/04/13 08:34	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
007	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
008	A	Fascia			I	Aluminum	White	-0.1	QM
010	A	Gutter			I	Aluminum	White	-0.1	QM
009	A	Soffit			I	Aluminum	White	-0.2	QM
015	A	Window	Lft	Sash	I	Wood	White	-0.2	QM
016	A	Window	Lft	Well	I	Vinyl	White	-0.1	QM
031	A	Window	Ctr	Sash	I	Wood	White	0.1	QM
020	A	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
011	A	Door	Lft	Lft casing	I	Wood	White	0.1	QM
012	A	Door	Lft	Lft jamb	I	Wood	White	0.1	QM
013	A	Door	Lft	U Ctr	I	Wood	White	0.0	QM
019	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
025	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
027	A	Door	Ctr	U Ctr	I	Metal	White	0.0	QM
039	A	Door	Rgt	U Lft	I	Metal	White	0.1	QM
034	A	Door	Rgt	U Ctr	I	Metal	White	-0.2	QM
014	A	PorchCeiling	Lft		I	Vinyl	White	-0.1	QM
017	A	Lintel	Lft		P	Metal	White	-0.1	QM
018	A	Lintel	Lft		I	Metal	White	-0.1	QM
	Mechanical room door.								
021	A	Fence	Lft		P	Wood	Brown	-0.2	QM
022	A	Joist	Lft		P	Wood	Brown	0.0	QM
	Carport								
023	A	Post	Lft		P	Metal	Brown	0.1	QM
	Carport								
024	A	Lintel	Lft		I	Metal	White	0.3	QM
	Mechanical room door.								
026	A	Lintel	Ctr		I	Metal	White	1.0	QM
	Mechanical room door.								
028	A	Fence	Ctr		P	Wood	Brown	0.1	QM
029	A	Joist	Ctr		P	Wood	Brown	-0.1	QM
	Carport								
030	A	Post	Ctr		P	Metal	Brown	-0.1	QM
	Carport								
032	A	Lintel	Ctr		P	Metal	White	0.0	QM
033	A	Lintel	Rgt		I	Metal	White	1.0	QM
	Mechanical room door.								
035	A	Fence	Rgt		P	Wood	Brown	0.0	QM
036	A	Joist	Rgt		P	Wood	Brown	0.0	QM
	Carport								
037	A	Posts	Rgt		P	Metal	Brown	-0.1	QM
	Carport								
038	A	Lintel	Rgt		I	Metal	White	0.0	QM
	Mechanical room door.								
040	C	Wall	U Ctr		I	Vinyl	White	-0.1	QM
041	C	Fascia			I	Aluminum	White	-0.1	QM
043	C	Gutter			I	Aluminum	White	0.1	QM
042	C	Soffit			I	Aluminum	White	-0.1	QM
047	C	Window	Rgt	Rgt casing	P	Wood	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
050	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
054	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
049	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
053	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
051	C	Door	Ctr	U Ctr	I	Wood	White	0.0	QM
055	C	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
045	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
044	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
046	C	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
Exterior Room 002 Shed									
048	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
052	C	Wall	L Ctr		P	Wood	Brown	-0.2	QM
056	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
057	C	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
Calibration Readings									
001								1.0	QM
002								1.0	QM
003								1.0	QM
004								0.1	QM
005								-0.1	QM
006								0.0	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	380-386 Hercules Court- Exterior
Report No.	09/04/13 08:07	
Total Reading Sets:	51	
Job Started:	09/04/13 08:07	
Job Finished:	09/04/13 08:34	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Lft casing	1	0	<0%>	1	<100%>	0	<0%>
Door Lft jamb	1	0	<0%>	1	<100%>	0	<0%>
Door Rgt casing	4	0	<0%>	4	<100%>	0	<0%>
Door Rgt jamb	3	0	<0%>	3	<100%>	0	<0%>
Door U Ctr	8	0	<0%>	8	<100%>	0	<0%>
Door U Lft	1	0	<0%>	1	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	3	0	<0%>	3	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joist	3	0	<0%>	3	<100%>	0	<0%>
Lintel	7	2	<29%>	5	<71%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Post	2	0	<0%>	2	<100%>	0	<0%>
Posts	1	0	<0%>	1	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	5	0	<0%>	5	<100%>	0	<0%>
Window Rgt casing	2	0	<0%>	2	<100%>	0	<0%>
Window Sash	2	0	<0%>	2	<100%>	0	<0%>
Window Well	1	0	<0%>	1	<100%>	0	<0%>
Inspection Totals:	51	2	< 4%>	49	< 96%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 15:25

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01866

PERFORMED AT: USCG Elizabeth City
Housing Units
220-226 Albatross Street- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ **Date:** 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	220-226 Albatross Street- Exterior
Report No.	09/03/13 15:25	
Total Readings:	46 Actionable: 0	
Job Started:	09/03/13 15:25	
Job Finished:	09/03/13 16:01	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	220-226 Albatross Street- Exterior
Report No.	09/03/13 15:25	
Total Readings:	46	
Job Started:	09/03/13 15:25	
Job Finished:	09/03/13 16:01	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	0.0	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	-0.3	QM
3	001	Exterior	A	Soffit			I	Aluminum	White	-0.2	QM
4	001	Exterior	A	Gutter			I	Aluminum	White	-0.2	QM
5	001	Exterior	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
6	001	Exterior	A	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
7	001	Exterior	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
8	001	Exterior	A	Window	Lft	Sash	I	Wood	White	0.0	QM
9	001	Exterior	A	Lintel	Lft		P	Metal	White	-0.1	QM
10	001	Exterior	A	PorchCeiling	Lft		I	Vinyl	White	0.0	QM
11	001	Exterior Mechanical room door.	A	Door	Lft	U Ctr	I	Metal	White	-0.1	QM
12	001	Exterior	A	Lintel	Lft		I	Metal	White	-0.1	QM
13	001	Exterior	A	Door	Lft	Rgt casing	I	Wood	White	-0.3	QM
14	001	Exterior	A	Fence	Ctr		I	Wood	Brown	0.0	QM
15	001	Exterior Carport	A	Joist	Ctr		I	Wood	Brown	-0.1	QM
16	001	Exterior Carport	A	Post	Ctr		I	Metal	Brown	-0.1	QM
17	001	Exterior Mechanical room door.	A	Lintel	Ctr		P	Metal	White	-0.1	QM
18	001	Exterior	A	Door	Ctr	U Ctr	I	Metal	White	-0.2	QM
19	001	Exterior	A	Door	Ctr	Rgt casing	P	Wood	White	-0.1	QM
20	001	Exterior	A	Fence	Rgt		I	Wood	Brown	0.0	QM
21	001	Exterior Carport	A	Joist	Rgt		I	Wood	Brown	0.0	QM
22	001	Exterior Carport	A	Post	Rgt		I	Metal	Brown	-0.1	QM
23	001	Exterior Mechanical room door.	A	Lintel	Rgt		P	Metal	White	-0.1	QM
24	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	-0.2	QM
25	001	Exterior	A	Window	Rgt	Sash	I	Wood	White	0.0	QM
26	001	Exterior	A	Lintel	Rgt		I	Metal	White	-0.1	QM
27	001	Exterior	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
28	001	Exterior	C	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
29	001	Exterior	C	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
30	001	Exterior	C	Window	Rgt	Rgt casing	P	Wood	White	-0.1	QM
31	001	Exterior	C	Wall	U Ctr		I	Vinyl	White	0.1	QM
32	001	Exterior	C	Fascia			I	Aluminum	White	0.0	QM
33	001	Exterior	C	Soffit			I	Aluminum	White	0.1	QM
34	001	Exterior	C	Gutter			I	Aluminum	White	0.1	QM
35	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
36	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
37	001	Exterior	C	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
38	001	Exterior	C	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
39	001	Exterior	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
40	001	Exterior	C	Window	Lft	Rgt casing	P	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
41		CALIBRATION								1.0	QM
42		CALIBRATION								1.0	QM
43		CALIBRATION								1.0	QM
44		CALIBRATION								0.0	QM
45		CALIBRATION								0.0	QM
46		CALIBRATION								-0.1	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	220-226 Albatross Street- Exterior
Report No.	09/03/13 15:25	
Total Readings:	46	
Job Started:	09/03/13 15:25	
Job Finished:	09/03/13 16:01	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	0.0	QM
002	A	Fascia			I	Aluminum	White	-0.3	QM
004	A	Gutter			I	Aluminum	White	-0.2	QM
003	A	Soffit			I	Aluminum	White	-0.2	QM
008	A	Window	Lft	Sash	I	Wood	White	0.0	QM
025	A	Window	Rgt	Sash	I	Wood	White	0.0	QM
006	A	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
005	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
013	A	Door	Lft	Rgt casing	I	Wood	White	-0.3	QM
007	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
011	A	Door	Lft	U Ctr	I	Metal	White	-0.1	QM
	Mechanical room door.								
019	A	Door	Ctr	Rgt casing	P	Wood	White	-0.1	QM
018	A	Door	Ctr	U Ctr	I	Metal	White	-0.2	QM
024	A	Door	Rgt	U Ctr	I	Metal	White	-0.2	QM
009	A	Lintel	Lft		P	Metal	White	-0.1	QM
010	A	PorchCeiling	Lft		I	Vinyl	White	0.0	QM
012	A	Lintel	Lft		I	Metal	White	-0.1	QM
014	A	Fence	Ctr		I	Wood	Brown	0.0	QM
015	A	Joist	Ctr		I	Wood	Brown	-0.1	QM
	Carport								
016	A	Post	Ctr		I	Metal	Brown	-0.1	QM
	Carport								
017	A	Lintel	Ctr		P	Metal	White	-0.1	QM
	Mechanical room door.								
020	A	Fence	Rgt		I	Wood	Brown	0.0	QM
021	A	Joist	Rgt		I	Wood	Brown	0.0	QM
	Carport								
022	A	Post	Rgt		I	Metal	Brown	-0.1	QM
	Carport								
023	A	Lintel	Rgt		P	Metal	White	-0.1	QM
	Mechanical room door.								
026	A	Lintel	Rgt		I	Metal	White	-0.1	QM
031	C	Wall	U Ctr		I	Vinyl	White	0.1	QM
032	C	Fascia			I	Aluminum	White	0.0	QM
034	C	Gutter			I	Aluminum	White	0.1	QM
033	C	Soffit			I	Aluminum	White	0.1	QM
040	C	Window	Lft	Rgt casing	P	Wood	White	-0.1	QM
030	C	Window	Rgt	Rgt casing	P	Wood	White	-0.1	QM
038	C	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
037	C	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
039	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
028	C	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
027	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
029	C	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
Exterior Room 002 Shed									
035	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
036	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
041								1.0	QM
042								1.0	QM
043								1.0	QM
044								0.0	QM
045								0.0	QM
046								-0.1	QM
			---- End of Readings ----						

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	220-226 Albatross Street- Exterior
Report No.	09/03/13 15:25	
Total Reading Sets:	40	
Job Started:	09/03/13 15:25	
Job Finished:	09/03/13 16:01	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	5	0	<0%>	5	<100%>	0	<0%>
Door Rgt jamb	3	0	<0%>	3	<100%>	0	<0%>
Door U Ctr	6	0	<0%>	6	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	2	0	<0%>	2	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joist	2	0	<0%>	2	<100%>	0	<0%>
Lintel	5	0	<0%>	5	<100%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Post	2	0	<0%>	2	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	4	0	<0%>	4	<100%>	0	<0%>
Window Rgt casing	2	0	<0%>	2	<100%>	0	<0%>
Window Sash	2	0	<0%>	2	<100%>	0	<0%>
Inspection Totals:	40	0	<0%>	40	<100%>	0	<0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 14:41

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
340-350 Pelican Street- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ Date: 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	340-350 Pelican Street- Exterior
Report No.	09/03/13 14:41	
Total Readings:	35 Actionable: 0	
Job Started:	09/03/13 14:41	
Job Finished:	09/03/13 15:07	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	340-350 Pelican Street- Exterior
Report No.	09/03/13 14:41	
Total Readings:	35	
Job Started:	09/03/13 14:41	
Job Finished:	09/03/13 15:07	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	-0.1	QM
002	A	Fascia			I	Aluminum	White	-0.1	QM
003	A	Gutter			I	Aluminum	White	-0.2	QM
004	A	Soffit			I	Aluminum	White	-0.2	QM
018	A	Window	Lft	Sash	P	Wood	Brown	-0.1	QM
009	A	Window	Rgt	Sash	I	Wood	White	0.1	QM
010	A	Window	Rgt	Well	I	Vinyl	White	-0.3	QM
020	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
	Mechanical room door.								
006	A	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
005	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
013	A	Door	Rgt	Rgt casing	I	Metal	White	0.0	QM
007	A	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
014	A	Door	Rgt	U Ctr	I	Metal	White	-0.1	QM
019	A	Lintel	Lft		P	Metal	Brown	-0.2	QM
021	A	Lintel	Lft		I	Metal	White	-0.1	QM
022	A	Post	Lft		P	Metal	Brown	0.0	QM
	Carport								
008	A	PorchCeiling	Rgt		I	Vinyl	White	0.0	QM
011	A	Lintel	Rgt		I	Metal	White	-0.1	QM
012	A	Lintel	Rgt		I	Metal	White	-0.1	QM
	Mechanical room door.								
015	A	Fence	Rgt		P	Wood	Brown	-0.1	QM
016	A	Joist	Rgt		P	Wood	Brown	0.1	QM
	Carport								
017	A	Post	Rgt		P	Metal	Brown	-0.1	QM
	Carport								
023	C	Wall	U Ctr		I	Vinyl	White	-0.1	QM
024	C	Fascia			I	Aluminum	White	0.0	QM
026	C	Gutter			I	Aluminum	White	-0.1	QM
025	C	Soffit			I	Aluminum	White	-0.2	QM
030	C	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
034	C	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
033	C	Door	Lft	Rgt casing	I	Wood	White	0.1	QM
035	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
028	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
027	C	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
029	C	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
Exterior Room 002 Shed									
031	C	Wall	L Ctr		P	Wood	Brown	0.1	QM
032	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	340-350 Pelican Street- Exterior
Report No.	09/03/13 14:41	
Total Reading Sets:	35	
Job Started:	09/03/13 14:41	
Job Finished:	09/03/13 15:07	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	4	0	<0%>	4	<100%>	0	<0%>
Door Rgt jamb	3	0	<0%>	3	<100%>	0	<0%>
Door U Ctr	5	0	<0%>	5	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	1	0	<0%>	1	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joist	1	0	<0%>	1	<100%>	0	<0%>
Lintel	4	0	<0%>	4	<100%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Post	2	0	<0%>	2	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	4	0	<0%>	4	<100%>	0	<0%>
Window Rgt casing	1	0	<0%>	1	<100%>	0	<0%>
Window Sash	2	0	<0%>	2	<100%>	0	<0%>
Window Well	1	0	<0%>	1	<100%>	0	<0%>
Inspection Totals:	35	0	< 0%>	35	<100%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 15:07

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01866

PERFORMED AT: USCG Elizabeth City
Housing Units
240-250 Albatross Street- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ **Date:** 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	240-250 Albatross Street- Exterior
Report No.	09/03/13 15:07	
Total Readings:	42 Actionable: 0	
Job Started:	09/03/13 15:07	
Job Finished:	09/03/13 15:24	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/9/2013
Abatement Level: 1.0
Report No. 09/03/13 15:07
Total Readings: 42
Job Started: 09/03/13 15:07
Job Finished: 09/03/13 15:24

USCG Elizabeth City
Housing Units
240-250 Albatross Street- Exterior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	0.0	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	0.1	QM
3	001	Exterior	A	Soffit			I	Aluminum	White	-0.2	QM
4	001	Exterior	A	Gutter			I	Aluminum	White	-0.1	QM
5	001	Exterior	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
6	001	Exterior	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
7	001	Exterior	A	Door	Rgt	U Lft	I	Wood	White	-0.1	QM
8	001	Exterior	A	PorchCeiling	Rgt		I	Vinyl	White	-0.1	QM
9	001	Exterior	A	Window	Ctr	Sash	I	Wood	White	-0.2	QM
10	001	Exterior	A	Lintel	Ctr		I	Metal	White	0.0	QM
11	001	Exterior	A	Lintel	Rgt		I	Metal	White	0.0	QM
		Mechanical room door.									
12	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	-0.1	QM
13	001	Exterior	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
14	001	Exterior	A	Fence	Rgt		P	Wood	Brown	-0.1	QM
15	001	Exterior	A	Joist	Rgt		P	Wood	Brown	-0.1	QM
		Carport									
16	001	Exterior	A	Post	Rgt		P	Metal	Brown	-0.3	QM
		Carport									
17	001	Exterior	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
18	001	Exterior	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
19	001	Exterior	C	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
20	001	Exterior	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
21	001	Exterior	C	Lintel	Ctr		I	Metal	White	-0.1	QM
22	001	Exterior	A	Fence	Lft		P	Wood	Brown	-0.1	QM
23	001	Exterior	A	Joist	Lft		P	Wood	Brown	-0.1	QM
		Carport									
24	001	Exterior	A	Post	Lft		P	Metal	Brown	0.0	QM
		Carport									
25	001	Exterior	A	Lintel	Lft		I	Metal	White	-0.1	QM
		Mechanical room door.									
26	001	Exterior	A	Door	Lft	U Ctr	I	Metal	White	-0.1	QM
27	001	Exterior	A	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
28	001	Exterior	A	Window	Lft	Sash	P	Wood	White	-0.2	QM
29	001	Exterior	C	Wall	U Ctr		I	Vinyl	White	0.0	QM
30	001	Exterior	C	Fascia			I	Aluminum	White	-0.1	QM
31	001	Exterior	C	Soffit			I	Aluminum	White	-0.1	QM
32	001	Exterior	C	Gutter			I	Aluminum	White	0.1	QM
33	001	Exterior	C	Door	Ctr	Rgt casing	I	Wood	White	0.1	QM
34	001	Exterior	C	Door	Ctr	Rgt jamb	I	Wood	White	0.1	QM
35	001	Exterior	C	Door	Ctr	U Lft	I	Wood	White	-0.1	QM
36	001	Exterior	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
37	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
38	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
39	002	Shed	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
40	002	Shed	C	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
41	002	Shed	C	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
42	002	Shed	C	Door	Lft	U Ctr	I	Wood	White	0.0	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	240-250 Albatross Street- Exterior
Report No.	09/03/13 15:07	
Total Readings:	42	
Job Started:	09/03/13 15:07	
Job Finished:	09/03/13 15:24	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	0.0	QM
002	A	Fascia			I	Aluminum	White	0.1	QM
004	A	Gutter			I	Aluminum	White	-0.1	QM
003	A	Soffit			I	Aluminum	White	-0.2	QM
028	A	Window	Lft	Sash	P	Wood	White	-0.2	QM
009	A	Window	Ctr	Sash	I	Wood	White	-0.2	QM
027	A	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
026	A	Door	Lft	U Ctr	I	Metal	White	-0.1	QM
006	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
005	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
013	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
007	A	Door	Rgt	U Lft	I	Wood	White	-0.1	QM
012	A	Door	Rgt	U Ctr	I	Metal	White	-0.1	QM
022	A	Fence	Lft		P	Wood	Brown	-0.1	QM
023	A	Joist	Lft		P	Wood	Brown	-0.1	QM
	Carport								
024	A	Post	Lft		P	Metal	Brown	0.0	QM
	Carport								
025	A	Lintel	Lft		I	Metal	White	-0.1	QM
	Mechanical room door.								
010	A	Lintel	Ctr		I	Metal	White	0.0	QM
008	A	PorchCeiling	Rgt		I	Vinyl	White	-0.1	QM
011	A	Lintel	Rgt		I	Metal	White	0.0	QM
	Mechanical room door.								
014	A	Fence	Rgt		P	Wood	Brown	-0.1	QM
015	A	Joist	Rgt		P	Wood	Brown	-0.1	QM
	Carport								
016	A	Post	Rgt		P	Metal	Brown	-0.3	QM
	Carport								
029	C	Wall	U Ctr		I	Vinyl	White	0.0	QM
030	C	Fascia			I	Aluminum	White	-0.1	QM
032	C	Gutter			I	Aluminum	White	0.1	QM
031	C	Soffit			I	Aluminum	White	-0.1	QM
036	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
020	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
018	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
034	C	Door	Ctr	Rgt jamb	I	Wood	White	0.1	QM
017	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
033	C	Door	Ctr	Rgt casing	I	Wood	White	0.1	QM
035	C	Door	Ctr	U Lft	I	Wood	White	-0.1	QM
019	C	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
021	C	Lintel	Ctr		I	Metal	White	-0.1	QM
Exterior Room 002 Shed									
037	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
038	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
039	C	Wall	L Ctr		P	Wood	Brown	-0.1	QM
041	C	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
040	C	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
042	C	Door	Lft	U Ctr	I	Wood	White	0.0	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	240-250 Albatross Street- Exterior
Report No.	09/03/13 15:07	
Total Reading Sets:	42	
Job Started:	09/03/13 15:07	
Job Finished:	09/03/13 15:24	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	6	0	<0%>	6	<100%>	0	<0%>
Door Rgt jamb	4	0	<0%>	4	<100%>	0	<0%>
Door U Ctr	4	0	<0%>	4	<100%>	0	<0%>
Door U Lft	2	0	<0%>	2	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	2	0	<0%>	2	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joist	2	0	<0%>	2	<100%>	0	<0%>
Lintel	4	0	<0%>	4	<100%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Post	2	0	<0%>	2	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	5	0	<0%>	5	<100%>	0	<0%>
Window Rgt casing	1	0	<0%>	1	<100%>	0	<0%>
Window Sash	3	0	<0%>	3	<100%>	0	<0%>
Inspection Totals:	42	0	< 0%>	42	<100%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 13:39

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01866

PERFORMED AT: USCG Elizabeth City
Housing Units
271-281 Mariner Court- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 120126

SIGNED: _____ **Date:** 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	271-281 Mariner Court- Exterior
Report No.	09/03/13 13:39	
Total Readings:	42 Actionable: 0	
Job Started:	09/03/13 13:39	
Job Finished:	09/03/13 13:57	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	271-281 Mariner Court- Exterior
Report No.	09/03/13 13:39	
Total Readings:	42	
Job Started:	09/03/13 13:39	
Job Finished:	09/03/13 13:57	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	-0.2	QM
3	001	Exterior	A	Gutter			I	Aluminum	White	-0.2	QM
4	001	Exterior	A	Soffit			I	Aluminum	White	-0.1	QM
5	001	Exterior	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
6	001	Exterior	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
7	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	-0.2	QM
8	001	Exterior	A	Side Lite	Rgt		I	Wood	White	-0.1	QM
9	001	Exterior	A	Window	Rgt	Sash	I	Wood	White	-0.2	QM
10	001	Exterior	A	Window	Rgt	Well	I	Vinyl	White	-0.2	QM
11	001	Exterior	A	Lintel	Rgt		I	Metal	White	-0.2	QM
		Mechanical room door.									
12	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	0.0	QM
13	001	Exterior	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
14	001	Exterior	A	Fence	Rgt		P	Wood	Yellow	-0.1	QM
15	001	Exterior	A	Post	Rgt		P	Metal	Yellow	0.0	QM
		Carport									
16	001	Exterior	A	Lintel	Ctr		P	Metal	White	-0.1	QM
		Mechanical room door.									
17	001	Exterior	A	Door	Ctr	U Ctr	P	Metal	White	0.0	QM
18	001	Exterior	A	Fence	Ctr		P	Wood	Yellow	0.0	QM
19	001	Exterior	A	Post	Ctr		P	Metal	Yellow	0.4	QM
		Carport									
20	001	Exterior	A	Lintel	Lft		P	Metal	White	0.0	QM
21	001	Exterior	A	Fence	Rgt		P	Wood	Yellow	0.2	QM
22	001	Exterior	A	Joist	Rgt		P	Wood	Yellow	-0.1	QM
		Carport									
23	001	Exterior	A	Post	Rgt		P	Metal	Yellow	-0.1	QM
		Carport									
24	001	Exterior	C	Wall	U Ctr		I	Vinyl	White	-0.1	QM
25	001	Exterior	C	Fascia			I	Aluminum	White	-0.1	QM
26	001	Exterior	C	Soffit			I	Aluminum	White	-0.1	QM
27	001	Exterior	C	Gutter			I	Aluminum	White	-0.1	QM
28	001	Exterior	C	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
29	001	Exterior	C	Door	Lft	Rgt jamb	P	Wood	White	-0.1	QM
30	001	Exterior	C	Door	Lft	U Ctr	P	Wood	White	-0.2	QM
31	001	Exterior	C	Window	Lft	Sash	P	Wood	White	-0.3	QM
32	002	Shed	C	Wall	L Ctr		P	Wood	Yellow	0.0	QM
33	002	Shed	C	Wall	L Lft		P	Wood	Yellow	-0.1	QM
34	002	Shed	C	Wall	L Rgt		P	Wood	Yellow	-0.2	QM
35	001	Exterior	C	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
36	001	Exterior	C	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
37	001	Exterior	C	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
38	001	Exterior	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
39	001	Exterior	C	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
40	001	Exterior	C	Window	Rgt	Rgt casing	I	Wood	White	0.0	QM
41	001	Exterior	C	Window	Rgt	Sash	I	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
42	001	Exterior	C	Window	Lft	Rgt casing	I	Wood	White	-0.2	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/9/2013
Abatement Level: 1.0
Report No. 09/03/13 13:39
Total Readings: 42
Job Started: 09/03/13 13:39
Job Finished: 09/03/13 13:57

USCG Elizabeth City
Housing Units
271-281 Mariner Court- Exterior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
002	A	Fascia			I	Aluminum	White	-0.2	QM
003	A	Gutter			I	Aluminum	White	-0.2	QM
004	A	Soffit			I	Aluminum	White	-0.1	QM
009	A	Window	Rgt	Sash	I	Wood	White	-0.2	QM
010	A	Window	Rgt	Well	I	Vinyl	White	-0.2	QM
017	A	Door	Ctr	U Ctr	P	Metal	White	0.0	QM
006	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
005	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
013	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
007	A	Door	Rgt	U Ctr	I	Metal	White	-0.2	QM
012	A	Door	Rgt	U Ctr	I	Metal	White	0.0	QM
020	A	Lintel	Lft		P	Metal	White	0.0	QM
016	A	Lintel	Ctr		P	Metal	White	-0.1	QM
	Mechanical room door.								
018	A	Fence	Ctr		P	Wood	Yellow	0.0	QM
019	A	Post	Ctr		P	Metal	Yellow	0.4	QM
	Carport								
008	A	Side Lite	Rgt		I	Wood	White	-0.1	QM
011	A	Lintel	Rgt		I	Metal	White	-0.2	QM
	Mechanical room door.								
014	A	Fence	Rgt		P	Wood	Yellow	-0.1	QM
015	A	Post	Rgt		P	Metal	Yellow	0.0	QM
	Carport								
021	A	Fence	Rgt		P	Wood	Yellow	0.2	QM
022	A	Joist	Rgt		P	Wood	Yellow	-0.1	QM
	Carport								
023	A	Post	Rgt		P	Metal	Yellow	-0.1	QM
	Carport								
024	C	Wall	U Ctr		I	Vinyl	White	-0.1	QM
025	C	Fascia			I	Aluminum	White	-0.1	QM
027	C	Gutter			I	Aluminum	White	-0.1	QM
026	C	Soffit			I	Aluminum	White	-0.1	QM
042	C	Window	Lft	Rgt casing	I	Wood	White	-0.2	QM
031	C	Window	Lft	Sash	P	Wood	White	-0.3	QM
040	C	Window	Rgt	Rgt casing	I	Wood	White	0.0	QM
041	C	Window	Rgt	Sash	I	Wood	White	-0.1	QM
029	C	Door	Lft	Rgt jamb	P	Wood	White	-0.1	QM
036	C	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
028	C	Door	Lft	Rgt casing	P	Wood	White	-0.1	QM
030	C	Door	Lft	U Ctr	P	Wood	White	-0.2	QM
035	C	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
037	C	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
038	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
039	C	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
Exterior Room 002 Shed									
033	C	Wall	L Lft		P	Wood	Yellow	-0.1	QM
032	C	Wall	L Ctr		P	Wood	Yellow	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
034	C	Wall	L Rgt		P	Wood	Yellow	-0.2	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	271-281 Mariner Court- Exterior
Report No.	09/03/13 13:39	
Total Reading Sets:	42	
Job Started:	09/03/13 13:39	
Job Finished:	09/03/13 13:57	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	4	0	<0%>	4	<100%>	0	<0%>
Door Rgt jamb	4	0	<0%>	4	<100%>	0	<0%>
Door U Ctr	6	0	<0%>	6	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	3	0	<0%>	3	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joist	1	0	<0%>	1	<100%>	0	<0%>
Lintel	3	0	<0%>	3	<100%>	0	<0%>
Post	3	0	<0%>	3	<100%>	0	<0%>
Side Lite	1	0	<0%>	1	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	5	0	<0%>	5	<100%>	0	<0%>
Window Rgt casing	2	0	<0%>	2	<100%>	0	<0%>
Window Sash	3	0	<0%>	3	<100%>	0	<0%>
Window Well	1	0	<0%>	1	<100%>	0	<0%>
Inspection Totals:	42	0	< 0%>	42	<100%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 14:18

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA

PERFORMED AT: USCG Elizabeth City
Housing Units
370-376 Mariner Court- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ Date: 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	370-376 Mariner Court- Exterior
Report No.	09/03/13 14:18	
Total Readings:	29 Actionable: 0	
Job Started:	09/03/13 14:18	
Job Finished:	09/03/13 14:30	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	370-376 Mariner Court- Exterior
Report No.	09/03/13 14:18	
Total Readings:	29	
Job Started:	09/03/13 14:18	
Job Finished:	09/03/13 14:30	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	-0.2	QM
3	001	Exterior	A	Gutter			I	Aluminum	White	-0.1	QM
4	001	Exterior	A	Soffit			I	Aluminum	White	0.0	QM
5	001	Exterior	A	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
6	001	Exterior	A	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
7	001	Exterior	A	Door	Ctr	U Lft	I	Metal	White	-0.1	QM
8	001	Exterior	A	Window	Ctr	Sash	I	Wood	White	-0.2	QM
9	001	Exterior	A	Window	Ctr	Well	I	Vinyl	White	-0.1	QM
10	001	Exterior	A	PorchCeiling	Ctr		I	Vinyl	White	-0.2	QM
11	001	Exterior	A	Fence	Lft		P	Wood	Brown	-0.2	QM
12	001	Exterior Carport	A	Post	Lft		P	Metal	Brown	-0.2	QM
13	001	Exterior Mechanical room door.	A	Lintel	Lft		P	Metal	White	0.0	QM
14	001	Exterior	A	Door	Lft	U Ctr	P	Metal	White	-0.1	QM
15	001	Exterior	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
16	001	Exterior	A	Fence	Rgt		I	Wood	Tan	0.0	QM
17	001	Exterior Mechanical room door.	A	Lintel	Rgt		I	Metal	White	0.2	QM
18	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	0.0	QM
19	001	Exterior	A	Side Lite	Rgt		I	Wood	White	-0.2	QM
20	001	Exterior	C	Wall	U Ctr		I	Vinyl	White	-0.3	QM
21	001	Exterior	C	Fascia			I	Aluminum	White	-0.2	QM
22	001	Exterior	C	Soffit			I	Aluminum	White	-0.2	QM
23	001	Exterior	C	Gutter			I	Aluminum	White	-0.1	QM
24	001	Exterior	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
25	001	Exterior	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
26	001	Exterior	C	Door	Ctr	U Rgt	I	Wood	White	-0.1	QM
27	001	Exterior	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
28	002	Shed	C	Wall	L Lft		P	Wood	Yellow	-0.1	QM
29	002	Shed	C	Wall	L Rgt		P	Wood	Yellow	-0.2	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	370-376 Mariner Court- Exterior
Report No.	09/03/13 14:18	
Total Readings:	29	
Job Started:	09/03/13 14:18	
Job Finished:	09/03/13 14:30	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
002	A	Fascia			I	Aluminum	White	-0.2	QM
003	A	Gutter			I	Aluminum	White	-0.1	QM
004	A	Soffit			I	Aluminum	White	0.0	QM
008	A	Window	Ctr	Sash	I	Wood	White	-0.2	QM
009	A	Window	Ctr	Well	I	Vinyl	White	-0.1	QM
015	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
014	A	Door	Lft	U Ctr	P	Metal	White	-0.1	QM
006	A	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
005	A	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
007	A	Door	Ctr	U Lft	I	Metal	White	-0.1	QM
018	A	Door	Rgt	U Ctr	I	Metal	White	0.0	QM
011	A	Fence	Lft		P	Wood	Brown	-0.2	QM
012	A	Post	Lft		P	Metal	Brown	-0.2	QM
	Carport								
013	A	Lintel	Lft		P	Metal	White	0.0	QM
	Mechanical room door.								
010	A	PorchCeiling	Ctr		I	Vinyl	White	-0.2	QM
016	A	Fence	Rgt		I	Wood	Tan	0.0	QM
017	A	Lintel	Rgt		I	Metal	White	0.2	QM
	Mechanical room door.								
019	A	Side Lite	Rgt		I	Wood	White	-0.2	QM
020	C	Wall	U Ctr		I	Vinyl	White	-0.3	QM
021	C	Fascia			I	Aluminum	White	-0.2	QM
023	C	Gutter			I	Aluminum	White	-0.1	QM
022	C	Soffit			I	Aluminum	White	-0.2	QM
027	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
025	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
024	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
026	C	Door	Ctr	U Rgt	I	Wood	White	-0.1	QM
Exterior Room 002 Shed									
028	C	Wall	L Lft		P	Wood	Yellow	-0.1	QM
029	C	Wall	L Rgt		P	Wood	Yellow	-0.2	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	370-376 Mariner Court- Exterior
Report No.	09/03/13 14:18	
Total Reading Sets:	29	
Job Started:	09/03/13 14:18	
Job Finished:	09/03/13 14:30	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	3	0	<0%>	3	<100%>	0	<0%>
Door Rgt jamb	2	0	<0%>	2	<100%>	0	<0%>
Door U Ctr	2	0	<0%>	2	<100%>	0	<0%>
Door U Lft	1	0	<0%>	1	<100%>	0	<0%>
Door U Rgt	1	0	<0%>	1	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	2	0	<0%>	2	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Lintel	2	0	<0%>	2	<100%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Post	1	0	<0%>	1	<100%>	0	<0%>
Side Lite	1	0	<0%>	1	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	4	0	<0%>	4	<100%>	0	<0%>
Window Sash	2	0	<0%>	2	<100%>	0	<0%>
Window Well	1	0	<0%>	1	<100%>	0	<0%>
Inspection Totals:	29	0	< 0%>	29	<100%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 13:58

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
388-394 Hercules Court- Exterior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ Date: 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	388-394 Hercules Court- Exterior
Report No.	09/03/13 13:58	
Total Readings:	36 Actionable: 1	
Job Started:	09/03/13 13:58	
Job Finished:	09/03/13 14:16	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
016	A	Lintel	Rgt		P	Metal	White	1.0	QM
	Mechanical room door.								

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	388-394 Hercules Court- Exterior
Report No.	09/03/13 13:58	
Total Readings:	36	
Job Started:	09/03/13 13:58	
Job Finished:	09/03/13 14:16	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Exterior	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
2	001	Exterior	A	Fascia			I	Aluminum	White	-0.2	QM
3	001	Exterior	A	Soffit			I	Aluminum	White	-0.1	QM
4	001	Exterior	A	Gutter			I	Aluminum	White	-0.1	QM
5	001	Exterior	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
6	001	Exterior	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
7	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	-0.2	QM
8	001	Exterior	A	Side Lite	Rgt		I	Wood	White	-0.2	QM
9	001	Exterior	A	PorchCeiling	Rgt		I	Vinyl	White	-0.1	QM
10	001	Exterior	A	Window	Rgt	Sash	I	Wood	White	-0.1	QM
11	001	Exterior	A	Window	Rgt	Well	I	Vinyl	White	0.0	QM
12	001	Exterior	A	Lintel	Rgt		I	Metal	White	-0.1	QM
		Mechanical room door.									
13	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	0.0	QM
14	001	Exterior	A	Door	Rgt	Rgt casing	I	Metal	White	-0.2	QM
15	001	Exterior	A	Fence	Rgt		P	Wood	Yellow	-0.1	QM
16	001	Exterior	A	Lintel	Rgt		P	Metal	White	1.0	QM
		Mechanical room door.									
17	001	Exterior	A	Door	Rgt	U Ctr	I	Metal	White	0.0	QM
18	001	Exterior	A	Door	Rgt	Rgt casing	I	Metal	White	0.0	QM
19	001	Exterior	A	Fence	Rgt		P	Wood	Yellow	0.0	QM
20	001	Exterior	A	Joist	Rgt		P	Wood	Yellow	0.0	QM
		Carport									
21	001	Exterior	A	Post	Rgt		P	Metal	Yellow	-0.2	QM
		Carport									
22	001	Exterior	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
23	001	Exterior	A	Fence	Lft		P	Wood	Yellow	0.0	QM
24	001	Exterior	A	Joist	Lft		P	Wood	Yellow	0.0	QM
		Carport									
25	001	Exterior	A	Post	Lft		P	Metal	Yellow	-0.3	QM
		Carport									
26	001	Exterior	A	Side Lite	Ctr		I	Wood	White	-0.2	QM
27	001	Exterior	A	Side Lite	Lft		I	Wood	White	-0.1	QM
28	001	Exterior	C	Wall	U Ctr		I	Vinyl	White	-0.2	QM
29	001	Exterior	C	Fascia			I	Aluminum	White	-0.1	QM
30	001	Exterior	C	Gutter			I	Aluminum	White	-0.1	QM
31	001	Exterior	C	Soffit			I	Aluminum	White	0.0	QM
32	001	Exterior	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
33	001	Exterior	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
34	001	Exterior	C	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
35	001	Exterior	C	Window	Rgt	Sash	P	Wood	White	-0.1	QM
36	002	Shed	C	Wall	L Ctr		P	Wood	Yellow	-0.1	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	388-394 Hercules Court- Exterior
Report No.	09/03/13 13:58	
Total Readings:	36	
Job Started:	09/03/13 13:58	
Job Finished:	09/03/13 14:16	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Exterior									
001	A	Wall	U Ctr		I	Vinyl	White	-0.2	QM
002	A	Fascia			I	Aluminum	White	-0.2	QM
004	A	Gutter			I	Aluminum	White	-0.1	QM
003	A	Soffit			I	Aluminum	White	-0.1	QM
010	A	Window	Rgt	Sash	I	Wood	White	-0.1	QM
011	A	Window	Rgt	Well	I	Vinyl	White	0.0	QM
022	A	Door	Lft	U Ctr	I	Metal	White	0.0	QM
006	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
005	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
014	A	Door	Rgt	Rgt casing	I	Metal	White	-0.2	QM
018	A	Door	Rgt	Rgt casing	I	Metal	White	0.0	QM
007	A	Door	Rgt	U Ctr	I	Metal	White	-0.2	QM
013	A	Door	Rgt	U Ctr	I	Metal	White	0.0	QM
017	A	Door	Rgt	U Ctr	I	Metal	White	0.0	QM
023	A	Fence	Lft		P	Wood	Yellow	0.0	QM
024	A	Joist	Lft		P	Wood	Yellow	0.0	QM
	Carport								
025	A	Post	Lft		P	Metal	Yellow	-0.3	QM
	Carport								
027	A	Side Lite	Lft		I	Wood	White	-0.1	QM
026	A	Side Lite	Ctr		I	Wood	White	-0.2	QM
008	A	Side Lite	Rgt		I	Wood	White	-0.2	QM
009	A	PorchCeiling	Rgt		I	Vinyl	White	-0.1	QM
012	A	Lintel	Rgt		I	Metal	White	-0.1	QM
	Mechanical room door.								
015	A	Fence	Rgt		P	Wood	Yellow	-0.1	QM
016	A	Lintel	Rgt		P	Metal	White	1.0	QM
	Mechanical room door.								
019	A	Fence	Rgt		P	Wood	Yellow	0.0	QM
020	A	Joist	Rgt		P	Wood	Yellow	0.0	QM
	Carport								
021	A	Post	Rgt		P	Metal	Yellow	-0.2	QM
	Carport								
028	C	Wall	U Ctr		I	Vinyl	White	-0.2	QM
029	C	Fascia			I	Aluminum	White	-0.1	QM
030	C	Gutter			I	Aluminum	White	-0.1	QM
031	C	Soffit			I	Aluminum	White	0.0	QM
035	C	Window	Rgt	Sash	P	Wood	White	-0.1	QM
033	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
032	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
034	C	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
Exterior Room 002 Shed									
036	C	Wall	L Ctr		P	Wood	Yellow	-0.1	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	270-276 Gulfstream Drive- Exterior
Report No.	09/03/13 13:58	
Total Reading Sets:	36	
Job Started:	09/03/13 13:58	
Job Finished:	09/03/13 14:16	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Door Rgt casing	4	0	<0%>	4	<100%>	0	<0%>
Door Rgt jamb	2	0	<0%>	2	<100%>	0	<0%>
Door U Ctr	5	0	<0%>	5	<100%>	0	<0%>
Fascia	2	0	<0%>	2	<100%>	0	<0%>
Fence	3	0	<0%>	3	<100%>	0	<0%>
Gutter	2	0	<0%>	2	<100%>	0	<0%>
Joist	2	0	<0%>	2	<100%>	0	<0%>
Lintel	2	1	<50%>	1	<50%>	0	<0%>
PorchCeiling	1	0	<0%>	1	<100%>	0	<0%>
Post	2	0	<0%>	2	<100%>	0	<0%>
Side Lite	3	0	<0%>	3	<100%>	0	<0%>
Soffit	2	0	<0%>	2	<100%>	0	<0%>
Wall	3	0	<0%>	3	<100%>	0	<0%>
Window Sash	2	0	<0%>	2	<100%>	0	<0%>
Window Well	1	0	<0%>	1	<100%>	0	<0%>
Inspection Totals:	36	1	< 3%>	35	< 97%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 08:35

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
Paving Markings, Playground, and
Gazebo

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ **Date:** 9/9/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	
Report No.	09/04/13 08:35	
Total Readings:	28 Actionable: 9	
Job Started:	09/04/13 08:35	
Job Finished:	09/04/13 09:07	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Albatross									
003	A	Speedbump	Ctr		P	Concrete	Yellow	3.1	QM
	Albatross St.								
Exterior Room 002 Pelican									
007	A	Curb	Ctr		P	Concrete	White	1.7	QM
	Pelican St.								
008	A	Curb	Ctr		P	Concrete	Red	1.0	QM
	Pelican St.								
009	A	FireHydrant	Ctr		P	Metal	Yellow	1.8	QM
	Pelican St.								
Exterior Room 003 Marlin									
013	A	Speedbump	Ctr		P	Concrete	Yellow	1.0	QM
	Marlin St.								
Exterior Room 004 Gulfstream									
016	A	Curb	Ctr		P	Concrete	White	1.5	QM
	Gulfstream Dr.								
018	A	Speedbump	Ctr		P	Concrete	Yellow	2.7	QM
	Gulfstream Dr.								
020	A	MailBxPost	Ctr		P	Metal	Black	1.0	QM
	287 Gulfstream Dr.								
Exterior Room 005 Playground									
022	A	Equipment	Ctr		I	Metal	Yellow	1.0	QM
	Older looking metal								

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	
Report No.	09/04/13 08:35	
Total Readings:	28	
Job Started:	09/04/13 08:35	
Job Finished:	09/04/13 09:07	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Albatross Playground	A	Curb	Ctr		P	Concrete	White	-0.1	QM
2	001	Albatross Albatross St.	A	Curb	Ctr		P	Concrete	Red	-0.1	QM
3	001	Albatross Albatross St.	A	Speedbump	Ctr		P	Concrete	Yellow	3.1	QM
4	001	Albatross 210 Albatross St.	A	MailBxPost	Ctr		P	Metal	Black	0.0	QM
5	001	Albatross Albatross St.	A	FireHydrant	Ctr		P	Metal	Yellow	0.2	QM
6	001	Albatross 210 Albatross St.	A	Transformer	Ctr		I	Metal	Green	0.4	QM
7	002	Pelican Pelican St.	A	Curb	Ctr		P	Concrete	White	1.7	QM
8	002	Pelican Pelican St.	A	Curb	Ctr		P	Concrete	Red	1.0	QM
9	002	Pelican Pelican St.	A	FireHydrant	Ctr		P	Metal	Yellow	1.8	QM
10	002	Pelican 348 Pelican St.	A	MailBxPost	Ctr		P	Metal	Black	-0.1	QM
11	003	Marlin Marlin St.	A	Curb	Ctr		P	Concrete	White	-0.1	QM
12	003	Marlin Marlin St.	A	Curb	Ctr		P	Concrete	Red	0.0	QM
13	003	Marlin Marlin St.	A	Speedbump	Ctr		P	Concrete	Yellow	1.0	QM
14	003	Marlin Beside Speedbumps	A	Fence	Ctr		P	Wood	White	-0.1	QM
15	003	Marlin 374 Mariner Ct.	A	MailBxPost	Ctr		P	Metal	Black	-0.1	QM
16	004	Gulfstream Gulfstream Dr.	A	Curb	Ctr		P	Concrete	White	1.5	QM
17	004	Gulfstream Gulfstream Dr.	A	Curb	Ctr		P	Concrete	Red	-0.2	QM
18	004	Gulfstream Gulfstream Dr.	A	Speedbump	Ctr		P	Concrete	Yellow	2.7	QM
19	004	Gulfstream 287 Gulfstream Dr.	A	FireHydrant	Ctr		P	Metal	Yellow	0.1	QM
20	004	Gulfstream 287 Gulfstream Dr.	A	MailBxPost	Ctr		P	Metal	Black	1.0	QM
21	005	Playground	A	Equipment	Ctr		I	Metal	White	0.0	QM
22	005	Playground Older looking metal	A	Equipment	Ctr		I	Metal	Yellow	1.0	QM
23	005	Playground	A	Equipment	Ctr		I	Metal	Blue	-0.1	QM
24	005	Playground	A	Equipment	Ctr		I	Metal	Red	-0.1	QM
25	005	Playground	A	SwingSet	Ctr		I	Metal	Yellow	-0.1	QM
26	005	Playground	A	SwingSet	Ctr		I	Metal	Blue	0.0	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
27	005	Playground	A	Slide	Ctr		I	Metal	Purple	-0.1	QM
28	006	Gazebo	A	Structure	Ctr		I	Wood	Varnish	-0.1	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	
Report No.	09/04/13 08:35	
Total Readings:	28	
Job Started:	09/04/13 08:35	
Job Finished:	09/04/13 09:07	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Albatross									
001	A	Curb Playground	Ctr		P	Concrete	White	-0.1	QM
002	A	Curb Albatross St.	Ctr		P	Concrete	Red	-0.1	QM
003	A	Speedbump Albatross St.	Ctr		P	Concrete	Yellow	3.1	QM
004	A	MailBxPost 210 Albatross St.	Ctr		P	Metal	Black	0.0	QM
005	A	FireHydrant Albatross St.	Ctr		P	Metal	Yellow	0.2	QM
006	A	Transformer 210 Albatross St.	Ctr		I	Metal	Green	0.4	QM
Exterior Room 002 Pelican									
007	A	Curb Pelican St.	Ctr		P	Concrete	White	1.7	QM
008	A	Curb Pelican St.	Ctr		P	Concrete	Red	1.0	QM
009	A	FireHydrant Pelican St.	Ctr		P	Metal	Yellow	1.8	QM
010	A	MailBxPost 348 Pelican St.	Ctr		P	Metal	Black	-0.1	QM
Exterior Room 003 Marlin									
011	A	Curb Marlin St.	Ctr		P	Concrete	White	-0.1	QM
012	A	Curb Marlin St.	Ctr		P	Concrete	Red	0.0	QM
013	A	Speedbump Marlin St.	Ctr		P	Concrete	Yellow	1.0	QM
014	A	Fence Beside Speedbumps	Ctr		P	Wood	White	-0.1	QM
015	A	MailBxPost 374 Mariner Ct.	Ctr		P	Metal	Black	-0.1	QM
Exterior Room 004 Gulfstream									
016	A	Curb Gulfstream Dr.	Ctr		P	Concrete	White	1.5	QM
017	A	Curb Gulfstream Dr.	Ctr		P	Concrete	Red	-0.2	QM
018	A	Speedbump Gulfstream Dr.	Ctr		P	Concrete	Yellow	2.7	QM
019	A	FireHydrant 287 Gulfstream Dr.	Ctr		P	Metal	Yellow	0.1	QM
020	A	MailBxPost 287 Gulfstream Dr.	Ctr		P	Metal	Black	1.0	QM
Exterior Room 005 Playground									
021	A	Equipment	Ctr		I	Metal	White	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
022	A	Equipment	Ctr		I	Metal	Yellow	1.0	QM
	Older looking metal								
023	A	Equipment	Ctr		I	Metal	Blue	-0.1	QM
024	A	Equipment	Ctr		I	Metal	Red	-0.1	QM
025	A	SwingSet	Ctr		I	Metal	Yellow	-0.1	QM
026	A	SwingSet	Ctr		I	Metal	Blue	0.0	QM
027	A	Slide	Ctr		I	Metal	Purple	-0.1	QM
Exterior Room 006 Gazebo									
028	A	Structure	Ctr		I	Wood	Varnish	-0.1	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/9/2013	Housing Units
Abatement Level:	1.0	
Report No.	09/04/13 08:35	
Total Reading Sets:	28	
Job Started:	09/04/13 08:35	
Job Finished:	09/04/13 09:07	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Curb	8	3	<38%>	5	<63%>	0	<0%>
Equipment	4	1	<25%>	3	<75%>	0	<0%>
Fence	1	0	<0%>	1	<100%>	0	<0%>
FireHydrant	3	1	<33%>	2	<67%>	0	<0%>
MailBxPost	4	1	<25%>	3	<75%>	0	<0%>
Slide	1	0	<0%>	1	<100%>	0	<0%>
Speedbump	3	3	<100%>	0	<0%>	0	<0%>
Structure	1	0	<0%>	1	<100%>	0	<0%>
SwingSet	2	0	<0%>	2	<100%>	0	<0%>
Transformer	1	0	<0%>	1	<100%>	0	<0%>
Inspection Totals:	28	9	< 32%>	19	< 68%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 10:07

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
281 Gulfstream Drive- Interior

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ Date: 9/27/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	281 Gulfstream Drive- Interior
Report No.	09/04/13 10:07	
Total Readings:	136 Actionable: 2	
Job Started:	09/04/13 10:07	
Job Finished:	09/04/13 10:45	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 007 MasterBath									
085	B	Wall	L Rgt		I	Ceramic	Tan	5.5	QM
Interior Room 008 UpperBedD/A									
091	C	Wall	L Ctr		I	Ceramic	Tan	5.8	QM

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	281 Gulfstream Drive- Interior
Report No.	09/04/13 10:07	
Total Readings:	136	
Job Started:	09/04/13 10:07	
Job Finished:	09/04/13 10:45	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
5	001	Hall/Stairs	A	Ceiling			I	Drywall	White	-0.1	QM
6	001	Hall/Stairs	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
7	001	Hall/Stairs	A	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
8	001	Hall/Stairs	A	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
9	001	Hall/Stairs	A	Door	Lft	U Ctr	I	Metal	White	-0.2	QM
10	001	Hall/Stairs	A	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
11	001	Hall/Stairs	A	Window	Rgt	Sill	I	Wood	White	-0.2	QM
12	001	Hall/Stairs	D	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
13	001	Hall/Stairs	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM
14	001	Hall/Stairs	C	Stairs	Ctr	Stringer	I	Wood	White	-0.2	QM
15	001	Hall/Stairs	D	Stairs	Ctr	Risers	I	Wood	White	-0.2	QM
16	001	Hall/Stairs	B	Stairs	Ctr	Wall	I	Wood	White	-0.1	QM
17	001	Hall/Stairs	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.2	QM
18	001	Hall/Stairs	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.1	QM
19	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
20	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
21	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
22	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
23	002	Bedroom A/B	A	Ceiling			I	Drywall	White	-0.2	QM
24	002	Bedroom A/B	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
25	002	Bedroom A/B	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
26	002	Bedroom A/B	D	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
27	002	Bedroom A/B	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
28	002	Bedroom A/B	C	Window	Ctr	Rgt casing	I	Wood	White	0.1	QM
29	002	Bedroom A/B	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
30	002	Bedroom A/B	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
31	003	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
32	003	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
33	003	Kitchen	C	Wall	L Ctr		I	Drywall	White	0.1	QM
34	003	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
35	003	Kitchen	A	Ceiling			I	Drywall	White	-0.1	QM
36	003	Kitchen	C	Baseboard	Rgt		I	Vinyl	Black	-0.2	QM
37	003	Kitchen	B	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
38	004	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
39	004	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
40	004	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
41	004	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
42	004	Living/Din	A	Ceiling			I	Drywall	White	-0.2	QM
43	004	Living/Din	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
44	004	Living/Din	C	Door	Ctr	Rgt casing	I	Metal	White	-0.2	QM
45	004	Living/Din	C	Door	Ctr	Rgt jamb	I	Metal	White	-0.2	QM
46	004	Living/Din	C	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
47	004	Living/Din	C	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Living/Din	C	Window	Rgt	Sash	I	Vinyl	White	-0.2	QM
49	004	Living/Din	C	Window	Rgt	Sill	I	Wood	White	-0.1	QM
50	005	Bathroom	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
51	005	Bathroom	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
52	005	Bathroom	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
53	005	Bathroom	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
54	005	Bathroom	A	Ceiling			I	Drywall	White	-0.1	QM
55	005	Bathroom	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
56	005	Bathroom	B	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
57	005	Bathroom	B	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
58	005	Bathroom	B	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
59	005	Bathroom	D	Cabinet	Lft		I	Wood	Varnish	-0.1	QM
60	005	Bathroom	A	Cabinet	Ctr		I	Wood	Varnish	-0.3	QM
61	006	UpperBedA/B	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
62	006	UpperBedA/B	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
63	006	UpperBedA/B	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
64	006	UpperBedA/B	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
65	006	UpperBedA/B	A	Ceiling			I	Drywall	White	-0.1	QM
66	006	UpperBedA/B	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
67	006	UpperBedA/B	D	Closet	Rgt	Door Casing	I	Wood	White	-0.1	QM
68	006	UpperBedA/B	D	Closet	Rgt	Door Jamb	I	Wood	White	-0.1	QM
69	006	UpperBedA/B	D	Closet	Rgt	Door	I	Wood	White	-0.2	QM
70	006	UpperBedA/B	A	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
71	006	UpperBedA/B	A	Window	Lft	Sash	I	Wood	White	0.0	QM
72	006	UpperBedA/B	A	Window	Lft	Sill	I	Wood	White	-0.3	QM
73	006	UpperBedA/B	D	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM
74	006	UpperBedA/B	D	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.1	QM
75	007	MasterBath	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
76	007	MasterBath	B	Wall	U Ctr		I	Drywall	White	-0.1	QM
77	007	MasterBath	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
78	007	MasterBath	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
79	007	MasterBath	A	Ceiling			I	Drywall	White	-0.2	QM
80	007	MasterBath	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
81	007	MasterBath	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
82	007	MasterBath	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
83	007	MasterBath	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
84	007	MasterBath	D	Cabinet	Rgt		I	Wood	White	-0.1	QM
85	007	MasterBath	B	Wall	L Rgt		I	Ceramic	Tan	5.5	QM
86	008	UpperBedD/A	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
87	008	UpperBedD/A	B	Wall	U Ctr		I	Drywall	White	-0.1	QM
88	008	UpperBedD/A	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
89	008	UpperBedD/A	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
90	008	UpperBedD/A	A	Ceiling			I	Drywall	White	-0.1	QM
91	008	UpperBedD/A	C	Wall	L Ctr		I	Ceramic	Tan	5.8	QM
92	008	UpperBedD/A	D	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
93	008	UpperBedD/A	D	Door	Ctr	Rgt jamb	I	Wood	White	0.0	QM
94	008	UpperBedD/A	D	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
95	008	UpperBedD/A	A	Bathtub	Ctr		I	Porcelain	White	-0.3	QM
96	008	UpperBedD/A	B	Sink	Rgt		I	Porcelain	White	-0.4	QM
97	008	UpperBedD/A	B	Cabinet	Rgt		I	Wood	White	-0.1	QM
98	009	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
99	009	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
100	009	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
101	009	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
102	009	UpperBedB/C	A	Ceiling			I	Drywall	White	-0.2	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	009	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
104	009	UpperBedB/C	D	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
105	009	UpperBedB/C	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
106	009	UpperBedB/C	D	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
107	009	UpperBedB/C	C	Window	Ctr	Rgt casing	I	Wood	White	-0.2	QM
108	009	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
109	009	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
110	009	UpperBedB/C	A	Closet	Ctr	Door	I	Wood	White	-0.2	QM
111	010	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
112	010	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
113	010	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
114	010	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
115	010	UpperBedC/D	A	Ceiling			I	Drywall	White	-0.4	QM
116	010	UpperBedC/D	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
117	010	UpperBedC/D	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
118	010	UpperBedC/D	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
119	010	UpperBedC/D	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
120	010	UpperBedC/D	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
121	010	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
122	010	UpperBedC/D	C	Window	Ctr	Sill	I	Wood	White	0.1	QM
123	010	UpperBedC/D	A	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
124	010	UpperBedC/D	A	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM
125	011	UpperHall	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
126	011	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
127	011	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
128	011	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
129	011	UpperHall	A	Ceiling			I	Drywall	White	0.0	QM
130	011	UpperHall	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
131	011	UpperHall	B	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
132	011	UpperHall	B	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
133	011	UpperHall	B	Door	Ctr	U Ctr	I	Wood	White	0.0	QM
134	011	UpperHall	B	DoorStop	Ctr		I	Wood	Black	-0.2	QM
135	011	UpperHall	B	Closet	Ctr	Shelf	I	Wood	White	0.0	QM
136	011	UpperHall	B	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13
Report Date: 9/23/2013
Abatement Level: 1.0
Report No. 09/04/13 10:07
Total Readings: 136
Job Started: 09/04/13 10:07
Job Finished: 09/04/13 10:45

USCG Elizabeth City
Housing Units
281 Gulfstream Drive- Interior

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
005	A	Ceiling			I	Drywall	White	-0.1	QM
010	A	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
011	A	Window	Rgt	Sill	I	Wood	White	-0.2	QM
008	A	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
007	A	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
009	A	Door	Lft	U Ctr	I	Metal	White	-0.2	QM
018	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.1	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
016	B	Stairs	Ctr	Wall	I	Wood	White	-0.1	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
006	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
014	C	Stairs	Ctr	Stringer	I	Wood	White	-0.2	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
017	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.2	QM
015	D	Stairs	Ctr	Risers	I	Wood	White	-0.2	QM
013	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM
012	D	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
Interior Room 002 Bedroom A/B									
019	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
023	A	Ceiling			I	Drywall	White	-0.2	QM
020	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
021	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
024	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
028	C	Window	Ctr	Rgt casing	I	Wood	White	0.1	QM
029	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
030	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
022	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
026	D	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
025	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
027	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
Interior Room 003 Kitchen									
031	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
035	A	Ceiling			I	Drywall	White	-0.1	QM
032	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
037	B	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
033	C	Wall	L Ctr		I	Drywall	White	0.1	QM
036	C	Baseboard	Rgt		I	Vinyl	Black	-0.2	QM
034	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 004 Living/Din									
038	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
042	A	Ceiling			I	Drywall	White	-0.2	QM
039	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
040	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
043	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
047	C	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
048	C	Window	Rgt	Sash	I	Vinyl	White	-0.2	QM
049	C	Window	Rgt	Sill	I	Wood	White	-0.1	QM
045	C	Door	Ctr	Rgt jamb	I	Metal	White	-0.2	QM
044	C	Door	Ctr	Rgt casing	I	Metal	White	-0.2	QM
046	C	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
041	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Interior Room 005 Bathroom									
050	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
054	A	Ceiling			I	Drywall	White	-0.1	QM
060	A	Cabinet	Ctr		I	Wood	Varnish	-0.3	QM
051	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
057	B	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
056	B	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
058	B	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
052	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
055	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
053	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
059	D	Cabinet	Lft		I	Wood	Varnish	-0.1	QM
Interior Room 006 UpperBedA/B									
061	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
065	A	Ceiling			I	Drywall	White	-0.1	QM
070	A	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
071	A	Window	Lft	Sash	I	Wood	White	0.0	QM
072	A	Window	Lft	Sill	I	Wood	White	-0.3	QM
062	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
063	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
066	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
064	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
069	D	Closet	Rgt	Door	I	Wood	White	-0.2	QM
067	D	Closet	Rgt	Door Casing	I	Wood	White	-0.1	QM
068	D	Closet	Rgt	Door Jamb	I	Wood	White	-0.1	QM
074	D	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.1	QM
073	D	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM
Interior Room 007 MasterBath									
075	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
079	A	Ceiling			I	Drywall	White	-0.2	QM
082	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
081	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
083	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
085	B	Wall	L Rgt		I	Ceramic	Tan	5.5	QM
076	B	Wall	U Ctr		I	Drywall	White	-0.1	QM
077	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
080	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
078	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
084	D	Cabinet	Rgt		I	Wood	White	-0.1	QM
Interior Room 008 UpperBedD/A									
086	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
090	A	Ceiling			I	Drywall	White	-0.1	QM
095	A	Bathtub	Ctr		I	Porcelain	White	-0.3	QM
087	B	Wall	U Ctr		I	Drywall	White	-0.1	QM
096	B	Sink	Rgt		I	Porcelain	White	-0.4	QM
097	B	Cabinet	Rgt		I	Wood	White	-0.1	QM
091	C	Wall	L Ctr		I	Ceramic	Tan	5.8	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
088	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
089	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
093	D	Door	Ctr	Rgt jamb	I	Wood	White	0.0	QM
092	D	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
094	D	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
Interior Room 009 UpperBedB/C									
098	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
102	A	Ceiling			I	Drywall	White	-0.2	QM
110	A	Closet	Ctr	Door	I	Wood	White	-0.2	QM
099	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
100	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
103	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
107	C	Window	Ctr	Rgt casing	I	Wood	White	-0.2	QM
108	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
109	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
101	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
105	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
104	D	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
106	D	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
Interior Room 010 UpperBedC/D									
111	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
115	A	Ceiling			I	Drywall	White	-0.4	QM
118	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
117	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
119	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
124	A	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM
123	A	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
112	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
113	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
116	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
120	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
121	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
122	C	Window	Ctr	Sill	I	Wood	White	0.1	QM
114	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 011 UpperHall									
125	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
129	A	Ceiling			I	Drywall	White	0.0	QM
126	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
132	B	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
131	B	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
133	B	Door	Ctr	U Ctr	I	Wood	White	0.0	QM
136	B	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM
135	B	Closet	Ctr	Shelf	I	Wood	White	0.0	QM
134	B	DoorStop	Ctr		I	Wood	Black	-0.2	QM
127	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
130	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
128	D	Wall	L Ctr		I	Drywall	White	-0.2	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	281 Gulfstream Drive- Interior
Report No.	09/04/13 10:07	
Total Reading Sets:	136	
Job Started:	09/04/13 10:07	
Job Finished:	09/04/13 10:45	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Baseboard	10	0	<0%>	10	<100%>	0	<0%>
Bathtub	1	0	<0%>	1	<100%>	0	<0%>
Cabinet	5	0	<0%>	5	<100%>	0	<0%>
Ceiling	11	0	<0%>	11	<100%>	0	<0%>
Closet Door	2	0	<0%>	2	<100%>	0	<0%>
Closet Door Casing	1	0	<0%>	1	<100%>	0	<0%>
Closet Door Jamb	1	0	<0%>	1	<100%>	0	<0%>
Closet Shelf	4	0	<0%>	4	<100%>	0	<0%>
Closet Shelf Sup.	4	0	<0%>	4	<100%>	0	<0%>
Door Rgt casing	9	0	<0%>	9	<100%>	0	<0%>
Door Rgt jamb	9	0	<0%>	9	<100%>	0	<0%>
Door U Ctr	9	0	<0%>	9	<100%>	0	<0%>
DoorStop	1	0	<0%>	1	<100%>	0	<0%>
Sink	1	0	<0%>	1	<100%>	0	<0%>
Stairs Railing cap	1	0	<0%>	1	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	46	2	<4%>	44	<96%>	0	<0%>
Window Rgt casing	6	0	<0%>	6	<100%>	0	<0%>
Window Sash	5	0	<0%>	5	<100%>	0	<0%>
Window Sill	6	0	<0%>	6	<100%>	0	<0%>
Inspection Totals:	136	2	< 1%>	134	< 99%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 15:24

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
254 Gulfstream Drive- Interior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____ **Date:** 9/23/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	254 Gulfstream Drive- Interior
Report No.	09/03/13 15:24	
Total Readings:	150 Actionable: 2	
Job Started:	09/03/13 15:24	
Job Finished:	09/03/13 16:13	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 008 MasterBath									
090	C	Wall	L Rgt		I	Ceramic	Tan	5.6	QM
Interior Room 009 UpperBath									
103	C	Wall	L Ctr		I	Ceramic	Tan	6.7	QM
Calibration Readings									

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	254 Gulfstream Drive- Interior
Report No.	09/03/13 15:24	
Total Readings:	150	
Job Started:	09/03/13 15:24	
Job Finished:	09/03/13 16:13	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	0.0	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	0.1	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	0.0	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.7	QM
5	001	Hall/Stairs	A	Ceiling			I	Drywall	White	-0.3	QM
6	001	Hall/Stairs	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
7	001	Hall/Stairs	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
8	001	Hall/Stairs	A	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
9	001	Hall/Stairs	A	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
10	001	Hall/Stairs	A	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
11	001	Hall/Stairs	A	Window	Rgt	Sill	I	Wood	White	-0.1	QM
12	001	Hall/Stairs	D	Closet	Ctr	Shelf	I	Wood	White	-0.4	QM
13	001	Hall/Stairs	C	Closet	Ctr	Shelf Sup.	I	Wood	White	0.0	QM
14	001	Hall/Stairs	C	Stairs	Ctr	Stringer	I	Wood	White	0.1	QM
15	001	Hall/Stairs	D	Stairs	Ctr	Risers	I	Wood	White	0.0	QM
16	001	Hall/Stairs	B	Stairs	Ctr	Wall	I	Wood	White	-0.1	QM
17	001	Hall/Stairs	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.3	QM
18	001	Hall/Stairs	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.1	QM
19	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
20	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
21	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
22	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	0.1	QM
23	002	Bedroom A/B	A	Ceiling			I	Drywall	White	0.0	QM
24	002	Bedroom A/B	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
25	002	Bedroom A/B	D	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
26	002	Bedroom A/B	D	Door	Lft	Rgt jamb	I	Wood	White	0.2	QM
27	002	Bedroom A/B	D	Door	Lft	U Ctr	I	Wood	White	0.3	QM
28	002	Bedroom A/B	A	Window	Ctr	Rgt casing	I	Wood	White	-0.5	QM
29	002	Bedroom A/B	A	Window	Ctr	Sash	I	Wood	White	-0.4	QM
30	002	Bedroom A/B	A	Window	Ctr	Sill	I	Wood	White	-0.5	QM
31	003	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
32	003	Kitchen	B	Wall	L Ctr		I	Drywall	White	0.0	QM
33	003	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
34	003	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
35	003	Kitchen	A	Ceiling			I	Drywall	White	-0.3	QM
36	003	Kitchen	C	Baseboard	Ctr		I	Vinyl	Black	-0.4	QM
37	003	Kitchen	B	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
38	004	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
39	004	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
40	004	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
41	004	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
42	004	Living/Din	A	Ceiling			I	Drywall	White	-0.2	QM
43	004	Living/Din	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
44	004	Living/Din	C	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
45	004	Living/Din	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
46	004	Living/Din	C	Door	Ctr	U Ctr	I	Wood	White	-0.3	QM
47	004	Living/Din	C	Window	Rgt	Rgt casing	I	Wood	White	-0.3	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Living/Din	C	Window	Rgt	Sash	I	Wood	White	-0.2	QM
49	004	Living/Din	C	Window	Rgt	Sill	I	Wood	White	-0.3	QM
50	005	Bathroom	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
51	005	Bathroom	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
52	005	Bathroom	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
53	005	Bathroom	D	Wall	L Ctr		I	Drywall	White	0.0	QM
54	005	Bathroom	A	Ceiling			I	Drywall	White	-0.6	QM
55	005	Bathroom	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
56	005	Bathroom	B	Door	Rgt	Rgt casing	I	Wood	White	-0.4	QM
57	005	Bathroom	B	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
58	005	Bathroom	B	Door	Rgt	U Ctr	I	Wood	White	-0.5	QM
59	005	Bathroom	D	Cabinet	Lft		I	Wood	Varnish	-0.4	QM
60	005	Bathroom	A	Cabinet	Ctr		I	Wood	Varnish	-0.3	QM
61	006	UpperBedD/A	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
62	006	UpperBedD/A	B	Wall	L Ctr		I	Drywall	White	-0.5	QM
63	006	UpperBedD/A	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
64	006	UpperBedD/A	D	Wall	L Ctr		I	Drywall	White	-0.6	QM
65	006	UpperBedD/A	D	Ceiling			I	Drywall	White	-0.4	QM
66	006	UpperBedD/A	B	Wall	L Ctr		I	Wood	White	-0.3	QM
67	006	UpperBedD/A	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
68	006	UpperBedD/A	A	Closet	Lft	Door Casing	I	Wood	White	-0.2	QM
69	006	UpperBedD/A	A	Closet	Lft	Door Jamb	I	Wood	White	-0.1	QM
70	006	UpperBedD/A	A	Closet	Lft	Door	I	Wood	White	-0.3	QM
71	006	UpperBedD/A	A	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
72	006	UpperBedD/A	A	Window	Rgt	Sash	I	Wood	White	0.0	QM
73	007	UpperBedA/B	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
74	007	UpperBedA/B	B	Wall	L Ctr		I	Drywall	White	0.0	QM
75	007	UpperBedA/B	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
76	007	UpperBedA/B	D	Wall	L Ctr		I	Drywall	White	0.1	QM
77	007	UpperBedA/B	A	Ceiling			I	Drywall	White	0.1	QM
78	007	UpperBedA/B	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
79	007	UpperBedA/B	D	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
80	007	UpperBedA/B	D	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM
81	007	UpperBedA/B	D	Door	Lft	U Ctr	I	Wood	White	-0.8	QM
82	007	UpperBedA/B	A	Window	Ctr	Rgt casing	I	Wood	White	-0.8	QM
83	007	UpperBedA/B	A	Window	Ctr	Sash	I	Wood	White	-0.5	QM
84	007	UpperBedA/B	A	Window	Ctr	Sill	I	Wood	White	-0.6	QM
85	008	MasterBath	A	Wall	U Ctr		I	Drywall	White	-0.4	QM
86	008	MasterBath	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
87	008	MasterBath	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
88	008	MasterBath	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
89	008	MasterBath	A	Ceiling			I	Drywall	White	-0.5	QM
90	008	MasterBath	C	Wall	L Rgt		I	Ceramic	Tan	5.6	QM
91	008	MasterBath	A	Door	Rgt	Rgt casing	I	Wood	White	-0.6	QM
92	008	MasterBath	A	Door	Rgt	Rgt jamb	I	Wood	White	-1.0	QM
93	008	MasterBath	A	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
94	008	MasterBath	C	Bathtub	Ctr		I	Porcelain	White	-0.5	QM
95	008	MasterBath	D	Sink	Rgt		I	Porcelain	White	-0.4	QM
96	008	MasterBath	D	Cabinet	Rgt		I	Wood	White	-0.7	QM
97	008	MasterBath	A	DoorStop	Rgt		I	Wood	Black	-0.7	QM
98	009	UpperBath	A	Wall	U Ctr		I	Drywall	White	-0.4	QM
99	009	UpperBath	B	Wall	U Lft		I	Drywall	White	-0.3	QM
100	009	UpperBath	C	Wall	U Ctr		I	Drywall	White	-0.4	QM
101	009	UpperBath	D	Wall	U Ctr		I	Drywall	White	-0.4	QM
102	009	UpperBath	A	Ceiling			I	Drywall	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	009	UpperBath	C	Wall	L Ctr		I	Ceramic	Tan	6.7	QM
104	009	UpperBath	D	Door	Lft	Rgt casing	I	Wood	White	-0.8	QM
105	009	UpperBath	D	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM
106	009	UpperBath	D	Door	Lft	U Ctr	I	Wood	White	-0.8	QM
107	009	UpperBath	A	Bathtub	Ctr		I	Porcelain	White	-0.7	QM
108	009	UpperBath	B	Sink	Rgt		I	Porcelain	White	-0.2	QM
109	009	UpperBath	B	Cabinet	Rgt		I	Wood	White	0.1	QM
110	010	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	0.0	QM
111	010	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
112	010	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
113	010	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
114	010	UpperBedB/C	A	Ceiling			I	Drywall	White	0.0	QM
115	010	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
116	010	UpperBedB/C	D	Closet	Lft	Door Casing	I	Wood	White	-0.1	QM
117	010	UpperBedB/C	D	Closet	Lft	Door Jamb	I	Wood	White	-0.1	QM
118	010	UpperBedB/C	D	Closet	Lft	Door	I	Wood	White	-0.2	QM
119	010	UpperBedB/C	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
120	010	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
121	010	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	-0.3	QM
122	011	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
123	011	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
124	011	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
125	011	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
126	011	UpperBedC/D	A	Ceiling			I	Drywall	White	-0.5	QM
127	011	UpperBedC/D	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
128	011	UpperBedC/D	B	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
129	011	UpperBedC/D	B	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
130	011	UpperBedC/D	B	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
131	011	UpperBedC/D	C	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
132	011	UpperBedC/D	C	Window	Lft	Sash	I	Wood	White	-0.5	QM
133	011	UpperBedC/D	C	Window	Lft	Sill	I	Wood	White	-0.3	QM
134	012	UpperHall	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
135	012	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
136	012	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
137	012	UpperHall	D	Wall	L Ctr		I	Drywall	White	0.0	QM
138	012	UpperHall	A	Ceiling			I	Drywall	White	-0.1	QM
139	012	UpperHall	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
140	012	UpperHall	D	Closet	Ctr	Door Casing	I	Wood	White	-0.3	QM
141	012	UpperHall	D	Closet	Ctr	Door Jamb	I	Wood	White	-0.4	QM
142	012	UpperHall	D	Closet	Ctr	Door	I	Wood	White	-0.1	QM
143	012	UpperHall	A	Attic Hatch	Ctr		I	Wood	White	0.0	QM
144	012	UpperHall	A	Attic Casing	Ctr		I	Wood	White	0.1	QM
145		CALIBRATION								1.0	QM
146		CALIBRATION								1.0	QM
147		CALIBRATION								1.0	QM
148		CALIBRATION								0.0	QM
149		CALIBRATION								0.2	QM
150		CALIBRATION								0.0	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	254 Gulfstream Drive- Interior
Report No.	09/03/13 15:24	
Total Readings:	150	
Job Started:	09/03/13 15:24	
Job Finished:	09/03/13 16:13	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	0.0	QM
005	A	Ceiling			I	Drywall	White	-0.3	QM
010	A	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
011	A	Window	Rgt	Sill	I	Wood	White	-0.1	QM
008	A	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
007	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
009	A	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
018	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.1	QM
002	B	Wall	L Ctr		I	Drywall	White	0.1	QM
016	B	Stairs	Ctr	Wall	I	Wood	White	-0.1	QM
003	C	Wall	L Ctr		I	Drywall	White	0.0	QM
006	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
014	C	Stairs	Ctr	Stringer	I	Wood	White	0.1	QM
013	C	Closet	Ctr	Shelf Sup.	I	Wood	White	0.0	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.7	QM
017	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.3	QM
015	D	Stairs	Ctr	Risers	I	Wood	White	0.0	QM
012	D	Closet	Ctr	Shelf	I	Wood	White	-0.4	QM
Interior Room 002 Bedroom A/B									
019	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
023	A	Ceiling			I	Drywall	White	0.0	QM
028	A	Window	Ctr	Rgt casing	I	Wood	White	-0.5	QM
029	A	Window	Ctr	Sash	I	Wood	White	-0.4	QM
030	A	Window	Ctr	Sill	I	Wood	White	-0.5	QM
020	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
021	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
024	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
022	D	Wall	L Ctr		I	Drywall	White	0.1	QM
026	D	Door	Lft	Rgt jamb	I	Wood	White	0.2	QM
025	D	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
027	D	Door	Lft	U Ctr	I	Wood	White	0.3	QM
Interior Room 003 Kitchen									
031	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
035	A	Ceiling			I	Drywall	White	-0.3	QM
032	B	Wall	L Ctr		I	Drywall	White	0.0	QM
037	B	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
033	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
036	C	Baseboard	Ctr		I	Vinyl	Black	-0.4	QM
034	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 004 Living/Din									
038	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
042	A	Ceiling			I	Drywall	White	-0.2	QM
039	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
040	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
043	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
047	C	Window	Rgt	Rgt casing	I	Wood	White	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
048	C	Window	Rgt	Sash	I	Wood	White	-0.2	QM
049	C	Window	Rgt	Sill	I	Wood	White	-0.3	QM
045	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
044	C	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
046	C	Door	Ctr	U Ctr	I	Wood	White	-0.3	QM
041	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
Interior Room 005 Bathroom									
050	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
054	A	Ceiling			I	Drywall	White	-0.6	QM
060	A	Cabinet	Ctr		I	Wood	Varnish	-0.3	QM
051	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
057	B	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
056	B	Door	Rgt	Rgt casing	I	Wood	White	-0.4	QM
058	B	Door	Rgt	U Ctr	I	Wood	White	-0.5	QM
052	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
055	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
053	D	Wall	L Ctr		I	Drywall	White	0.0	QM
059	D	Cabinet	Lft		I	Wood	Varnish	-0.4	QM
Interior Room 006 UpperBedD/A									
061	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
071	A	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
072	A	Window	Rgt	Sash	I	Wood	White	0.0	QM
070	A	Closet	Lft	Door	I	Wood	White	-0.3	QM
068	A	Closet	Lft	Door Casing	I	Wood	White	-0.2	QM
069	A	Closet	Lft	Door Jamb	I	Wood	White	-0.1	QM
062	B	Wall	L Ctr		I	Drywall	White	-0.5	QM
066	B	Wall	L Ctr		I	Wood	White	-0.3	QM
063	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
067	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
064	D	Wall	L Ctr		I	Drywall	White	-0.6	QM
065	D	Ceiling			I	Drywall	White	-0.4	QM
Interior Room 007 UpperBedA/B									
073	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
077	A	Ceiling			I	Drywall	White	0.1	QM
082	A	Window	Ctr	Rgt casing	I	Wood	White	-0.8	QM
083	A	Window	Ctr	Sash	I	Wood	White	-0.5	QM
084	A	Window	Ctr	Sill	I	Wood	White	-0.6	QM
074	B	Wall	L Ctr		I	Drywall	White	0.0	QM
075	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
078	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
076	D	Wall	L Ctr		I	Drywall	White	0.1	QM
080	D	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM
079	D	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
081	D	Door	Lft	U Ctr	I	Wood	White	-0.8	QM
Interior Room 008 MasterBath									
085	A	Wall	U Ctr		I	Drywall	White	-0.4	QM
089	A	Ceiling			I	Drywall	White	-0.5	QM
092	A	Door	Rgt	Rgt jamb	I	Wood	White	-1.0	QM
091	A	Door	Rgt	Rgt casing	I	Wood	White	-0.6	QM
093	A	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
097	A	DoorStop	Rgt		I	Wood	Black	-0.7	QM
086	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
090	C	Wall	L Rgt		I	Ceramic	Tan	5.6	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
087	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
094	C	Bathtub	Ctr		I	Porcelain	White	-0.5	QM
088	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
095	D	Sink	Rgt		I	Porcelain	White	-0.4	QM
096	D	Cabinet	Rgt		I	Wood	White	-0.7	QM
Interior Room 009 UpperBath									
098	A	Wall	U Ctr		I	Drywall	White	-0.4	QM
102	A	Ceiling			I	Drywall	White	-0.1	QM
107	A	Bathtub	Ctr		I	Porcelain	White	-0.7	QM
099	B	Wall	U Lft		I	Drywall	White	-0.3	QM
108	B	Sink	Rgt		I	Porcelain	White	-0.2	QM
109	B	Cabinet	Rgt		I	Wood	White	0.1	QM
103	C	Wall	L Ctr		I	Ceramic	Tan	6.7	QM
100	C	Wall	U Ctr		I	Drywall	White	-0.4	QM
101	D	Wall	U Ctr		I	Drywall	White	-0.4	QM
105	D	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM
104	D	Door	Lft	Rgt casing	I	Wood	White	-0.8	QM
106	D	Door	Lft	U Ctr	I	Wood	White	-0.8	QM
Interior Room 010 UpperBedB/C									
110	A	Wall	L Ctr		I	Drywall	White	0.0	QM
114	A	Ceiling			I	Drywall	White	0.0	QM
111	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
112	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
115	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
119	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
120	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
121	C	Window	Ctr	Sill	I	Wood	White	-0.3	QM
113	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
118	D	Closet	Lft	Door	I	Wood	White	-0.2	QM
116	D	Closet	Lft	Door Casing	I	Wood	White	-0.1	QM
117	D	Closet	Lft	Door Jamb	I	Wood	White	-0.1	QM
Interior Room 011 UpperBedC/D									
122	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
126	A	Ceiling			I	Drywall	White	-0.5	QM
123	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
129	B	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
128	B	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
130	B	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
124	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
127	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
131	C	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
132	C	Window	Lft	Sash	I	Wood	White	-0.5	QM
133	C	Window	Lft	Sill	I	Wood	White	-0.3	QM
125	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Interior Room 012 UpperHall									
134	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
138	A	Ceiling			I	Drywall	White	-0.1	QM
143	A	Attic Hatch	Ctr		I	Wood	White	0.0	QM
144	A	Attic Casing	Ctr		I	Wood	White	0.1	QM
135	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
136	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
139	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
137	D	Wall	L Ctr		I	Drywall	White	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
142	D	Closet	Ctr	Door	I	Wood	White	-0.1	QM
140	D	Closet	Ctr	Door Casing	I	Wood	White	-0.3	QM
141	D	Closet	Ctr	Door Jamb	I	Wood	White	-0.4	QM
Calibration Readings									
145								1.0	QM
146								1.0	QM
147								1.0	QM
148								0.0	QM
149								0.2	QM
150								0.0	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	254 Gulfstream Drive- Interior
Report No.	09/03/13 15:24	
Total Reading Sets:	144	
Job Started:	09/03/13 15:24	
Job Finished:	09/03/13 16:13	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Attic Casing	1	0	<0%>	1	<100%>	0	<0%>
Attic Hatch	1	0	<0%>	1	<100%>	0	<0%>
Baseboard	10	0	<0%>	10	<100%>	0	<0%>
Bathtub	2	0	<0%>	2	<100%>	0	<0%>
Cabinet	5	0	<0%>	5	<100%>	0	<0%>
Ceiling	12	0	<0%>	12	<100%>	0	<0%>
Closet Door	3	0	<0%>	3	<100%>	0	<0%>
Closet Door Casing	3	0	<0%>	3	<100%>	0	<0%>
Closet Door Jamb	3	0	<0%>	3	<100%>	0	<0%>
Closet Shelf	1	0	<0%>	1	<100%>	0	<0%>
Closet Shelf Sup.	1	0	<0%>	1	<100%>	0	<0%>
Door Rgt casing	8	0	<0%>	8	<100%>	0	<0%>
Door Rgt jamb	8	0	<0%>	8	<100%>	0	<0%>
Door U Ctr	8	0	<0%>	8	<100%>	0	<0%>
DoorStop	1	0	<0%>	1	<100%>	0	<0%>
Sink	2	0	<0%>	2	<100%>	0	<0%>
Stairs Railing cap	1	0	<0%>	1	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	51	2	<4%>	49	<96%>	0	<0%>
Window Rgt casing	7	0	<0%>	7	<100%>	0	<0%>
Window Sash	6	0	<0%>	6	<100%>	0	<0%>
Window Sill	6	0	<0%>	6	<100%>	0	<0%>
Inspection Totals:	144	2	< 1%>	142	< 99%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 14:47

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
252 Gulfstream Drive- Interior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 120173

SIGNED: _____ Date: 9-23-13

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	250 Gulfstream Drive- Interior
Report No.	09/03/13 14:47	
Total Readings:	138 Actionable: 2	
Job Started:	09/03/13 14:47	
Job Finished:	09/03/13 15:23	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 007 MasterBath									
080	C	Wall	L Ctr		I	Ceramic	Tan	4.2	QM
Interior Room 010 UpperBath									
121	C	Wall	L Ctr		I	Ceramic	Tan	3.9	QM

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	250 Gulfstream Drive- Interior
Report No.	09/03/13 14:47	
Total Readings:	138	
Job Started:	09/03/13 14:47	
Job Finished:	09/03/13 15:23	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	0.3	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	0.2	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	-0.6	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
5	001	Hall/Stairs	A	Ceiling			I	Drywall	White	-0.1	QM
6	001	Hall/Stairs	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
7	001	Hall/Stairs	A	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
8	001	Hall/Stairs	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
9	001	Hall/Stairs	A	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
10	001	Hall/Stairs	A	Window	Lft	Rgt casing	I	Wood	White	-0.2	QM
11	001	Hall/Stairs	A	Window	Lft	Sill	I	Wood	White	0.0	QM
12	001	Hall/Stairs	B	Closet	Ctr	Shelf	I	Wood	White	0.0	QM
13	001	Hall/Stairs	B	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.3	QM
14	001	Hall/Stairs	C	Stairs	Ctr	Stringer	I	Wood	White	-0.5	QM
15	001	Hall/Stairs	C	Stairs	Ctr	Risers	I	Wood	White	-0.3	QM
16	001	Hall/Stairs	C	Stairs	Ctr	Wall	I	Wood	White	-0.3	QM
17	001	Hall/Stairs	B	Stairs	Ctr	Treads	I	Wood	Varnish	-0.3	QM
18	001	Hall/Stairs	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.4	QM
19	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
20	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
21	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	0.0	QM
22	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
23	002	Bedroom A/B	A	Ceiling			I	Drywall	White	-0.7	QM
24	002	Bedroom A/B	C	Baseboard	Ctr		I	Wood	White	-0.6	QM
25	002	Bedroom A/B	D	Door	Lft	Rgt casing	I	Wood	White	-0.6	QM
26	002	Bedroom A/B	D	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
27	002	Bedroom A/B	D	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
28	002	Bedroom A/B	B	Cabinet	Rgt		I	Wood	Varnish	-0.1	QM
29	002	Bedroom A/B	A	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
30	003	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
31	003	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
32	003	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
33	003	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
34	003	Living/Din	A	Ceiling			I	Drywall	White	-0.1	QM
35	003	Living/Din	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
36	003	Living/Din	C	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
37	003	Living/Din	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.3	QM
38	003	Living/Din	C	Door	Ctr	U Ctr	I	Wood	White	0.2	QM
39	003	Living/Din	C	Window	Lft	Rgt casing	I	Wood	White	-0.2	QM
40	003	Living/Din	C	Window	Lft	Sash	I	Wood	White	-0.6	QM
41	003	Living/Din	C	Window	Lft	Sill	I	Wood	White	-0.3	QM
42	004	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
43	004	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.5	QM
44	004	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
45	004	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
46	004	Kitchen	D	Ceiling			I	Drywall	White	-0.4	QM
47	004	Kitchen	C	Baseboard	Ctr		I	Wood	White	-0.3	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Kitchen	D	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
49	005	Bedroom D/A	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
50	005	Bedroom D/A	B	Wall	L Ctr		I	Drywall	White	-0.6	QM
51	005	Bedroom D/A	C	Wall	L Ctr		I	Drywall	White	-0.6	QM
52	005	Bedroom D/A	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
53	005	Bedroom D/A	A	Ceiling			I	Drywall	White	-0.1	QM
54	005	Bedroom D/A	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
55	005	Bedroom D/A	B	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
56	005	Bedroom D/A	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
57	005	Bedroom D/A	B	Door	Rgt	U Ctr	I	Wood	White	-0.4	QM
58	005	Bedroom D/A	A	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
59	005	Bedroom D/A	A	Window	Ctr	Sash	I	Wood	White	-0.2	QM
60	005	Bedroom D/A	A	Window	Ctr	Sill	I	Wood	White	0.0	QM
61	006	UpperBedD/A	A	Wall	L Ctr		I	Drywall	White	0.2	QM
62	006	UpperBedD/A	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
63	006	UpperBedD/A	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
64	006	UpperBedD/A	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
65	006	UpperBedD/A	A	Ceiling			I	Drywall	White	-0.1	QM
66	006	UpperBedD/A	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
67	006	UpperBedD/A	B	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
68	006	UpperBedD/A	B	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
69	006	UpperBedD/A	B	Door	Lft	U Ctr	I	Wood	White	-0.4	QM
70	006	UpperBedD/A	A	Window	Rgt	Rgt casing	I	Wood	White	-0.5	QM
71	006	UpperBedD/A	A	Window	Rgt	Sash	I	Wood	White	-1.3	QM
72	006	UpperBedD/A	A	Window	Rgt	Sill	I	Wood	White	-0.7	QM
73	006	UpperBedD/A	B	Closet	Ctr	Shelf	I	Wood	White	-0.5	QM
74	006	UpperBedD/A	B	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.5	QM
75	007	MasterBath	A	Wall	U Ctr		I	Drywall	White	-0.9	QM
76	007	MasterBath	B	Wall	U Ctr		I	Drywall	White	-0.5	QM
77	007	MasterBath	C	Wall	U Ctr		I	Drywall	White	-0.9	QM
78	007	MasterBath	D	Wall	U Ctr		I	Drywall	White	-0.4	QM
79	007	MasterBath	A	Ceiling			I	Drywall	White	-0.3	QM
80	007	MasterBath	C	Wall	L Ctr		I	Ceramic	Tan	4.2	QM
81	007	MasterBath	A	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
82	007	MasterBath	A	Door	Lft	U Ctr	I	Wood	White	-0.5	QM
83	007	MasterBath	C	Bathtub	Ctr		I	Porcelain	White	-0.6	QM
84	007	MasterBath	B	Sink	Lft		I	Porcelain	White	-0.5	QM
85	007	MasterBath	B	Cabinet	Lft		I	Wood	White	-1.1	QM
86	008	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	0.0	QM
87	008	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
88	008	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
89	008	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
90	008	UpperBedB/C	A	Ceiling			I	Drywall	White	-0.2	QM
91	008	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
92	008	UpperBedB/C	A	Door	Lft	Rgt casing	I	Wood	White	-0.3	QM
93	008	UpperBedB/C	A	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
94	008	UpperBedB/C	A	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
95	008	UpperBedB/C	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
96	008	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
97	008	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	-0.3	QM
98	008	UpperBedB/C	A	Closet	Rgt	Door	I	Wood	White	-0.1	QM
99	008	UpperBedB/C	A	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM
100	008	UpperBedB/C	A	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.1	QM
101	009	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
102	009	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.2	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	009	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
104	009	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
105	009	UpperBedC/D	A	Ceiling			I	Drywall	White	-0.4	QM
106	009	UpperBedC/D	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
107	009	UpperBedC/D	B	Door	Lft	Rgt casing	I	Wood	White	-0.4	QM
108	009	UpperBedC/D	B	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM
109	009	UpperBedC/D	B	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
110	009	UpperBedC/D	C	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
111	009	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
112	009	UpperBedC/D	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
113	009	UpperBedC/D	A	Closet	Lft	Door	I	Wood	White	-0.1	QM
114	009	UpperBedC/D	A	Closet	Ctr	Shelf	I	Wood	White	-0.4	QM
115	009	UpperBedC/D	A	Closet	Ctr	Shelf Sup.	I	Wood	White	0.0	QM
116	010	UpperBath	A	Wall	U Ctr		I	Drywall	White	0.0	QM
117	010	UpperBath	B	Wall	U Ctr		I	Drywall	White	-0.3	QM
118	010	UpperBath	C	Wall	U Ctr		I	Drywall	White	0.0	QM
119	010	UpperBath	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
120	010	UpperBath	A	Ceiling			I	Drywall	White	-0.2	QM
121	010	UpperBath	C	Wall	L Ctr		I	Ceramic	Tan	3.9	QM
122	010	UpperBath	B	Door	Ctr	Rgt casing	I	Wood	White	-0.5	QM
123	010	UpperBath	B	Door	Ctr	Rgt jamb	I	Wood	White	-1.0	QM
124	010	UpperBath	B	Door	Ctr	U Ctr	I	Wood	White	-0.4	QM
125	010	UpperBath	A	Bathtub	Ctr		I	Porcelain	White	-0.6	QM
126	010	UpperBath	B	Sink	Lft		I	Porcelain	White	-0.6	QM
127	010	UpperBath	D	Cabinet	Lft		I	Wood	White	0.0	QM
128	011	UpperHall	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
129	011	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
130	011	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
131	011	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
132	011	UpperHall	A	Ceiling			I	Drywall	White	-0.1	QM
133	011	UpperHall	C	Baseboard	Ctr		I	Wood	White	-0.5	QM
134	011	UpperHall	B	Closet	Ctr	Door Casing	I	Wood	White	-0.2	QM
135	011	UpperHall	B	Closet	Ctr	Door Jamb	I	Wood	White	-0.3	QM
136	011	UpperHall	B	Closet	Ctr	Door	I	Wood	White	-0.3	QM
137	011	UpperHall	A	Attic Hatch	Ctr		I	Wood	White	-1.1	QM
138	011	UpperHall	A	Attic Casing	Ctr		I	Wood	White	0.0	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	250 Gulfstream Drive- Interior
Report No.	09/03/13 14:47	
Total Readings:	138	
Job Started:	09/03/13 14:47	
Job Finished:	09/03/13 15:23	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	0.3	QM
005	A	Ceiling			I	Drywall	White	-0.1	QM
010	A	Window	Lft	Rgt casing	I	Wood	White	-0.2	QM
011	A	Window	Lft	Sill	I	Wood	White	0.0	QM
008	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
007	A	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
009	A	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
018	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.4	QM
002	B	Wall	L Ctr		I	Drywall	White	0.2	QM
017	B	Stairs	Ctr	Treads	I	Wood	Varnish	-0.3	QM
013	B	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.3	QM
012	B	Closet	Ctr	Shelf	I	Wood	White	0.0	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.6	QM
006	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
016	C	Stairs	Ctr	Wall	I	Wood	White	-0.3	QM
015	C	Stairs	Ctr	Risers	I	Wood	White	-0.3	QM
014	C	Stairs	Ctr	Stringer	I	Wood	White	-0.5	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
Interior Room 002 Bedroom A/B									
019	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
023	A	Ceiling			I	Drywall	White	-0.7	QM
029	A	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
020	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
028	B	Cabinet	Rgt		I	Wood	Varnish	-0.1	QM
021	C	Wall	L Ctr		I	Drywall	White	0.0	QM
024	C	Baseboard	Ctr		I	Wood	White	-0.6	QM
022	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
026	D	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
025	D	Door	Lft	Rgt casing	I	Wood	White	-0.6	QM
027	D	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
Interior Room 003 Living/Din									
030	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
034	A	Ceiling			I	Drywall	White	-0.1	QM
031	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
032	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
035	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
039	C	Window	Lft	Rgt casing	I	Wood	White	-0.2	QM
040	C	Window	Lft	Sash	I	Wood	White	-0.6	QM
041	C	Window	Lft	Sill	I	Wood	White	-0.3	QM
037	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.3	QM
036	C	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
038	C	Door	Ctr	U Ctr	I	Wood	White	0.2	QM
033	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
Interior Room 004 Kitchen									
042	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
043	B	Wall	L Ctr		I	Drywall	White	-0.5	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	250 Gulfstream Drive- Interior
Report No.	09/03/13 14:47	
Total Readings:	138	
Job Started:	09/03/13 14:47	
Job Finished:	09/03/13 15:23	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	0.3	QM
005	A	Ceiling			I	Drywall	White	-0.1	QM
010	A	Window	Lft	Rgt casing	I	Wood	White	-0.2	QM
011	A	Window	Lft	Sill	I	Wood	White	0.0	QM
008	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
007	A	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
009	A	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
018	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.4	QM
002	B	Wall	L Ctr		I	Drywall	White	0.2	QM
017	B	Stairs	Ctr	Treads	I	Wood	Varnish	-0.3	QM
013	B	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.3	QM
012	B	Closet	Ctr	Shelf	I	Wood	White	0.0	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.6	QM
006	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
016	C	Stairs	Ctr	Wall	I	Wood	White	-0.3	QM
015	C	Stairs	Ctr	Risers	I	Wood	White	-0.3	QM
014	C	Stairs	Ctr	Stringer	I	Wood	White	-0.5	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
Interior Room 002 Bedroom A/B									
019	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
023	A	Ceiling			I	Drywall	White	-0.7	QM
029	A	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
020	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
028	B	Cabinet	Rgt		I	Wood	Varnish	-0.1	QM
021	C	Wall	L Ctr		I	Drywall	White	0.0	QM
024	C	Baseboard	Ctr		I	Wood	White	-0.6	QM
022	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
026	D	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
025	D	Door	Lft	Rgt casing	I	Wood	White	-0.6	QM
027	D	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
Interior Room 003 Living/Din									
030	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
034	A	Ceiling			I	Drywall	White	-0.1	QM
031	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
032	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
035	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
039	C	Window	Lft	Rgt casing	I	Wood	White	-0.2	QM
040	C	Window	Lft	Sash	I	Wood	White	-0.6	QM
041	C	Window	Lft	Sill	I	Wood	White	-0.3	QM
037	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.3	QM
036	C	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
038	C	Door	Ctr	U Ctr	I	Wood	White	0.2	QM
033	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
Interior Room 004 Kitchen									
042	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
043	B	Wall	L Ctr		I	Drywall	White	-0.5	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
099	A	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM
087	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
088	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
091	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
095	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
096	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
097	C	Window	Ctr	Sill	I	Wood	White	-0.3	QM
089	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
Interior Room 009 UpperBedC/D									
101	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
105	A	Ceiling			I	Drywall	White	-0.4	QM
113	A	Closet	Lft	Door	I	Wood	White	-0.1	QM
115	A	Closet	Ctr	Shelf Sup.	I	Wood	White	0.0	QM
114	A	Closet	Ctr	Shelf	I	Wood	White	-0.4	QM
102	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
108	B	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM
107	B	Door	Lft	Rgt casing	I	Wood	White	-0.4	QM
109	B	Door	Lft	U Ctr	I	Wood	White	-0.3	QM
103	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
106	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
110	C	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
111	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
112	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
104	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 010 UpperBath									
116	A	Wall	U Ctr		I	Drywall	White	0.0	QM
120	A	Ceiling			I	Drywall	White	-0.2	QM
125	A	Bathtub	Ctr		I	Porcelain	White	-0.6	QM
117	B	Wall	U Ctr		I	Drywall	White	-0.3	QM
123	B	Door	Ctr	Rgt jamb	I	Wood	White	-1.0	QM
122	B	Door	Ctr	Rgt casing	I	Wood	White	-0.5	QM
124	B	Door	Ctr	U Ctr	I	Wood	White	-0.4	QM
126	B	Sink	Lft		I	Porcelain	White	-0.6	QM
121	C	Wall	L Ctr		I	Ceramic	Tan	3.9	QM
118	C	Wall	U Ctr		I	Drywall	White	0.0	QM
119	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
127	D	Cabinet	Lft		I	Wood	White	0.0	QM
Interior Room 011 UpperHall									
128	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
132	A	Ceiling			I	Drywall	White	-0.1	QM
137	A	Attic Hatch	Ctr		I	Wood	White	-1.1	QM
138	A	Attic Casing	Ctr		I	Wood	White	0.0	QM
129	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
136	B	Closet	Ctr	Door	I	Wood	White	-0.3	QM
134	B	Closet	Ctr	Door Casing	I	Wood	White	-0.2	QM
135	B	Closet	Ctr	Door Jamb	I	Wood	White	-0.3	QM
130	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
133	C	Baseboard	Ctr		I	Wood	White	-0.5	QM
131	D	Wall	L Ctr		I	Drywall	White	-0.1	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/23/2013
Abatement Level: 1.0
Report No. 09/03/13 14:47
Total Reading Sets: 138
Job Started: 09/03/13 14:47
Job Finished: 09/03/13 15:23

USCG Elizabeth City
Housing Units
250 Gulfstream Drive- Interior

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Attic Casing	1	0	<0%>	1	<100%>	0	<0%>
Attic Hatch	1	0	<0%>	1	<100%>	0	<0%>
Baseboard	9	0	<0%>	9	<100%>	0	<0%>
Bathtub	2	0	<0%>	2	<100%>	0	<0%>
Cabinet	5	0	<0%>	5	<100%>	0	<0%>
Ceiling	11	0	<0%>	11	<100%>	0	<0%>
Closet Door	3	0	<0%>	3	<100%>	0	<0%>
Closet Door Casing	1	0	<0%>	1	<100%>	0	<0%>
Closet Door Jamb	1	0	<0%>	1	<100%>	0	<0%>
Closet Shelf	4	0	<0%>	4	<100%>	0	<0%>
Closet Shelf Sup.	4	0	<0%>	4	<100%>	0	<0%>
Door Rgt casing	8	0	<0%>	8	<100%>	0	<0%>
Door Rgt jamb	9	0	<0%>	9	<100%>	0	<0%>
Door U Ctr	9	0	<0%>	9	<100%>	0	<0%>
Sink	2	0	<0%>	2	<100%>	0	<0%>
Stairs Railing cap	1	0	<0%>	1	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	46	2	<4%>	44	<96%>	0	<0%>
Window Rgt casing	6	0	<0%>	6	<100%>	0	<0%>
Window Sash	5	0	<0%>	5	<100%>	0	<0%>
Window Sill	6	0	<0%>	6	<100%>	0	<0%>
Inspection Totals:	138	2	< 1%>	136	< 99%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/03/13 14:09

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
250 Gulfstream Drive- Interior

INSPECTION DATE: 09/03/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 120173

SIGNED: _____ **Date:** 9/23/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	250 Gulfstream Drive- Interior
Report No.	09/03/13 14:09	
Total Readings:	129 Actionable: 2	
Job Started:	09/03/13 14:09	
Job Finished:	09/03/13 14:45	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 006 MasterBath									
070	C	Wall	L Ctr		I	Ceramic	Tan	3.9	QM
Interior Room 007 UpperBath									
082	C	Wall	L Ctr		I	Ceramic	Tan	5.8	QM

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/03/13
Report Date: 9/23/2013
Abatement Level: 1.0
Report No. 09/03/13 14:09
Total Readings: 129
Job Started: 09/03/13 14:09
Job Finished: 09/03/13 14:45

USCG Elizabeth City
Housing Units
250 Gulfstream Drive- Interior

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
5	001	Hall/Stairs	B	Ceiling			I	Drywall	White	0.0	QM
6	001	Hall/Stairs	C	Baseboard	Ctr		I	Wood	White	0.0	QM
7	001	Hall/Stairs	A	Door	Lft	Rgt casing	I	Wood	White	-0.5	QM
8	001	Hall/Stairs	A	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
9	001	Hall/Stairs	A	Door	Lft	U Rgt	I	Wood	White	-0.3	QM
10	001	Hall/Stairs	A	Window	Rgt	Rgt casing	I	Wood	White	-0.3	QM
11	001	Hall/Stairs	A	Window	Rgt	Sill	I	Wood	White	-0.3	QM
12	001	Hall/Stairs	D	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
13	001	Hall/Stairs	C	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.2	QM
14	001	Hall/Stairs	C	Stairs	Ctr	Stringer	I	Wood	White	0.0	QM
15	001	Hall/Stairs	D	Stairs	Ctr	Risers	I	Wood	White	-0.2	QM
16	001	Hall/Stairs	B	Stairs	Ctr	Wall	I	Wood	White	-0.2	QM
17	001	Hall/Stairs	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.4	QM
18	001	Hall/Stairs	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.5	QM
19	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	0.0	QM
20	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	0.0	QM
21	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	0.1	QM
22	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	0.0	QM
23	002	Bedroom A/B	D	Ceiling			I	Drywall	White	0.0	QM
24	002	Bedroom A/B	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
25	002	Bedroom A/B	D	Door	Lft	Rgt casing	I	Wood	White	0.1	QM
26	002	Bedroom A/B	D	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM
27	002	Bedroom A/B	D	Door	Lft	U Ctr	I	Wood	White	-0.6	QM
28	002	Bedroom A/B	A	Window	Ctr	Rgt casing	I	Wood	White	-1.0	QM
29	002	Bedroom A/B	A	Window	Ctr	Sash	I	Wood	White	-0.6	QM
30	002	Bedroom A/B	A	Window	Ctr	Sill	I	Wood	White	-0.3	QM
31	003	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
32	003	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
33	003	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
34	003	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
35	003	Kitchen	A	Ceiling			I	Drywall	White	-0.6	QM
36	003	Kitchen	C	Baseboard	Ctr		I	Vinyl	Black	-0.6	QM
37	003	Kitchen	B	Cabinet	Ctr		I	Wood	Varnish	-0.4	QM
38	004	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
39	004	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.9	QM
40	004	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
41	004	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
42	004	Living/Din	A	Ceiling			I	Drywall	White	-0.1	QM
43	004	Living/Din	C	Baseboard	Ctr		I	Wood	White	-0.9	QM
44	004	Living/Din	C	Door	Ctr	Rgt casing	I	Wood	White	-0.5	QM
45	004	Living/Din	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.3	QM
46	004	Living/Din	C	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
47	004	Living/Din	C	Window	Rgt	Rgt casing	I	Wood	White	-0.4	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Living/Din	C	Window	Rgt	Sash	I	Wood	White	0.1	QM
49	004	Living/Din	C	Window	Rgt	Sill	I	Wood	White	0.1	QM
50	005	UpperBedA/B	A	Wall	L Ctr		I	Drywall	White	0.2	QM
51	005	UpperBedA/B	B	Wall	L Ctr		I	Drywall	White	-0.8	QM
52	005	UpperBedA/B	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
53	005	UpperBedA/B	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
54	005	UpperBedA/B	A	Ceiling			I	Drywall	White	0.2	QM
55	005	UpperBedA/B	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
56	005	UpperBedA/B	C	Door	Rgt	Rgt casing	I	Wood	White	-0.6	QM
57	005	UpperBedA/B	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.7	QM
58	005	UpperBedA/B	C	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
59	005	UpperBedA/B	A	Window	Ctr	Rgt casing	I	Wood	White	-0.5	QM
60	005	UpperBedA/B	A	Window	Ctr	Sash	I	Wood	White	-0.7	QM
61	005	UpperBedA/B	A	Window	Ctr	Sill	I	Wood	White	-0.7	QM
62	005	UpperBedA/B	A	Mini Blinds	Ctr		I	Vinyl	White	-0.5	QM
		Blinds on floor									
63	005	UpperBedA/B	D	Closet	Ctr	Shelf	I	Wood	White	-0.5	QM
64	005	UpperBedA/B	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.3	QM
65	006	MasterBath	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
66	006	MasterBath	B	Wall	U Ctr		I	Drywall	White	-0.7	QM
67	006	MasterBath	C	Wall	U Ctr		I	Drywall	White	-0.5	QM
68	006	MasterBath	D	Wall	U Ctr		I	Drywall	White	-1.0	QM
69	006	MasterBath	A	Ceiling			I	Drywall	White	-0.4	QM
70	006	MasterBath	C	Wall	L Ctr		I	Ceramic	Tan	3.9	QM
71	006	MasterBath	A	Door	Rgt	Rgt casing	I	Wood	White	-1.0	QM
72	006	MasterBath	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.6	QM
73	006	MasterBath	A	Door	Rgt	U Ctr	I	Wood	White	-0.4	QM
74	006	MasterBath	C	Bathtub	Ctr		I	Porcelain	White	-0.3	QM
75	006	MasterBath	D	Sink	Rgt		I	Porcelain	White	-0.9	QM
76	006	MasterBath	D	Cabinet	Rgt		I	Wood	White	-0.3	QM
77	007	UpperBath	A	Wall	U Ctr		I	Drywall	White	0.0	QM
78	007	UpperBath	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
79	007	UpperBath	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
80	007	UpperBath	D	Wall	U Ctr		I	Drywall	White	-0.7	QM
81	007	UpperBath	A	Ceiling			I	Drywall	White	-0.2	QM
82	007	UpperBath	C	Wall	L Ctr		I	Ceramic	Tan	5.8	QM
83	007	UpperBath	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
84	007	UpperBath	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
85	007	UpperBath	D	Door	Lft	U Ctr	I	Wood	White	-0.4	QM
86	007	UpperBath	B	Cabinet	Rgt		I	Wood	White	-0.7	QM
87	008	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
88	008	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
89	008	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
90	008	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
91	008	UpperBedB/C	A	Ceiling			I	Drywall	White	-0.3	QM
92	008	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
93	008	UpperBedB/C	D	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
94	008	UpperBedB/C	D	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
95	008	UpperBedB/C	D	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
96	008	UpperBedB/C	C	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
97	008	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	0.1	QM
98	008	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	-0.2	QM
99	008	UpperBedB/C	C	Mini Blinds	Ctr		I	Vinyl	White	-0.5	QM
		Blinds on floor									
100	008	UpperBedB/C	A	Closet	Rgt	Shelf	I	Wood	White	0.0	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
101	008	UpperBedB/C	A	Closet	Rgt	Shelf Sup.	I	Wood	White	0.0	QM
102	008	UpperBedB/C	A	Closet	Rgt	Door	I	Wood	White	-0.2	QM
103	009	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	0.2	QM
104	009	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
105	009	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
106	009	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
107	009	UpperBedC/D	D	Ceiling			I	Drywall	White	-0.5	QM
108	009	UpperBedC/D	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
109	009	UpperBedC/D	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
110	009	UpperBedC/D	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
111	009	UpperBedC/D	A	Door	Rgt	U Ctr	I	Wood	White	-0.4	QM
112	009	UpperBedC/D	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
113	009	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	-0.4	QM
114	009	UpperBedC/D	C	Window	Ctr	Sill	I	Wood	White	-0.3	QM
115	009	UpperBedC/D	C	Mini Blinds	Ctr		I	Vinyl	White	-0.4	QM
		Blinds on floor									
116	009	UpperBedC/D	A	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
117	009	UpperBedC/D	A	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.3	QM
118	009	UpperBedC/D	A	Closet	Ctr	Door	I	Wood	White	-0.2	QM
119	010	UpperHall	A	Wall	L Ctr		I	Drywall	White	-0.6	QM
120	010	UpperHall	B	Wall	L Rgt		I	Drywall	White	-0.3	QM
121	010	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
122	010	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
123	010	UpperHall	A	Ceiling			I	Drywall	White	0.2	QM
124	010	UpperHall	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
125	010	UpperHall	D	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
126	010	UpperHall	D	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
127	010	UpperHall	D	Door	Ctr	U Ctr	I	Wood	White	-0.6	QM
128	010	UpperHall	D	Closet	Ctr	Shelf	I	Wood	White	-0.9	QM
129	010	UpperHall	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.2	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	250 Gulfstream Drive- Interior
Report No.	09/03/13 14:09	
Total Readings:	129	
Job Started:	09/03/13 14:09	
Job Finished:	09/03/13 14:45	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
010	A	Window	Rgt	Rgt casing	I	Wood	White	-0.3	QM
011	A	Window	Rgt	Sill	I	Wood	White	-0.3	QM
008	A	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
007	A	Door	Lft	Rgt casing	I	Wood	White	-0.5	QM
009	A	Door	Lft	U Rgt	I	Wood	White	-0.3	QM
018	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.5	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
005	B	Ceiling			I	Drywall	White	0.0	QM
016	B	Stairs	Ctr	Wall	I	Wood	White	-0.2	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
006	C	Baseboard	Ctr		I	Wood	White	0.0	QM
014	C	Stairs	Ctr	Stringer	I	Wood	White	0.0	QM
013	C	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.2	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
017	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.4	QM
015	D	Stairs	Ctr	Risers	I	Wood	White	-0.2	QM
012	D	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
Interior Room 002 Bedroom A/B									
019	A	Wall	L Ctr		I	Drywall	White	0.0	QM
028	A	Window	Ctr	Rgt casing	I	Wood	White	-1.0	QM
029	A	Window	Ctr	Sash	I	Wood	White	-0.6	QM
030	A	Window	Ctr	Sill	I	Wood	White	-0.3	QM
020	B	Wall	L Ctr		I	Drywall	White	0.0	QM
021	C	Wall	L Ctr		I	Drywall	White	0.1	QM
024	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
022	D	Wall	L Ctr		I	Drywall	White	0.0	QM
023	D	Ceiling			I	Drywall	White	0.0	QM
026	D	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM
025	D	Door	Lft	Rgt casing	I	Wood	White	0.1	QM
027	D	Door	Lft	U Ctr	I	Wood	White	-0.6	QM
Interior Room 003 Kitchen									
031	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
035	A	Ceiling			I	Drywall	White	-0.6	QM
032	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
037	B	Cabinet	Ctr		I	Wood	Varnish	-0.4	QM
033	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
036	C	Baseboard	Ctr		I	Vinyl	Black	-0.6	QM
034	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Interior Room 004 Living/Din									
038	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
042	A	Ceiling			I	Drywall	White	-0.1	QM
039	B	Wall	L Ctr		I	Drywall	White	-0.9	QM
040	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
043	C	Baseboard	Ctr		I	Wood	White	-0.9	QM
047	C	Window	Rgt	Rgt casing	I	Wood	White	-0.4	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
048	C	Window	Rgt	Sash	I	Wood	White	0.1	QM
049	C	Window	Rgt	Sill	I	Wood	White	0.1	QM
045	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.3	QM
044	C	Door	Ctr	Rgt casing	I	Wood	White	-0.5	QM
046	C	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
041	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
Interior Room 005 UpperBedA/B									
050	A	Wall	L Ctr		I	Drywall	White	0.2	QM
054	A	Ceiling			I	Drywall	White	0.2	QM
059	A	Window	Ctr	Rgt casing	I	Wood	White	-0.5	QM
060	A	Window	Ctr	Sash	I	Wood	White	-0.7	QM
061	A	Window	Ctr	Sill	I	Wood	White	-0.7	QM
062	A	Mini Blinds	Ctr		I	Vinyl	White	-0.5	QM
	Blinds on floor								
051	B	Wall	L Ctr		I	Drywall	White	-0.8	QM
052	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
055	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
057	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.7	QM
056	C	Door	Rgt	Rgt casing	I	Wood	White	-0.6	QM
058	C	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
053	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
064	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.3	QM
063	D	Closet	Ctr	Shelf	I	Wood	White	-0.5	QM
Interior Room 006 MasterBath									
065	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
069	A	Ceiling			I	Drywall	White	-0.4	QM
072	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.6	QM
071	A	Door	Rgt	Rgt casing	I	Wood	White	-1.0	QM
073	A	Door	Rgt	U Ctr	I	Wood	White	-0.4	QM
066	B	Wall	U Ctr		I	Drywall	White	-0.7	QM
070	C	Wall	L Ctr		I	Ceramic	Tan	3.9	QM
067	C	Wall	U Ctr		I	Drywall	White	-0.5	QM
074	C	Bathtub	Ctr		I	Porcelain	White	-0.3	QM
068	D	Wall	U Ctr		I	Drywall	White	-1.0	QM
075	D	Sink	Rgt		I	Porcelain	White	-0.9	QM
076	D	Cabinet	Rgt		I	Wood	White	-0.3	QM
Interior Room 007 UpperBath									
077	A	Wall	U Ctr		I	Drywall	White	0.0	QM
081	A	Ceiling			I	Drywall	White	-0.2	QM
078	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
086	B	Cabinet	Rgt		I	Wood	White	-0.7	QM
082	C	Wall	L Ctr		I	Ceramic	Tan	5.8	QM
079	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
080	D	Wall	U Ctr		I	Drywall	White	-0.7	QM
084	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
083	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
085	D	Door	Lft	U Ctr	I	Wood	White	-0.4	QM
Interior Room 008 UpperBedB/C									
087	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
091	A	Ceiling			I	Drywall	White	-0.3	QM
102	A	Closet	Rgt	Door	I	Wood	White	-0.2	QM
101	A	Closet	Rgt	Shelf Sup.	I	Wood	White	0.0	QM
100	A	Closet	Rgt	Shelf	I	Wood	White	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
088	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
089	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
092	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
096	C	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
097	C	Window	Ctr	Sash	I	Wood	White	0.1	QM
098	C	Window	Ctr	Sill	I	Wood	White	-0.2	QM
099	C	Mini Blinds	Ctr		I	Vinyl	White	-0.5	QM
	Blinds on floor								
090	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
094	D	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
093	D	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
095	D	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
Interior Room 009 UpperBedC/D									
103	A	Wall	L Ctr		I	Drywall	White	0.2	QM
110	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
109	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
111	A	Door	Rgt	U Ctr	I	Wood	White	-0.4	QM
118	A	Closet	Ctr	Door	I	Wood	White	-0.2	QM
117	A	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.3	QM
116	A	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
104	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
105	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
108	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
112	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
113	C	Window	Ctr	Sash	I	Wood	White	-0.4	QM
114	C	Window	Ctr	Sill	I	Wood	White	-0.3	QM
115	C	Mini Blinds	Ctr		I	Vinyl	White	-0.4	QM
	Blinds on floor								
106	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
107	D	Ceiling			I	Drywall	White	-0.5	QM
Interior Room 010 UpperHall									
119	A	Wall	L Ctr		I	Drywall	White	-0.6	QM
123	A	Ceiling			I	Drywall	White	0.2	QM
120	B	Wall	L Rgt		I	Drywall	White	-0.3	QM
121	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
124	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
122	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
126	D	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
125	D	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
127	D	Door	Ctr	U Ctr	I	Wood	White	-0.6	QM
129	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.2	QM
128	D	Closet	Ctr	Shelf	I	Wood	White	-0.9	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/03/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	250 Gulfstream Drive- Interior
Report No.	09/03/13 14:09	
Total Reading Sets:	129	
Job Started:	09/03/13 14:09	
Job Finished:	09/03/13 14:45	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Baseboard	8	0	<0%>	8	<100%>	0	<0%>
Bathtub	1	0	<0%>	1	<100%>	0	<0%>
Cabinet	3	0	<0%>	3	<100%>	0	<0%>
Ceiling	10	0	<0%>	10	<100%>	0	<0%>
Closet Door	2	0	<0%>	2	<100%>	0	<0%>
Closet Shelf	5	0	<0%>	5	<100%>	0	<0%>
Closet Shelf Sup.	5	0	<0%>	5	<100%>	0	<0%>
Door Rgt casing	9	0	<0%>	9	<100%>	0	<0%>
Door Rgt jamb	9	0	<0%>	9	<100%>	0	<0%>
Door U Ctr	8	0	<0%>	8	<100%>	0	<0%>
Door U Rgt	1	0	<0%>	1	<100%>	0	<0%>
Mini Blinds	3	0	<0%>	3	<100%>	0	<0%>
Sink	1	0	<0%>	1	<100%>	0	<0%>
Stairs Railing cap	1	0	<0%>	1	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	42	2	<5%>	40	<95%>	0	<0%>
Window Rgt casing	6	0	<0%>	6	<100%>	0	<0%>
Window Sash	5	0	<0%>	5	<100%>	0	<0%>
Window Sill	6	0	<0%>	6	<100%>	0	<0%>
Inspection Totals:	129	2	< 2%>	127	< 98%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 08:41

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
279 Gulfstream Drive- Interior

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____ **Date:** 9/23/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	279 Gulfstream Drive- Interior
Report No.	09/04/13 08:41	
Total Readings:	130 Actionable: 2	
Job Started:	09/04/13 08:41	
Job Finished:	09/04/13 09:45	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 007 MasterBath									
078	C	Wall	L Ctr		I	Ceramic	Tan	4.8	QM
Interior Room 010 UpperBath									
115	C	Wall	L Ctr		I	Ceramic	Tan	5.6	QM
Calibration Readings									

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	279 Gulfstream Drive- Interior
Report No.	09/04/13 08:41	
Total Readings:	130	
Job Started:	09/04/13 08:41	
Job Finished:	09/04/13 09:45	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1		CALIBRATION								1.0	QM
2		CALIBRATION								1.0	QM
3		CALIBRATION								1.0	QM
4		CALIBRATION								-0.2	QM
5		CALIBRATION								0.0	QM
6		CALIBRATION								-0.2	QM
7	001	Hall/Stairs	A	Door	Rgt	Rgt casing	I	Wood	White	0.1	QM
8	001	Hall/Stairs	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
9	001	Hall/Stairs	A	Door	Rgt	U Ctr	I	Wood	White	-0.4	QM
10	001	Hall/Stairs	A	Window	Lft	Rgt casing	I	Wood	White	0.0	QM
11	001	Hall/Stairs	A	Window	Lft	Sill	I	Wood	White	-0.1	QM
12	001	Hall/Stairs	B	Closet	Ctr	Shelf	I	Wood	White	-0.3	QM
13	001	Hall/Stairs	C	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.6	QM
14	001	Hall/Stairs	C	Stairs	Ctr	Stringer	I	Wood	White	-0.6	QM
15	001	Hall/Stairs	B	Stairs	Ctr	Risers	I	Wood	White	-0.1	QM
16	001	Hall/Stairs	D	Stairs	Ctr	Wall	I	Wood	White	-0.4	QM
17	001	Hall/Stairs	B	Stairs	Ctr	Risers	I	Wood	Varnish	-0.7	QM
18	001	Hall/Stairs	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.6	QM
19	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	-0.8	QM
20	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
21	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
22	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	-0.7	QM
23	002	Bedroom A/B	A	Ceiling			I	Drywall	White	-0.2	QM
24	002	Bedroom A/B	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
25	002	Bedroom A/B	D	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
26	002	Bedroom A/B	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
27	002	Bedroom A/B	D	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
28	002	Bedroom A/B	B	Cabinet	Rgt		I	Wood	Varnish	-0.1	QM
29	002	Bedroom A/B	A	Cabinet	Ctr		I	Wood	Varnish	-0.6	QM
30	003	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.6	QM
31	003	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
32	003	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
33	003	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
34	003	Living/Din	A	Ceiling			I	Drywall	White	0.2	QM
35	003	Living/Din	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
36	003	Living/Din	C	Door	Ctr	Rgt casing	I	Wood	White	0.1	QM
37	003	Living/Din	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.6	QM
38	003	Living/Din	C	Door	Ctr	U Ctr	I	Metal	White	-0.8	QM
39	003	Living/Din	C	Window	Lft	Rgt casing	I	Wood	White	0.1	QM
40	003	Living/Din	C	Window	Lft	Sash	I	Wood	White	-0.4	QM
41	003	Living/Din	C	Window	Lft	Sill	I	Wood	White	-0.2	QM
42	004	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
43	004	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.6	QM
44	004	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
45	004	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
46	004	Kitchen	A	Ceiling			I	Drywall	White	-0.1	QM
47	004	Kitchen	C	Baseboard	Ctr		I	Wood	White	-0.3	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Kitchen	D	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
49	005	Bedroom D/A	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
50	005	Bedroom D/A	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
51	005	Bedroom D/A	C	Wall	L Ctr		I	Drywall	White	-1.1	QM
52	005	Bedroom D/A	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
53	005	Bedroom D/A	A	Ceiling			I	Drywall	White	0.0	QM
54	005	Bedroom D/A	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
55	005	Bedroom D/A	B	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
56	005	Bedroom D/A	B	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
57	005	Bedroom D/A	B	Door	Rgt	U Ctr	I	Wood	White	0.2	QM
58	005	Bedroom D/A	A	Window	Ctr	Rgt casing	I	Wood	White	0.1	QM
59	005	Bedroom D/A	A	Window	Ctr	Sash	I	Wood	White	-0.3	QM
60	005	Bedroom D/A	A	Window	Ctr	Sill	I	Wood	White	-0.2	QM
61	006	UpperBedD/A	A	Wall	L Ctr		I	Drywall	White	0.1	QM
62	006	UpperBedD/A	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
63	006	UpperBedD/A	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
64	006	UpperBedD/A	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
65	006	UpperBedD/A	A	Ceiling			I	Drywall	White	-0.2	QM
66	006	UpperBedD/A	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
67	006	UpperBedD/A	B	Closet	Lft	Door Casing	I	Wood	White	-0.2	QM
68	006	UpperBedD/A	B	Closet	Lft	Door Jamb	I	Wood	White	-0.4	QM
69	006	UpperBedD/A	B	Closet	Lft	Door	I	Wood	White	-0.4	QM
70	006	UpperBedD/A	A	Window	Rgt	Rgt casing	I	Wood	White	0.2	QM
71	006	UpperBedD/A	A	Window	Rgt	Sash	I	Wood	White	-0.3	QM
72	006	UpperBedD/A	A	Window	Rgt	Sill	I	Wood	White	-0.4	QM
73	007	MasterBath	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
74	007	MasterBath	B	Wall	U Ctr		I	Drywall	White	0.0	QM
75	007	MasterBath	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
76	007	MasterBath	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
77	007	MasterBath	A	Ceiling			I	Drywall	White	0.2	QM
78	007	MasterBath	C	Wall	L Ctr		I	Ceramic	Tan	4.8	QM
79	007	MasterBath	A	Door	Lft	Rgt casing	I	Wood	White	0.1	QM
80	007	MasterBath	A	Door	Lft	Rgt jamb	I	Wood	White	0.2	QM
81	007	MasterBath	A	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
82	007	MasterBath	B	Cabinet	Lft		I	Wood	White	-0.4	QM
83	008	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
84	008	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
85	008	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
86	008	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
87	008	UpperBedB/C	A	Ceiling			I	Drywall	White	-0.3	QM
88	008	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
89	008	UpperBedB/C	A	Door	Lft	Rgt casing	I	Wood	White	-0.3	QM
90	008	UpperBedB/C	A	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
91	008	UpperBedB/C	A	Door	Lft	U Ctr	I	Wood	White	-0.8	QM
92	008	UpperBedB/C	C	Window	Ctr	Rgt casing	I	Wood	White	-1.0	QM
93	008	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
94	008	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	-1.1	QM
95	008	UpperBedB/C	A	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
96	008	UpperBedB/C	A	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.2	QM
97	008	UpperBedB/C	A	Closet	Ctr	Door	I	Wood	White	-0.5	QM
98	009	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
99	009	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
100	009	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	0.0	QM
101	009	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
102	009	UpperBedC/D	A	Ceiling			I	Drywall	White	0.0	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	009	UpperBedC/D	C	Baseboard	Ctr		I	Wood	White	0.1	QM
104	009	UpperBedC/D	B	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
105	009	UpperBedC/D	B	Door	Lft	Rgt jamb	I	Wood	White	-1.2	QM
106	009	UpperBedC/D	B	Door	Lft	U Ctr	I	Wood	White	0.0	QM
107	009	UpperBedC/D	C	Window	Lft	Rgt casing	I	Wood	White	-0.3	QM
108	009	UpperBedC/D	C	Window	Lft	Sash	I	Wood	White	0.0	QM
109	009	UpperBedC/D	C	Window	Lft	Sill	I	Wood	White	-0.4	QM
110	010	UpperBath	A	Wall	U Ctr		I	Drywall	White	0.0	QM
111	010	UpperBath	B	Wall	U Ctr		I	Drywall	White	-0.1	QM
112	010	UpperBath	C	Wall	U Ctr		I	Drywall	White	-0.3	QM
113	010	UpperBath	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
114	010	UpperBath	A	Ceiling			I	Drywall	White	-0.2	QM
115	010	UpperBath	C	Wall	L Ctr		I	Ceramic	Tan	5.6	QM
116	010	UpperBath	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
117	010	UpperBath	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
118	010	UpperBath	B	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
119	010	UpperBath	D	Cabinet	Lft		I	Wood	White	-0.4	QM
120	011	UpperHall	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
121	011	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.6	QM
122	011	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
123	011	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
124	011	UpperHall	A	Ceiling			I	Drywall	White	-0.6	QM
125	011	UpperHall	C	Baseboard	Ctr		I	Wood	White	-1.3	QM
126	011	UpperHall	D	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
127	011	UpperHall	D	Door	Ctr	Rgt jamb	I	Wood	White	-0.5	QM
128	011	UpperHall	D	Door	Ctr	U Ctr	I	Wood	White	-0.3	QM
129	011	UpperHall	A	Attic Hatch	Ctr		I	Wood	White	0.1	QM
130	011	UpperHall	A	Attic Casing	Ctr		I	Wood	White	0.0	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	279 Gulfstream Drive- Interior
Report No.	09/04/13 08:41	
Total Readings:	130	
Job Started:	09/04/13 08:41	
Job Finished:	09/04/13 09:45	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
010	A	Window	Lft	Rgt casing	I	Wood	White	0.0	QM
011	A	Window	Lft	Sill	I	Wood	White	-0.1	QM
008	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
007	A	Door	Rgt	Rgt casing	I	Wood	White	0.1	QM
009	A	Door	Rgt	U Ctr	I	Wood	White	-0.4	QM
018	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.6	QM
015	B	Stairs	Ctr	Risers	I	Wood	White	-0.1	QM
017	B	Stairs	Ctr	Risers	I	Wood	Varnish	-0.7	QM
012	B	Closet	Ctr	Shelf	I	Wood	White	-0.3	QM
014	C	Stairs	Ctr	Stringer	I	Wood	White	-0.6	QM
013	C	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.6	QM
016	D	Stairs	Ctr	Wall	I	Wood	White	-0.4	QM
Interior Room 002 Bedroom A/B									
019	A	Wall	L Ctr		I	Drywall	White	-0.8	QM
023	A	Ceiling			I	Drywall	White	-0.2	QM
029	A	Cabinet	Ctr		I	Wood	Varnish	-0.6	QM
020	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
028	B	Cabinet	Rgt		I	Wood	Varnish	-0.1	QM
021	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
024	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
022	D	Wall	L Ctr		I	Drywall	White	-0.7	QM
026	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
025	D	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
027	D	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
Interior Room 003 Living/Din									
030	A	Wall	L Ctr		I	Drywall	White	-0.6	QM
034	A	Ceiling			I	Drywall	White	0.2	QM
031	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
032	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
035	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
039	C	Window	Lft	Rgt casing	I	Wood	White	0.1	QM
040	C	Window	Lft	Sash	I	Wood	White	-0.4	QM
041	C	Window	Lft	Sill	I	Wood	White	-0.2	QM
037	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.6	QM
036	C	Door	Ctr	Rgt casing	I	Wood	White	0.1	QM
038	C	Door	Ctr	U Ctr	I	Metal	White	-0.8	QM
033	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
Interior Room 004 Kitchen									
042	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
046	A	Ceiling			I	Drywall	White	-0.1	QM
043	B	Wall	L Ctr		I	Drywall	White	-0.6	QM
044	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
047	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
045	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
048	D	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 005 Bedroom D/A									
049	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
053	A	Ceiling			I	Drywall	White	0.0	QM
058	A	Window	Ctr	Rgt casing	I	Wood	White	0.1	QM
059	A	Window	Ctr	Sash	I	Wood	White	-0.3	QM
060	A	Window	Ctr	Sill	I	Wood	White	-0.2	QM
050	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
056	B	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
055	B	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
057	B	Door	Rgt	U Ctr	I	Wood	White	0.2	QM
051	C	Wall	L Ctr		I	Drywall	White	-1.1	QM
054	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
052	D	Wall	L Ctr		I	Drywall	White	-0.5	QM
Interior Room 006 UpperBedD/A									
061	A	Wall	L Ctr		I	Drywall	White	0.1	QM
065	A	Ceiling			I	Drywall	White	-0.2	QM
070	A	Window	Rgt	Rgt casing	I	Wood	White	0.2	QM
071	A	Window	Rgt	Sash	I	Wood	White	-0.3	QM
072	A	Window	Rgt	Sill	I	Wood	White	-0.4	QM
062	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
069	B	Closet	Lft	Door	I	Wood	White	-0.4	QM
067	B	Closet	Lft	Door Casing	I	Wood	White	-0.2	QM
068	B	Closet	Lft	Door Jamb	I	Wood	White	-0.4	QM
063	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
066	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
064	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 007 MasterBath									
073	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
077	A	Ceiling			I	Drywall	White	0.2	QM
080	A	Door	Lft	Rgt jamb	I	Wood	White	0.2	QM
079	A	Door	Lft	Rgt casing	I	Wood	White	0.1	QM
081	A	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
074	B	Wall	U Ctr		I	Drywall	White	0.0	QM
082	B	Cabinet	Lft		I	Wood	White	-0.4	QM
078	C	Wall	L Ctr		I	Ceramic	Tan	4.8	QM
075	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
076	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
Interior Room 008 UpperBedB/C									
083	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
087	A	Ceiling			I	Drywall	White	-0.3	QM
090	A	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
089	A	Door	Lft	Rgt casing	I	Wood	White	-0.3	QM
091	A	Door	Lft	U Ctr	I	Wood	White	-0.8	QM
097	A	Closet	Ctr	Door	I	Wood	White	-0.5	QM
096	A	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.2	QM
095	A	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
084	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
085	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
088	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
092	C	Window	Ctr	Rgt casing	I	Wood	White	-1.0	QM
093	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
094	C	Window	Ctr	Sill	I	Wood	White	-1.1	QM
086	D	Wall	L Ctr		I	Drywall	White	-0.5	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 009 UpperBedC/D									
098	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
102	A	Ceiling			I	Drywall	White	0.0	QM
099	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
105	B	Door	Lft	Rgt jamb	I	Wood	White	-1.2	QM
104	B	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
106	B	Door	Lft	U Ctr	I	Wood	White	0.0	QM
100	C	Wall	L Ctr		I	Drywall	White	0.0	QM
103	C	Baseboard	Ctr		I	Wood	White	0.1	QM
107	C	Window	Lft	Rgt casing	I	Wood	White	-0.3	QM
108	C	Window	Lft	Sash	I	Wood	White	0.0	QM
109	C	Window	Lft	Sill	I	Wood	White	-0.4	QM
101	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 010 UpperBath									
110	A	Wall	U Ctr		I	Drywall	White	0.0	QM
114	A	Ceiling			I	Drywall	White	-0.2	QM
111	B	Wall	U Ctr		I	Drywall	White	-0.1	QM
117	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
116	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
118	B	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
115	C	Wall	L Ctr		I	Ceramic	Tan	5.6	QM
112	C	Wall	U Ctr		I	Drywall	White	-0.3	QM
113	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
119	D	Cabinet	Lft		I	Wood	White	-0.4	QM
Interior Room 011 UpperHall									
120	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
124	A	Ceiling			I	Drywall	White	-0.6	QM
129	A	Attic Hatch	Ctr		I	Wood	White	0.1	QM
130	A	Attic Casing	Ctr		I	Wood	White	0.0	QM
121	B	Wall	L Ctr		I	Drywall	White	-0.6	QM
122	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
125	C	Baseboard	Ctr		I	Wood	White	-1.3	QM
123	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
127	D	Door	Ctr	Rgt jamb	I	Wood	White	-0.5	QM
126	D	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
128	D	Door	Ctr	U Ctr	I	Wood	White	-0.3	QM
Calibration Readings									
001								1.0	QM
002								1.0	QM
003								1.0	QM
004								-0.2	QM
005								0.0	QM
006								-0.2	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date: 09/04/13
Report Date: 9/23/2013
Abatement Level: 1.0
Report No. 09/04/13 08:41
Total Reading Sets: 124
Job Started: 09/04/13 08:41
Job Finished: 09/04/13 09:45

USCG Elizabeth City
Housing Units
279 Gulfstream Drive- Interior

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Attic Casing	1	0	<0%>	1	<100%>	0	<0%>
Attic Hatch	1	0	<0%>	1	<100%>	0	<0%>
Baseboard	8	0	<0%>	8	<100%>	0	<0%>
Cabinet	5	0	<0%>	5	<100%>	0	<0%>
Ceiling	10	0	<0%>	10	<100%>	0	<0%>
Closet Door	2	0	<0%>	2	<100%>	0	<0%>
Closet Door Casing	1	0	<0%>	1	<100%>	0	<0%>
Closet Door Jamb	1	0	<0%>	1	<100%>	0	<0%>
Closet Shelf	2	0	<0%>	2	<100%>	0	<0%>
Closet Shelf Sup.	2	0	<0%>	2	<100%>	0	<0%>
Door Rgt casing	9	0	<0%>	9	<100%>	0	<0%>
Door Rgt jamb	9	0	<0%>	9	<100%>	0	<0%>
Door U Ctr	9	0	<0%>	9	<100%>	0	<0%>
Stairs Railing cap	1	0	<0%>	1	<100%>	0	<0%>
Stairs Risers	2	0	<0%>	2	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	42	2	<5%>	40	<95%>	0	<0%>
Window Rgt casing	6	0	<0%>	6	<100%>	0	<0%>
Window Sash	5	0	<0%>	5	<100%>	0	<0%>
Window Sill	6	0	<0%>	6	<100%>	0	<0%>
Inspection Totals:	124	2	< 2%>	122	< 98%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/05/13 09:00

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
224 Albatross Street- Interior

INSPECTION DATE: 09/05/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____ **Date:** 9/23/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/05/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	224 Albatross Street- Interior
Report No.	09/05/13 09:00	
Total Readings:	121 Actionable: 2	
Job Started:	09/05/13 09:00	
Job Finished:	09/05/13 09:41	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 008 MasterBath									
078	C	Wall	L Ctr		I	Ceramic	Tan	5.7	QM
Interior Room 009 UpperBath									
091	C	Wall	L Ctr		I	Ceramic	Tan	4.8	QM
Calibration Readings									

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/05/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	224 Albatross Street- Interior
Report No.	09/05/13 09:00	
Total Readings:	121	
Job Started:	09/05/13 09:00	
Job Finished:	09/05/13 09:41	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1		CALIBRATION								1.0	QM
2		CALIBRATION								1.0	QM
3		CALIBRATION								1.0	QM
4		CALIBRATION								0.2	QM
5		CALIBRATION								-0.3	QM
6		CALIBRATION								0.0	QM
7	001	Hall/Stair	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
8	001	Hall/Stair	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
9	001	Hall/Stair	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
10	001	Hall/Stair	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
11	001	Hall/Stair	C	Ceiling			I	Drywall	White	-0.1	QM
12	001	Hall/Stair	D	Baseboard	Lft		I	Wood	White	-0.3	QM
13	001	Hall/Stair	A	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
14	001	Hall/Stair	A	Door	Ctr	U Ctr	I	Metal	White	-0.2	QM
15	001	Hall/Stair	D	Closet	Ctr	Door	I	Wood	White	-0.4	QM
16	001	Hall/Stair	D	Closet	Ctr	Door Casing	I	Wood	White	0.0	QM
17	001	Hall/Stair	D	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
18	001	Hall/Stair	D	Stairs	Lft	Risers	I	Wood	White	-0.4	QM
19	001	Hall/Stair	D	Stairs	Lft	Stringer	I	Wood	White	-0.6	QM
20	001	Hall/Stair	D	Stairs	Lft	Treads	I	Wood	Varnish	-0.5	QM
21	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
22	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	0.0	QM
23	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
24	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
25	002	Bedroom A/B	C	Ceiling			I	Drywall	White	-0.2	QM
26	002	Bedroom A/B	A	Wall	L Ctr		I	Wood	White	0.0	QM
27	002	Bedroom A/B	D	Door	Lft	Rgt casing	I	Wood	White	-0.8	QM
28	002	Bedroom A/B	D	Door	Lft	U Ctr	I	Wood	White	-0.4	QM
29	002	Bedroom A/B	A	Window	Ctr	Sash	I	Wood	White	-0.6	QM
30	002	Bedroom A/B	A	Window	Ctr	Sill	I	Wood	White	-0.4	QM
31	002	Bedroom A/B	A	Mini Blinds	Ctr		I	Vinyl	White	-0.4	QM
32	003	Kitchen	A	Wall	L Ctr		I	Drywall	White	-1.1	QM
33	003	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
34	003	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
35	003	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
36	003	Kitchen	C	Ceiling			I	Drywall	White	-0.6	QM
37	003	Kitchen	A	Baseboard	Ctr		I	Vinyl	Black	-0.3	QM
38	003	Kitchen	A	Cabinet	Ctr		I	Wood	Varnish	-0.6	QM
39	004	Living/Din	A	Wall	L Ctr		I	Drywall	White	-1.0	QM
40	004	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
41	004	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
42	004	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.6	QM
43	004	Living/Din	C	Ceiling			I	Drywall	White	-0.3	QM
44	004	Living/Din	C	Door	Ctr	U Ctr	I	Wood	White	-1.0	QM
45	004	Living/Din	C	Door	Ctr	Rgt casing	I	Wood	White	0.1	QM
46	004	Living/Din	C	Window	Rgt	Rgt casing	I	Wood	White	-0.3	QM
47	004	Living/Din	C	Baseboard	Ctr		I	Wood	White	-0.2	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	005	LowerBath	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
49	005	LowerBath	B	Wall	L Ctr		I	Drywall	White	-0.5	QM
50	005	LowerBath	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
51	005	LowerBath	D	Wall	L Ctr		I	Drywall	White	-0.7	QM
52	005	LowerBath	A	Ceiling			I	Drywall	White	-0.1	QM
53	005	LowerBath	D	Baseboard	Ctr		I	Wood	White	-0.3	QM
54	005	LowerBath	B	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
55	005	LowerBath	B	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
56	006	UpperHall	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
57	006	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
58	006	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.6	QM
59	006	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.7	QM
60	006	UpperHall	A	Ceiling			I	Drywall	White	0.1	QM
61	006	UpperHall	B	Baseboard	Ctr		I	Wood	White	0.1	QM
62	006	UpperHall	D	Closet	Ctr	Door	I	Wood	White	0.0	QM
63	006	UpperHall	D	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
64	006	UpperHall	D	WallCap	Rgt		I	Wood	White	-0.5	QM
65	006	UpperHall	A	Attic Casing	Ctr		I	Wood	White	-0.3	QM
66	006	UpperHall	A	Attic Hatch	Ctr		I	Wood	White	-0.5	QM
67	007	UpperBedA	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
68	007	UpperBedA	B	Wall	L Ctr		I	Drywall	White	-0.6	QM
69	007	UpperBedA	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
70	007	UpperBedA	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
71	007	UpperBedA	C	Ceiling			I	Drywall	White	-0.3	QM
72	007	UpperBedA	A	Baseboard	Ctr		I	Wood	White	-0.3	QM
73	008	MasterBath	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
74	008	MasterBath	B	Wall	U Ctr		I	Drywall	White	0.1	QM
75	008	MasterBath	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
76	008	MasterBath	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
77	008	MasterBath	A	Ceiling			I	Drywall	White	-0.5	QM
78	008	MasterBath	C	Wall	L Ctr		I	Ceramic	Tan	5.7	QM
79	008	MasterBath	A	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
80	008	MasterBath	A	Door	Ctr	Rgt jamb	I	Wood	White	0.1	QM
81	008	MasterBath	D	Cabinet	Rgt		I	Wood	White	-0.2	QM
82	008	MasterBath	D	Sink	Rgt		I	Porcelain	White	-0.6	QM
83	008	MasterBath	C	Bathtub	Ctr		I	Porcelain	White	-1.1	QM
84	009	UpperBath	A	Wall	U Ctr		I	Drywall	White	0.2	QM
85	009	UpperBath	B	Wall	U Ctr		I	Drywall	White	0.0	QM
86	009	UpperBath	C	Wall	U Ctr		I	Drywall	White	-0.6	QM
87	009	UpperBath	D	Wall	U Ctr		I	Drywall	White	-0.6	QM
88	009	UpperBath	A	Ceiling			I	Drywall	White	-0.6	QM
89	009	UpperBath	D	Door	Ctr	U Ctr	I	Wood	White	-0.3	QM
90	009	UpperBath	D	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
91	009	UpperBath	C	Wall	L Ctr		I	Ceramic	Tan	4.8	QM
92	009	UpperBath	B	Sink	Rgt		I	Porcelain	White	-0.4	QM
93	009	UpperBath	A	Bathtub	Ctr		I	Porcelain	White	-0.2	QM
94	009	UpperBath	B	Cabinet	Rgt		I	Wood	White	-0.2	QM
95	010	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
96	010	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
97	010	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
98	010	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
99	010	UpperBedB/C	A	Ceiling			I	Drywall	White	-0.4	QM
100	010	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	0.0	QM
101	010	UpperBedB/C	D	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
102	010	UpperBedB/C	D	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	010	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
104	010	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	0.2	QM
105	010	UpperBedB/C	C	Mini Blinds	Ctr		I	Vinyl	White	-0.2	QM
106	010	UpperBedB/C	A	Closet	Rgt	Door	I	Wood	White	0.0	QM
107	010	UpperBedB/C	A	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM
108	010	UpperBedB/C	A	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.1	QM
109	011	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
110	011	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	0.1	QM
111	011	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	0.0	QM
112	011	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	0.1	QM
113	011	UpperBedC/D	A	Ceiling			I	Drywall	White	-0.4	QM
114	011	UpperBedC/D	B	Baseboard	Ctr		I	Wood	White	-0.4	QM
115	011	UpperBedC/D	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
116	011	UpperBedC/D	A	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
117	011	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
118	011	UpperBedC/D	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
119	011	UpperBedC/D	C	Mini Blinds	Ctr		I	Vinyl	White	-0.1	QM
120	011	UpperBedC/D	A	Closet	Lft	Door	I	Wood	White	-0.1	QM
121	011	UpperBedC/D	A	Closet	Lft	Shelf	I	Wood	White	0.0	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/05/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	224 Albatross Street- Interior
Report No.	09/05/13 09:00	
Total Readings:	121	
Job Started:	09/05/13 09:00	
Job Finished:	09/05/13 09:41	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stair									
007	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
013	A	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
014	A	Door	Ctr	U Ctr	I	Metal	White	-0.2	QM
008	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
009	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
011	C	Ceiling			I	Drywall	White	-0.1	QM
010	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
012	D	Baseboard	Lft		I	Wood	White	-0.3	QM
020	D	Stairs	Lft	Treads	I	Wood	Varnish	-0.5	QM
018	D	Stairs	Lft	Risers	I	Wood	White	-0.4	QM
019	D	Stairs	Lft	Stringer	I	Wood	White	-0.6	QM
015	D	Closet	Ctr	Door	I	Wood	White	-0.4	QM
016	D	Closet	Ctr	Door Casing	I	Wood	White	0.0	QM
017	D	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
Interior Room 002 Bedroom A/B									
021	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
026	A	Wall	L Ctr		I	Wood	White	0.0	QM
029	A	Window	Ctr	Sash	I	Wood	White	-0.6	QM
030	A	Window	Ctr	Sill	I	Wood	White	-0.4	QM
031	A	Mini Blinds	Ctr		I	Vinyl	White	-0.4	QM
022	B	Wall	L Ctr		I	Drywall	White	0.0	QM
023	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
025	C	Ceiling			I	Drywall	White	-0.2	QM
024	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
027	D	Door	Lft	Rgt casing	I	Wood	White	-0.8	QM
028	D	Door	Lft	U Ctr	I	Wood	White	-0.4	QM
Interior Room 003 Kitchen									
032	A	Wall	L Ctr		I	Drywall	White	-1.1	QM
037	A	Baseboard	Ctr		I	Vinyl	Black	-0.3	QM
038	A	Cabinet	Ctr		I	Wood	Varnish	-0.6	QM
033	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
034	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
036	C	Ceiling			I	Drywall	White	-0.6	QM
035	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Interior Room 004 Living/Din									
039	A	Wall	L Ctr		I	Drywall	White	-1.0	QM
040	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
041	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
047	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
043	C	Ceiling			I	Drywall	White	-0.3	QM
046	C	Window	Rgt	Rgt casing	I	Wood	White	-0.3	QM
045	C	Door	Ctr	Rgt casing	I	Wood	White	0.1	QM
044	C	Door	Ctr	U Ctr	I	Wood	White	-1.0	QM
042	D	Wall	L Ctr		I	Drywall	White	-0.6	QM
Interior Room 005 LowerBath									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
048	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
052	A	Ceiling			I	Drywall	White	-0.1	QM
049	B	Wall	L Ctr		I	Drywall	White	-0.5	QM
055	B	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
054	B	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
050	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
051	D	Wall	L Ctr		I	Drywall	White	-0.7	QM
053	D	Baseboard	Ctr		I	Wood	White	-0.3	QM
Interior Room 006 UpperHall									
056	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
060	A	Ceiling			I	Drywall	White	0.1	QM
065	A	Attic Casing	Ctr		I	Wood	White	-0.3	QM
066	A	Attic Hatch	Ctr		I	Wood	White	-0.5	QM
057	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
061	B	Baseboard	Ctr		I	Wood	White	0.1	QM
058	C	Wall	L Ctr		I	Drywall	White	-0.6	QM
059	D	Wall	L Ctr		I	Drywall	White	-0.7	QM
062	D	Closet	Ctr	Door	I	Wood	White	0.0	QM
063	D	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
064	D	WallCap	Rgt		I	Wood	White	-0.5	QM
Interior Room 007 UpperBedA									
067	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
072	A	Baseboard	Ctr		I	Wood	White	-0.3	QM
068	B	Wall	L Ctr		I	Drywall	White	-0.6	QM
069	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
071	C	Ceiling			I	Drywall	White	-0.3	QM
070	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Interior Room 008 MasterBath									
073	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
077	A	Ceiling			I	Drywall	White	-0.5	QM
080	A	Door	Ctr	Rgt jamb	I	Wood	White	0.1	QM
079	A	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
074	B	Wall	U Ctr		I	Drywall	White	0.1	QM
078	C	Wall	L Ctr		I	Ceramic	Tan	5.7	QM
075	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
083	C	Bathtub	Ctr		I	Porcelain	White	-1.1	QM
076	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
081	D	Cabinet	Rgt		I	Wood	White	-0.2	QM
082	D	Sink	Rgt		I	Porcelain	White	-0.6	QM
Interior Room 009 UpperBath									
084	A	Wall	U Ctr		I	Drywall	White	0.2	QM
088	A	Ceiling			I	Drywall	White	-0.6	QM
093	A	Bathtub	Ctr		I	Porcelain	White	-0.2	QM
085	B	Wall	U Ctr		I	Drywall	White	0.0	QM
092	B	Sink	Rgt		I	Porcelain	White	-0.4	QM
094	B	Cabinet	Rgt		I	Wood	White	-0.2	QM
091	C	Wall	L Ctr		I	Ceramic	Tan	4.8	QM
086	C	Wall	U Ctr		I	Drywall	White	-0.6	QM
087	D	Wall	U Ctr		I	Drywall	White	-0.6	QM
090	D	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
089	D	Door	Ctr	U Ctr	I	Wood	White	-0.3	QM
Interior Room 010 UpperBedB/C									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
095	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
099	A	Ceiling			I	Drywall	White	-0.4	QM
106	A	Closet	Rgt	Door	I	Wood	White	0.0	QM
108	A	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.1	QM
107	A	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM
096	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
097	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
100	C	Baseboard	Ctr		I	Wood	White	0.0	QM
103	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
104	C	Window	Ctr	Sill	I	Wood	White	0.2	QM
105	C	Mini Blinds	Ctr		I	Vinyl	White	-0.2	QM
098	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
102	D	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
101	D	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
Interior Room 011 UpperBedC/D									
109	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
113	A	Ceiling			I	Drywall	White	-0.4	QM
116	A	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
115	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
120	A	Closet	Lft	Door	I	Wood	White	-0.1	QM
121	A	Closet	Lft	Shelf	I	Wood	White	0.0	QM
110	B	Wall	L Ctr		I	Drywall	White	0.1	QM
114	B	Baseboard	Ctr		I	Wood	White	-0.4	QM
111	C	Wall	L Ctr		I	Drywall	White	0.0	QM
118	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
117	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
119	C	Mini Blinds	Ctr		I	Vinyl	White	-0.1	QM
112	D	Wall	L Ctr		I	Drywall	White	0.1	QM
Calibration Readings									
001								1.0	QM
002								1.0	QM
003								1.0	QM
004								0.2	QM
005								-0.3	QM
006								0.0	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/05/13	USCG Elizabeth City
Report Date:	9/23/2013	Housing Units
Abatement Level:	1.0	224 Albatross Street- Interior
Report No.	09/05/13 09:00	
Total Reading Sets:	115	
Job Started:	09/05/13 09:00	
Job Finished:	09/05/13 09:41	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Attic Casing	1	0	<0%>	1	<100%>	0	<0%>
Attic Hatch	1	0	<0%>	1	<100%>	0	<0%>
Baseboard	8	0	<0%>	8	<100%>	0	<0%>
Bathtub	2	0	<0%>	2	<100%>	0	<0%>
Cabinet	3	0	<0%>	3	<100%>	0	<0%>
Ceiling	11	0	<0%>	11	<100%>	0	<0%>
Closet Door	4	0	<0%>	4	<100%>	0	<0%>
Closet Door Casing	1	0	<0%>	1	<100%>	0	<0%>
Closet Shelf	4	0	<0%>	4	<100%>	0	<0%>
Closet Shelf Sup.	1	0	<0%>	1	<100%>	0	<0%>
Door Rgt casing	6	0	<0%>	6	<100%>	0	<0%>
Door Rgt jamb	2	0	<0%>	2	<100%>	0	<0%>
Door U Ctr	8	0	<0%>	8	<100%>	0	<0%>
Mini Blinds	3	0	<0%>	3	<100%>	0	<0%>
Sink	2	0	<0%>	2	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Wall	47	2	<4%>	45	<96%>	0	<0%>
WallCap	1	0	<0%>	1	<100%>	0	<0%>
Window Rgt casing	2	0	<0%>	2	<100%>	0	<0%>
Window Sash	3	0	<0%>	3	<100%>	0	<0%>
Window Sill	2	0	<0%>	2	<100%>	0	<0%>
Inspection Totals:	115	2	< 2%>	113	< 98%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 10:48

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
282 Gulfstream Drive- Interior

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ **Date:** 9/13/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	282 Gulfstream Drive- Interior
Report No.	09/04/13 10:48	
Total Readings:	124 Actionable: 2	
Job Started:	09/04/13 10:48	
Job Finished:	09/04/13 11:36	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 008 MasterBath									
078	A	Wall	L Lft		I	Ceramic	Tan	5.5	QM
Interior Room 011 UpperBath									
113	A	Wall	L Ctr		I	Ceramic	Tan	4.6	QM
Calibration Readings									

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	282 Gulfstream Drive- Interior
Report No.	09/04/13 10:48	
Total Readings:	124	
Job Started:	09/04/13 10:48	
Job Finished:	09/04/13 11:36	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
5	001	Hall/Stairs	A	Ceiling			I	Drywall	White	-0.2	QM
6	001	Hall/Stairs	D	Baseboard	Ctr		I	Wood	White	-0.2	QM
7	001	Hall/Stairs	A	Door	Ctr	Lft casing	I	Wood	White	0.0	QM
8	001	Hall/Stairs	A	Door	Ctr	U Ctr	I	Metal	White	0.0	QM
9	001	Hall/Stairs	B	Closet	Ctr	Door	I	Wood	White	-0.1	QM
10	001	Hall/Stairs	B	Closet	Ctr	Door Casing	I	Wood	White	-0.2	QM
11	001	Hall/Stairs	B	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
12	001	Hall/Stairs	B	Stairs	Rgt	Risers	I	Wood	White	-0.1	QM
13	001	Hall/Stairs	B	Stairs	Rgt	Stringer	I	Wood	White	0.0	QM
14	001	Hall/Stairs	B	Stairs	Rgt	Treads	I	Wood	Varnish	-0.1	QM
15	002	Bathroom	A	Wall	L Ctr		I	Drywall	White	0.0	QM
16	002	Bathroom	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
17	002	Bathroom	C	Wall	L Ctr		I	Drywall	White	0.0	QM
18	002	Bathroom	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
19	002	Bathroom	C	Ceiling			I	Drywall	White	-0.1	QM
20	002	Bathroom	A	Baseboard	Ctr		I	Wood	White	0.0	QM
21	002	Bathroom	D	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
22	002	Bathroom	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
23	002	Bathroom	B	Cabinet	Rgt		I	Wood	Varnish	-0.1	QM
24	003	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
25	003	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
26	003	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
27	003	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
28	003	Living/Din	C	Ceiling			I	Drywall	White	-0.1	QM
29	003	Living/Din	C	Baseboard	Ctr		I	Wood	White	0.0	QM
30	003	Living/Din	C	Door	Ctr	Lft casing	I	Wood	White	0.0	QM
31	003	Living/Din	C	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
32	003	Living/Din	C	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
33	004	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
34	004	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
35	004	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
36	004	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
37	004	Kitchen	C	Ceiling			I	Drywall	White	-0.1	QM
38	004	Kitchen	D	Baseboard	Lft		I	Vinyl	Black	-0.2	QM
39	004	Kitchen	A	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
40	005	Bedroom D/A	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
41	005	Bedroom D/A	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
42	005	Bedroom D/A	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
43	005	Bedroom D/A	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
44	005	Bedroom D/A	C	Ceiling			I	Drywall	White	-0.2	QM
45	005	Bedroom D/A	A	Baseboard	Ctr		I	Wood	White	-0.1	QM
46	005	Bedroom D/A	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
47	005	Bedroom D/A	B	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	005	Bedroom D/A	A	Window	Ctr	Rgt casing	I	Wood	White	-0.2	QM
49	005	Bedroom D/A	A	Window	Ctr	Sash	I	Vinyl	White	0.1	QM
50	006	UpperHall	A	Wall	L Ctr		I	Fiberglass	White	-0.2	QM
51	006	UpperHall	B	Wall	L Ctr		I	Fiberglass	White	-0.2	QM
52	006	UpperHall	C	Wall	L Ctr		I	Fiberglass	White	-0.3	QM
53	006	UpperHall	D	Wall	L Ctr		I	Fiberglass	White	-0.1	QM
54	006	UpperHall	A	Ceiling			I	Fiberglass	White	-0.1	QM
55	006	UpperHall	D	Baseboard	Ctr		I	Wood	White	-0.1	QM
56	006	UpperHall	B	Closet	Ctr	Door Casing	I	Wood	White	-0.2	QM
57	006	UpperHall	B	Closet	Ctr	Door	I	Wood	White	0.1	QM
58	006	UpperHall	B	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
59	006	UpperHall	B	Stairs	Lft	Wall	I	Wood	White	-0.1	QM
60	006	UpperHall	A	AccessHatch	Ctr		I	Wood	White	-0.2	QM
61	006	UpperHall	A	Attic Casing	Ctr		I	Wood	White	-0.1	QM
62	007	UpperBedA	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
63	007	UpperBedA	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
64	007	UpperBedA	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
65	007	UpperBedA	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
66	007	UpperBedA	D	Ceiling			I	Drywall	White	-0.2	QM
67	007	UpperBedA	A	Baseboard	Ctr		I	Wood	White	0.0	QM
68	007	UpperBedA	C	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
69	007	UpperBedA	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
70	007	UpperBedA	A	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
71	007	UpperBedA	A	Window	Rgt	Sash	I	Wood	White	-0.1	QM
72	007	UpperBedA	B	Closet	Lft	Shelf	I	Wood	White	0.0	QM
73	008	MasterBath	A	Wall	U Ctr		I	Drywall	White	-0.2	QM
74	008	MasterBath	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
75	008	MasterBath	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
76	008	MasterBath	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
77	008	MasterBath	B	Ceiling			I	Drywall	White	-0.2	QM
78	008	MasterBath	A	Wall	L Lft		I	Ceramic	Tan	5.5	QM
79	008	MasterBath	A	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
80	008	MasterBath	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
81	008	MasterBath	B	Cabinet	Lft		I	Wood	White	-0.2	QM
82	008	MasterBath	B	Sink	Lft		I	Porcelain	White	-0.1	QM
83	008	MasterBath	C	Bathtub	Ctr		I	Porcelain	White	-0.2	QM
84	009	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
85	009	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
86	009	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
87	009	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
88	009	UpperBedB/C	A	Ceiling			I	Drywall	White	-0.1	QM
89	009	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
90	009	UpperBedB/C	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
91	009	UpperBedB/C	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
92	009	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
93	009	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	-0.2	QM
94	009	UpperBedB/C	A	Closet	Ctr	Door	I	Wood	White	-0.2	QM
95	009	UpperBedB/C	A	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
96	010	UpperBedC/D	A	Wall	L Rgt		I	Drywall	White	-0.2	QM
97	010	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
98	010	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
99	010	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
100	010	UpperBedC/D	C	Ceiling			I	Drywall	White	-0.2	QM
101	010	UpperBedC/D	D	Baseboard	Ctr		I	Wood	White	-0.1	QM
102	010	UpperBedC/D	B	Door	Lft	Lft jamb	I	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	010	UpperBedC/D	B	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
104	010	UpperBedC/D	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
105	010	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
106	010	UpperBedC/D	A	Closet	Lft	Door	I	Wood	White	0.1	QM
107	010	UpperBedC/D	A	Closet	Lft	Shelf	I	Wood	White	-0.1	QM
108	011	UpperBath	A	Wall	U Ctr		I	Drywall	White	-0.2	QM
109	011	UpperBath	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
110	011	UpperBath	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
111	011	UpperBath	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
112	011	UpperBath	A	Ceiling			I	Drywall	White	-0.1	QM
113	011	UpperBath	A	Wall	L Ctr		I	Ceramic	Tan	4.6	QM
114	011	UpperBath	B	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
115	011	UpperBath	B	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
116	011	UpperBath	D	Cabinet	Lft		I	Wood	White	0.0	QM
117	011	UpperBath	D	Sink	Lft		I	Porcelain	White	-0.4	QM
118	011	UpperBath	A	Bathtub	Ctr		I	Porcelain	White	-0.2	QM
119		CALIBRATION								1.0	QM
120		CALIBRATION								1.0	QM
121		CALIBRATION								1.0	QM
122		CALIBRATION								0.2	QM
123		CALIBRATION								0.2	QM
124		CALIBRATION								0.1	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City	
Report Date:	9/13/2013	Housing Units	
Abatement Level:	1.0	282 Gulfstream Drive- Interior	
Report No.	09/04/13 10:48		
Total Readings:	124		
Job Started:	09/04/13 10:48		
Job Finished:	09/04/13 11:36		

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
005	A	Ceiling			I	Drywall	White	-0.2	QM
007	A	Door	Ctr	Lft casing	I	Wood	White	0.0	QM
008	A	Door	Ctr	U Ctr	I	Metal	White	0.0	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
014	B	Stairs	Rgt	Treads	I	Wood	Varnish	-0.1	QM
012	B	Stairs	Rgt	Risers	I	Wood	White	-0.1	QM
013	B	Stairs	Rgt	Stringer	I	Wood	White	0.0	QM
009	B	Closet	Ctr	Door	I	Wood	White	-0.1	QM
010	B	Closet	Ctr	Door Casing	I	Wood	White	-0.2	QM
011	B	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
006	D	Baseboard	Ctr		I	Wood	White	-0.2	QM
Interior Room 002 Bathroom									
015	A	Wall	L Ctr		I	Drywall	White	0.0	QM
020	A	Baseboard	Ctr		I	Wood	White	0.0	QM
016	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
023	B	Cabinet	Rgt		I	Wood	Varnish	-0.1	QM
017	C	Wall	L Ctr		I	Drywall	White	0.0	QM
019	C	Ceiling			I	Drywall	White	-0.1	QM
018	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
021	D	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
022	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
Interior Room 003 Living/Din									
024	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
025	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
026	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
029	C	Baseboard	Ctr		I	Wood	White	0.0	QM
028	C	Ceiling			I	Drywall	White	-0.1	QM
032	C	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
030	C	Door	Ctr	Lft casing	I	Wood	White	0.0	QM
031	C	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
027	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 004 Kitchen									
033	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
039	A	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
034	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
035	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
037	C	Ceiling			I	Drywall	White	-0.1	QM
036	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
038	D	Baseboard	Lft		I	Vinyl	Black	-0.2	QM
Interior Room 005 Bedroom D/A									
040	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
045	A	Baseboard	Ctr		I	Wood	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
048	A	Window	Ctr	Rgt casing	I	Wood	White	-0.2	QM
049	A	Window	Ctr	Sash	I	Vinyl	White	0.1	QM
041	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
046	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
047	B	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
042	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
044	C	Ceiling			I	Drywall	White	-0.2	QM
043	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 006 UpperHall									
050	A	Wall	L Ctr		I	Fiberglass	White	-0.2	QM
054	A	Ceiling			I	Fiberglass	White	-0.1	QM
060	A	AccessHatch	Ctr		I	Wood	White	-0.2	QM
061	A	Attic Casing	Ctr		I	Wood	White	-0.1	QM
051	B	Wall	L Ctr		I	Fiberglass	White	-0.2	QM
059	B	Stairs	Lft	Wall	I	Wood	White	-0.1	QM
057	B	Closet	Ctr	Door	I	Wood	White	0.1	QM
056	B	Closet	Ctr	Door Casing	I	Wood	White	-0.2	QM
058	B	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
052	C	Wall	L Ctr		I	Fiberglass	White	-0.3	QM
053	D	Wall	L Ctr		I	Fiberglass	White	-0.1	QM
055	D	Baseboard	Ctr		I	Wood	White	-0.1	QM
Interior Room 007 UpperBedA									
062	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
067	A	Baseboard	Ctr		I	Wood	White	0.0	QM
070	A	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
071	A	Window	Rgt	Sash	I	Wood	White	-0.1	QM
063	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
072	B	Closet	Lft	Shelf	I	Wood	White	0.0	QM
064	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
068	C	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
069	C	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
065	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
066	D	Ceiling			I	Drywall	White	-0.2	QM
Interior Room 008 MasterBath									
078	A	Wall	L Lft		I	Ceramic	Tan	5.5	QM
073	A	Wall	U Ctr		I	Drywall	White	-0.2	QM
079	A	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
080	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
074	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
077	B	Ceiling			I	Drywall	White	-0.2	QM
081	B	Cabinet	Lft		I	Wood	White	-0.2	QM
082	B	Sink	Lft		I	Porcelain	White	-0.1	QM
075	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
083	C	Bathtub	Ctr		I	Porcelain	White	-0.2	QM
076	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
Interior Room 009 UpperBedB/C									
084	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
088	A	Ceiling			I	Drywall	White	-0.1	QM
090	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
091	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
094	A	Closet	Ctr	Door	I	Wood	White	-0.2	QM
095	A	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
085	B	Wall	L Ctr		I	Drywall	White	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
086	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
089	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
092	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
093	C	Window	Ctr	Sill	I	Wood	White	-0.2	QM
087	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 010 UpperBedC/D									
096	A	Wall	L Rgt		I	Drywall	White	-0.2	QM
106	A	Closet	Lft	Door	I	Wood	White	0.1	QM
107	A	Closet	Lft	Shelf	I	Wood	White	-0.1	QM
097	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
102	B	Door	Lft	Lft jamb	I	Wood	White	-0.1	QM
103	B	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
098	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
100	C	Ceiling			I	Drywall	White	-0.2	QM
104	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
105	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
099	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
101	D	Baseboard	Ctr		I	Wood	White	-0.1	QM
Interior Room 011 UpperBath									
113	A	Wall	L Ctr		I	Ceramic	Tan	4.6	QM
108	A	Wall	U Ctr		I	Drywall	White	-0.2	QM
112	A	Ceiling			I	Drywall	White	-0.1	QM
118	A	Bathtub	Ctr		I	Porcelain	White	-0.2	QM
109	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
114	B	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
115	B	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
110	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
111	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
116	D	Cabinet	Lft		I	Wood	White	0.0	QM
117	D	Sink	Lft		I	Porcelain	White	-0.4	QM
Calibration Readings									
119								1.0	QM
120								1.0	QM
121								1.0	QM
122								0.2	QM
123								0.2	QM
124								0.1	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	282 Gulfstream Drive- Interior
Report No.	09/04/13 10:48	
Total Reading Sets:	118	
Job Started:	09/04/13 10:48	
Job Finished:	09/04/13 11:36	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
AccessHatch	1	0	<0%>	1	<100%>	0	<0%>
Attic Casing	1	0	<0%>	1	<100%>	0	<0%>
Baseboard	9	0	<0%>	9	<100%>	0	<0%>
Bathtub	2	0	<0%>	2	<100%>	0	<0%>
Cabinet	4	0	<0%>	4	<100%>	0	<0%>
Ceiling	11	0	<0%>	11	<100%>	0	<0%>
Closet Door	4	0	<0%>	4	<100%>	0	<0%>
Closet Door Casing	2	0	<0%>	2	<100%>	0	<0%>
Closet Shelf	5	0	<0%>	5	<100%>	0	<0%>
Door Lft casing	2	0	<0%>	2	<100%>	0	<0%>
Door Lft jamb	1	0	<0%>	1	<100%>	0	<0%>
Door Rgt casing	4	0	<0%>	4	<100%>	0	<0%>
Door Rgt jamb	2	0	<0%>	2	<100%>	0	<0%>
Door U Ctr	9	0	<0%>	9	<100%>	0	<0%>
Sink	2	0	<0%>	2	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	46	2	<4%>	44	<96%>	0	<0%>
Window Rgt casing	4	0	<0%>	4	<100%>	0	<0%>
Window Sash	4	0	<0%>	4	<100%>	0	<0%>
Window Sill	1	0	<0%>	1	<100%>	0	<0%>
Inspection Totals:	118	2	< 2%>	116	< 98%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 12:28

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
374 Mariner Court- Interior

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ Date: 9/13/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	374 Mariner Court- Interior
Report No.	09/04/13 12:28	
Total Readings:	135 Actionable: 0	
Job Started:	09/04/13 12:28	
Job Finished:	09/04/13 13:08	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	374 Mariner Court- Interior
Report No.	09/04/13 12:28	
Total Readings:	135	
Job Started:	09/04/13 12:28	
Job Finished:	09/04/13 13:08	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
5	001	Hall/Stairs	C	Ceiling			I	Drywall	White	-0.2	QM
6	001	Hall/Stairs	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
7	001	Hall/Stairs	B	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
8	001	Hall/Stairs	B	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
9	001	Hall/Stairs	B	Door	Lft	U Lft	I	Wood	White	-0.1	QM
10	001	Hall/Stairs	A	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
11	001	Hall/Stairs	A	WinPanel	Lft		I	Wood	White	-0.2	QM
12	001	Hall/Stairs	D	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
13	001	Hall/Stairs	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM
14	001	Hall/Stairs	C	Stairs	Ctr	Stringer	I	Wood	White	-0.1	QM
15	001	Hall/Stairs	D	Stairs	Ctr	Risers	I	Wood	White	-0.1	QM
16	001	Hall/Stairs	B	Stairs	Ctr	Wall	I	Wood	White	-0.1	QM
17	001	Hall/Stairs	B	Stairs	Ctr	Treads	I	Wood	Varnish	-0.1	QM
18	001	Hall/Stairs	C	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.2	QM
19	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
20	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
21	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
22	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
23	002	Bedroom A/B	A	Ceiling			I	Drywall	White	0.0	QM
24	002	Bedroom A/B	C	Baseboard	Ctr		I	Wood	White	0.0	QM
25	002	Bedroom A/B	D	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
26	002	Bedroom A/B	D	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
27	002	Bedroom A/B	D	Door	Lft	U Ctr	I	Wood	White	0.0	QM
28	002	Bedroom A/B	A	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
29	002	Bedroom A/B	A	Window	Ctr	Sash	I	Wood	White	0.0	QM
30	002	Bedroom A/B	A	Window	Ctr	Sill	I	Wood	White	0.0	QM
31	003	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
32	003	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
33	003	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
34	003	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
35	003	Kitchen	A	Ceiling			I	Drywall	White	-0.1	QM
36	003	Kitchen	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
37	003	Kitchen	C	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
38	003	Kitchen	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
39	003	Kitchen	B	Cabinet	Ctr		I	Wood	Varnish	-0.3	QM
40	004	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
41	004	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
42	004	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
43	004	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
44	004	Living/Din	A	Ceiling			I	Drywall	White	-0.1	QM
45	004	Living/Din	C	Baseboard	Ctr		I	Wood	White	0.0	QM
46	004	Living/Din	C	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
47	004	Living/Din	C	Door	Ctr	Rgt jamb	I	Wood	White	0.0	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Living/Din	C	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
49	004	Living/Din	C	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
50	004	Living/Din	C	Window	Lft	Sash	I	Wood	White	-0.2	QM
51	004	Living/Din	C	Window	Lft	Sill	I	Wood	White	-0.1	QM
52	005	Bathroom	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
53	005	Bathroom	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
54	005	Bathroom	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
55	005	Bathroom	D	Wall	L Ctr		I	Drywall	White	0.0	QM
56	005	Bathroom	A	Ceiling			I	Drywall	White	-0.2	QM
57	005	Bathroom	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
58	005	Bathroom	B	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
59	005	Bathroom	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
60	005	Bathroom	B	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
61	005	Bathroom	D	Cabinet	Lft		I	Wood	Varnish	-0.3	QM
62	005	Bathroom	A	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
63	006	UpperBedA/B	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
64	006	UpperBedA/B	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
65	006	UpperBedA/B	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
66	006	UpperBedA/B	D	Wall	L Ctr		I	Drywall	White	0.0	QM
67	006	UpperBedA/B	A	Ceiling			I	Drywall	White	-0.2	QM
68	006	UpperBedA/B	C	Baseboard	Ctr		I	Wood	White	0.0	QM
69	006	UpperBedA/B	D	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
70	006	UpperBedA/B	D	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
71	006	UpperBedA/B	D	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
72	006	UpperBedA/B	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
73	006	UpperBedA/B	A	Window	Ctr	Sash	I	Wood	White	-0.1	QM
74	006	UpperBedA/B	A	Window	Ctr	Sill	I	Wood	White	0.0	QM
75	006	UpperBedA/B	D	Closet	Ctr	Shelf Sup.	I	Wood	White	0.1	QM
76	007	MasterBath	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
77	007	MasterBath	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
78	007	MasterBath	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
79	007	MasterBath	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
80	007	MasterBath	C	Ceiling			I	Drywall	White	-0.1	QM
81	007	MasterBath	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
82	007	MasterBath	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
83	007	MasterBath	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
84	007	MasterBath	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
85	007	MasterBath	D	Cabinet	Rgt		I	Wood	White	-0.2	QM
86	008	UpperBath	A	Wall	L Ctr		I	Drywall	White	0.0	QM
87	008	UpperBath	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
88	008	UpperBath	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
89	008	UpperBath	D	Wall	U Ctr		I	Drywall	White	0.2	QM
90	008	UpperBath	A	Ceiling			I	Drywall	White	-0.1	QM
91	008	UpperBath	C	Wall	L Ctr		I	Ceramic	White	-0.3	QM
92	008	UpperBath	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
93	008	UpperBath	D	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
94	008	UpperBath	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
95	008	UpperBath	D	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
96	008	UpperBath	B	Cabinet	Lft		I	Wood	White	-0.2	QM
97	009	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
98	009	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
99	009	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
100	009	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
101	009	UpperBedB/C	A	Ceiling			I	Drywall	White	-0.1	QM
102	009	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	0.0	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	009	UpperBedB/C	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
104	009	UpperBedB/C	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
105	009	UpperBedB/C	C	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
106	009	UpperBedB/C	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
107	009	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
108	009	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	-0.2	QM
109	009	UpperBedB/C	A	Closet	Rgt	Door	I	Wood	White	-0.2	QM
110	010	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
111	010	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
112	010	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
113	010	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
114	010	UpperBedC/D	D	Ceiling			I	Drywall	White	-0.2	QM
115	010	UpperBedC/D	C	Baseboard	Ctr		I	Wood	White	0.2	QM
116	010	UpperBedC/D	A	Door	Rgt	Rgt casing	I	Wood	White	0.1	QM
117	010	UpperBedC/D	A	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
118	010	UpperBedC/D	A	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
119	010	UpperBedC/D	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
120	010	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
121	010	UpperBedC/D	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
122	010	UpperBedC/D	A	Closet	Lft	Shelf	I	Wood	White	-0.2	QM
123	010	UpperBedC/D	A	Closet	Lft	Shelf Sup.	I	Wood	White	-0.1	QM
124	011	UpperHall	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
125	011	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
126	011	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
127	011	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
128	011	UpperHall	A	Ceiling			I	Drywall	White	-0.1	QM
129	011	UpperHall	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
130	011	UpperHall	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
131	011	UpperHall	A	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
132	011	UpperHall	A	Door	Lft	U Lft	I	Wood	White	-0.1	QM
133	011	UpperHall	A	Attic Hatch	Ctr		I	Wood	White	-0.2	QM
134	011	UpperHall	A	Attic Casing	Ctr		I	Wood	White	-0.1	QM
135	011	UpperHall	D	Closet	Ctr	Door	I	Wood	White	0.0	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	374 Mariner Court- Interior
Report No.	09/04/13 12:28	
Total Readings:	135	
Job Started:	09/04/13 12:28	
Job Finished:	09/04/13 13:08	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
010	A	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
011	A	WinPanel	Lft		I	Wood	White	-0.2	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
008	B	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
007	B	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
009	B	Door	Lft	U Lft	I	Wood	White	-0.1	QM
016	B	Stairs	Ctr	Wall	I	Wood	White	-0.1	QM
017	B	Stairs	Ctr	Treads	I	Wood	Varnish	-0.1	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
006	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
005	C	Ceiling			I	Drywall	White	-0.2	QM
014	C	Stairs	Ctr	Stringer	I	Wood	White	-0.1	QM
018	C	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.2	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
015	D	Stairs	Ctr	Risers	I	Wood	White	-0.1	QM
013	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.1	QM
012	D	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
Interior Room 002 Bedroom A/B									
019	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
023	A	Ceiling			I	Drywall	White	0.0	QM
028	A	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
029	A	Window	Ctr	Sash	I	Wood	White	0.0	QM
030	A	Window	Ctr	Sill	I	Wood	White	0.0	QM
020	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
021	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
024	C	Baseboard	Ctr		I	Wood	White	0.0	QM
022	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
026	D	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
025	D	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
027	D	Door	Lft	U Ctr	I	Wood	White	0.0	QM
Interior Room 003 Kitchen									
031	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
035	A	Ceiling			I	Drywall	White	-0.1	QM
032	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
039	B	Cabinet	Ctr		I	Wood	Varnish	-0.3	QM
033	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
036	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
038	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
037	C	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
034	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 004 Living/Din									
040	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
044	A	Ceiling			I	Drywall	White	-0.1	QM
041	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
042	C	Wall	L Ctr		I	Drywall	White	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
045	C	Baseboard	Ctr		I	Wood	White	0.0	QM
049	C	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
050	C	Window	Lft	Sash	I	Wood	White	-0.2	QM
051	C	Window	Lft	Sill	I	Wood	White	-0.1	QM
047	C	Door	Ctr	Rgt jamb	I	Wood	White	0.0	QM
046	C	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
048	C	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
043	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 005 Bathroom									
052	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
056	A	Ceiling			I	Drywall	White	-0.2	QM
062	A	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
053	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
059	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
058	B	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
060	B	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
054	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
057	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
055	D	Wall	L Ctr		I	Drywall	White	0.0	QM
061	D	Cabinet	Lft		I	Wood	Varnish	-0.3	QM
Interior Room 006 UpperBedA/B									
063	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
067	A	Ceiling			I	Drywall	White	-0.2	QM
072	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
073	A	Window	Ctr	Sash	I	Wood	White	-0.1	QM
074	A	Window	Ctr	Sill	I	Wood	White	0.0	QM
064	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
065	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
068	C	Baseboard	Ctr		I	Wood	White	0.0	QM
066	D	Wall	L Ctr		I	Drywall	White	0.0	QM
070	D	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
069	D	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
071	D	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
075	D	Closet	Ctr	Shelf Sup.	I	Wood	White	0.1	QM
Interior Room 007 MasterBath									
076	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
083	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
082	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
084	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
077	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
078	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
081	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
080	C	Ceiling			I	Drywall	White	-0.1	QM
079	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
085	D	Cabinet	Rgt		I	Wood	White	-0.2	QM
Interior Room 008 UpperBath									
086	A	Wall	L Ctr		I	Drywall	White	0.0	QM
090	A	Ceiling			I	Drywall	White	-0.1	QM
087	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
096	B	Cabinet	Lft		I	Wood	White	-0.2	QM
091	C	Wall	L Ctr		I	Ceramic	White	-0.3	QM
088	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
092	C	Baseboard	Ctr		I	Wood	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
089	D	Wall	U Ctr		I	Drywall	White	0.2	QM
094	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
093	D	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
095	D	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
Interior Room 009 UpperBedB/C									
097	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
101	A	Ceiling			I	Drywall	White	-0.1	QM
109	A	Closet	Rgt	Door	I	Wood	White	-0.2	QM
098	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
099	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
102	C	Baseboard	Ctr		I	Wood	White	0.0	QM
106	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
107	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
108	C	Window	Ctr	Sill	I	Wood	White	-0.2	QM
104	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.2	QM
103	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
105	C	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
100	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 010 UpperBedC/D									
110	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
117	A	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
116	A	Door	Rgt	Rgt casing	I	Wood	White	0.1	QM
118	A	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
123	A	Closet	Lft	Shelf Sup.	I	Wood	White	-0.1	QM
122	A	Closet	Lft	Shelf	I	Wood	White	-0.2	QM
111	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
112	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
115	C	Baseboard	Ctr		I	Wood	White	0.2	QM
119	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
120	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
121	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
113	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
114	D	Ceiling			I	Drywall	White	-0.2	QM
Interior Room 011 UpperHall									
124	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
128	A	Ceiling			I	Drywall	White	-0.1	QM
131	A	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
130	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
132	A	Door	Lft	U Lft	I	Wood	White	-0.1	QM
133	A	Attic Hatch	Ctr		I	Wood	White	-0.2	QM
134	A	Attic Casing	Ctr		I	Wood	White	-0.1	QM
125	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
126	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
129	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
127	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
135	D	Closet	Ctr	Door	I	Wood	White	0.0	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	374 Mariner Court- Interior
Report No.	09/04/13 12:28	
Total Reading Sets:	135	
Job Started:	09/04/13 12:28	
Job Finished:	09/04/13 13:08	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Attic Casing	1	0	<0%>	1	<100%>	0	<0%>
Attic Hatch	1	0	<0%>	1	<100%>	0	<0%>
Baseboard	11	0	<0%>	11	<100%>	0	<0%>
Cabinet	5	0	<0%>	5	<100%>	0	<0%>
Ceiling	11	0	<0%>	11	<100%>	0	<0%>
Closet Door	2	0	<0%>	2	<100%>	0	<0%>
Closet Shelf	2	0	<0%>	2	<100%>	0	<0%>
Closet Shelf Sup.	3	0	<0%>	3	<100%>	0	<0%>
Door Rgt casing	11	0	<0%>	11	<100%>	0	<0%>
Door Rgt jamb	11	0	<0%>	11	<100%>	0	<0%>
Door U Ctr	8	0	<0%>	8	<100%>	0	<0%>
Door U Lft	2	0	<0%>	2	<100%>	0	<0%>
Stairs Railing cap	1	0	<0%>	1	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	45	0	<0%>	45	<100%>	0	<0%>
Window Rgt casing	6	0	<0%>	6	<100%>	0	<0%>
Window Sash	5	0	<0%>	5	<100%>	0	<0%>
Window Sill	5	0	<0%>	5	<100%>	0	<0%>
WinPanel	1	0	<0%>	1	<100%>	0	<0%>
Inspection Totals:	135	0	< 0%>	135	<100%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 12:56

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
381 Mariner Court- Interior

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____ **Date:** 9/13/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	381 Mariner Court- Interior
Report No.	09/04/13 12:56	
Total Readings:	113 Actionable: 1	
Job Started:	09/04/13 12:56	
Job Finished:	09/04/13 13:29	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 009 UpperBath									
089	C	Bathtub	Ctr		I	Metal	White	>9.9	QM

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	381 Mariner Court- Interior
Report No.	09/04/13 12:56	
Total Readings:	113	
Job Started:	09/04/13 12:56	
Job Finished:	09/04/13 13:29	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	0.1	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	0.2	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
5	001	Hall/Stairs	C	Ceiling			I	Drywall	White	-0.2	QM
6	001	Hall/Stairs	A	Baseboard	Lft		I	Wood	White	0.0	QM
7	001	Hall/Stairs	A	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
8	001	Hall/Stairs	A	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
9	001	Hall/Stairs	D	Closet	Ctr	Door	I	Wood	White	0.1	QM
10	001	Hall/Stairs	D	Closet	Ctr	Door Casing	I	Wood	White	-0.1	QM
11	001	Hall/Stairs	D	Stairs	Lft	Risers	I	Wood	White	-0.5	QM
12	001	Hall/Stairs	D	Stairs	Lft	Stringer	I	Wood	White	-0.3	QM
13	001	Hall/Stairs	D	Stairs	Lft	Treads	I	Wood	Varnish	-0.1	QM
14	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
15	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
16	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
17	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
18	002	Bedroom A/B	C	Ceiling			I	Drywall	White	-0.2	QM
19	002	Bedroom A/B	A	Baseboard	Ctr		I	Wood	White	-0.4	QM
20	002	Bedroom A/B	D	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
21	002	Bedroom A/B	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
22	002	Bedroom A/B	A	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
23	002	Bedroom A/B	A	Window	Ctr	Sash	I	Wood	White	-0.4	QM
24	003	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
25	003	Kitchen	B	Wall	L Ctr		I	Drywall	White	0.1	QM
26	003	Kitchen	C	Wall	L Ctr		I	Drywall	White	0.0	QM
27	003	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
28	003	Kitchen	C	Ceiling			I	Drywall	White	0.0	QM
29	003	Kitchen	C	Baseboard	Ctr		I	Wood	White	0.0	QM
30	003	Kitchen	A	Cabinet	Ctr		I	Wood	Varnish	-0.3	QM
31	004	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
32	004	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
33	004	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
34	004	Living/Din	D	Wall	L Ctr		I	Drywall	White	0.0	QM
35	004	Living/Din	C	Ceiling			I	Drywall	White	0.0	QM
36	004	Living/Din	A	Baseboard	Ctr		I	Wood	White	-0.4	QM
37	004	Living/Din	C	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
38	004	Living/Din	C	Door	Lft	U Lft	I	Metal	White	-0.1	QM
39	004	Living/Din	C	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
40	004	Living/Din	C	Window	Rgt	Sash	I	Wood	White	-0.2	QM
41	004	Living/Din	A	Door	Rgt	Lft casing	I	Wood	White	-0.8	QM
42	005	Bathroom	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
43	005	Bathroom	B	Wall	L Ctr		I	Drywall	White	0.0	QM
44	005	Bathroom	C	Wall	L Ctr		I	Drywall	White	0.0	QM
45	005	Bathroom	D	Wall	L Ctr		I	Drywall	White	0.0	QM
46	005	Bathroom	C	Ceiling			I	Drywall	White	0.0	QM
47	005	Bathroom	D	Baseboard	Rgt		I	Wood	White	-0.2	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	005	Bathroom	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
49	005	Bathroom	B	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
50	005	Bathroom	D	Cabinet	Lft		I	Wood	Varnish	0.1	QM
51	006	UpperHall	A	Wall	L Ctr		I	Drywall	White	0.0	QM
52	006	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
53	006	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
54	006	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
55	006	UpperHall	C	Ceiling			I	Drywall	White	-0.1	QM
56	006	UpperHall	B	Baseboard	Ctr		I	Wood	White	-0.1	QM
57	006	UpperHall	D	Closet	Ctr	Door	I	Wood	White	-0.1	QM
58	006	UpperHall	D	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
59	006	UpperHall	D	Stairs	Rgt	Wall	I	Wood	White	-0.2	QM
60	006	UpperHall	C	Attic Casing	Ctr		I	Wood	White	-0.1	QM
61	007	UpperBedA	A	Wall	L Ctr		I	Drywall	White	0.0	QM
62	007	UpperBedA	B	Wall	L Ctr		I	Drywall	White	0.0	QM
63	007	UpperBedA	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
64	007	UpperBedA	D	Wall	L Ctr		I	Drywall	White	0.0	QM
65	007	UpperBedA	C	Ceiling			I	Drywall	White	0.1	QM
66	007	UpperBedA	A	Baseboard	Ctr		I	Wood	White	0.2	QM
67	007	UpperBedA	C	Door	Rgt	Lft jamb	I	Wood	White	-0.3	QM
68	007	UpperBedA	C	Door	Rgt	U Ctr	I	Wood	White	0.3	QM
69	007	UpperBedA	A	Window	Ctr	Lft casing	I	Wood	White	-0.3	QM
70	007	UpperBedA	A	Window	Ctr	Sash	I	Wood	White	0.0	QM
71	007	UpperBedA	D	Closet	Rgt	Shelf	I	Wood	White	0.0	QM
72	008	MasterBath	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
73	008	MasterBath	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
74	008	MasterBath	C	Wall	L Ctr		I	Drywall	White	-0.6	QM
75	008	MasterBath	D	Wall	L Ctr		I	Drywall	White	0.1	QM
76	008	MasterBath	C	Ceiling			I	Drywall	White	-0.9	QM
77	008	MasterBath	A	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
78	008	MasterBath	A	Door	Ctr	U Ctr	I	Wood	White	-0.4	QM
79	008	MasterBath	D	Cabinet	Rgt		I	Wood	White	0.0	QM
80	008	MasterBath	A	Baseboard	Ctr		I	Vinyl	Gray	-0.8	QM
81	009	UpperBath	A	Wall	L Ctr		I	Drywall	White	0.0	QM
82	009	UpperBath	B	Wall	L Ctr		I	Drywall	White	0.1	QM
83	009	UpperBath	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
84	009	UpperBath	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
85	009	UpperBath	A	Ceiling			I	Drywall	White	-0.1	QM
86	009	UpperBath	D	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
87	009	UpperBath	D	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
88	009	UpperBath	B	Cabinet	Lft		I	Wood	White	0.0	QM
89	009	UpperBath	C	Bathtub	Ctr		I	Metal	White	>9.9	QM
90	010	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
91	010	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
92	010	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	0.1	QM
93	010	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
94	010	UpperBedB/C	C	Ceiling			I	Drywall	White	-0.2	QM
95	010	UpperBedB/C	D	Baseboard	Ctr		I	Wood	White	-0.9	QM
96	010	UpperBedB/C	D	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
97	010	UpperBedB/C	D	Door	Rgt	U Ctr	I	Wood	White	-0.5	QM
98	010	UpperBedB/C	C	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
99	010	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	-0.4	QM
100	010	UpperBedB/C	A	Closet	Rgt	Door	I	Wood	White	-0.5	QM
101	010	UpperBedB/C	A	Closet	Rgt	Shelf	I	Wood	White	-0.6	QM
102	011	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	-0.5	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	011	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
104	011	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	-0.7	QM
105	011	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
106	011	UpperBedC/D	B	Ceiling			I	Drywall	White	-0.5	QM
107	011	UpperBedC/D	B	Baseboard	Ctr		I	Wood	White	-0.5	QM
108	011	UpperBedC/D	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
109	011	UpperBedC/D	A	Door	Rgt	U Ctr	I	Wood	White	-1.0	QM
110	011	UpperBedC/D	C	Window	Ctr	Rgt casing	I	Wood	White	-0.9	QM
111	011	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
112	011	UpperBedC/D	A	Closet	Lft	Door	I	Wood	White	-0.5	QM
113	011	UpperBedC/D	A	Closet	Lft	Shelf Sup.	I	Wood	White	0.0	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	381 Mariner Court- Interior
Report No.	09/04/13 12:56	
Total Readings:	113	
Job Started:	09/04/13 12:56	
Job Finished:	09/04/13 13:29	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	0.1	QM
006	A	Baseboard	Lft		I	Wood	White	0.0	QM
007	A	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
008	A	Door	Ctr	U Ctr	I	Wood	White	-0.2	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
003	C	Wall	L Ctr		I	Drywall	White	0.2	QM
005	C	Ceiling			I	Drywall	White	-0.2	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
013	D	Stairs	Lft	Treads	I	Wood	Varnish	-0.1	QM
011	D	Stairs	Lft	Risers	I	Wood	White	-0.5	QM
012	D	Stairs	Lft	Stringer	I	Wood	White	-0.3	QM
009	D	Closet	Ctr	Door	I	Wood	White	0.1	QM
010	D	Closet	Ctr	Door Casing	I	Wood	White	-0.1	QM
Interior Room 002 Bedroom A/B									
014	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
019	A	Baseboard	Ctr		I	Wood	White	-0.4	QM
022	A	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
023	A	Window	Ctr	Sash	I	Wood	White	-0.4	QM
015	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
016	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
018	C	Ceiling			I	Drywall	White	-0.2	QM
017	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
020	D	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
021	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
Interior Room 003 Kitchen									
024	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
030	A	Cabinet	Ctr		I	Wood	Varnish	-0.3	QM
025	B	Wall	L Ctr		I	Drywall	White	0.1	QM
026	C	Wall	L Ctr		I	Drywall	White	0.0	QM
029	C	Baseboard	Ctr		I	Wood	White	0.0	QM
028	C	Ceiling			I	Drywall	White	0.0	QM
027	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 004 Living/Din									
031	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
036	A	Baseboard	Ctr		I	Wood	White	-0.4	QM
041	A	Door	Rgt	Lft casing	I	Wood	White	-0.8	QM
032	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
033	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
035	C	Ceiling			I	Drywall	White	0.0	QM
039	C	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
040	C	Window	Rgt	Sash	I	Wood	White	-0.2	QM
037	C	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
038	C	Door	Lft	U Lft	I	Metal	White	-0.1	QM
034	D	Wall	L Ctr		I	Drywall	White	0.0	QM
Interior Room 005 Bathroom									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
042	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
043	B	Wall	L Ctr		I	Drywall	White	0.0	QM
048	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
049	B	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
044	C	Wall	L Ctr		I	Drywall	White	0.0	QM
046	C	Ceiling			I	Drywall	White	0.0	QM
045	D	Wall	L Ctr		I	Drywall	White	0.0	QM
047	D	Baseboard	Rgt		I	Wood	White	-0.2	QM
050	D	Cabinet	Lft		I	Wood	Varnish	0.1	QM
Interior Room 006 UpperHall									
051	A	Wall	L Ctr		I	Drywall	White	0.0	QM
052	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
056	B	Baseboard	Ctr		I	Wood	White	-0.1	QM
053	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
055	C	Ceiling			I	Drywall	White	-0.1	QM
060	C	Attic Casing	Ctr		I	Wood	White	-0.1	QM
054	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
059	D	Stairs	Rgt	Wall	I	Wood	White	-0.2	QM
057	D	Closet	Ctr	Door	I	Wood	White	-0.1	QM
058	D	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
Interior Room 007 UpperBedA									
061	A	Wall	L Ctr		I	Drywall	White	0.0	QM
066	A	Baseboard	Ctr		I	Wood	White	0.2	QM
070	A	Window	Ctr	Sash	I	Wood	White	0.0	QM
069	A	Window	Ctr	Lft casing	I	Wood	White	-0.3	QM
062	B	Wall	L Ctr		I	Drywall	White	0.0	QM
063	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
065	C	Ceiling			I	Drywall	White	0.1	QM
067	C	Door	Rgt	Lft jamb	I	Wood	White	-0.3	QM
068	C	Door	Rgt	U Ctr	I	Wood	White	0.3	QM
064	D	Wall	L Ctr		I	Drywall	White	0.0	QM
071	D	Closet	Rgt	Shelf	I	Wood	White	0.0	QM
Interior Room 008 MasterBath									
072	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
080	A	Baseboard	Ctr		I	Vinyl	Gray	-0.8	QM
077	A	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
078	A	Door	Ctr	U Ctr	I	Wood	White	-0.4	QM
073	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
074	C	Wall	L Ctr		I	Drywall	White	-0.6	QM
076	C	Ceiling			I	Drywall	White	-0.9	QM
075	D	Wall	L Ctr		I	Drywall	White	0.1	QM
079	D	Cabinet	Rgt		I	Wood	White	0.0	QM
Interior Room 009 UpperBath									
081	A	Wall	L Ctr		I	Drywall	White	0.0	QM
085	A	Ceiling			I	Drywall	White	-0.1	QM
082	B	Wall	L Ctr		I	Drywall	White	0.1	QM
088	B	Cabinet	Lft		I	Wood	White	0.0	QM
083	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
089	C	Bathtub	Ctr		I	Metal	White	>9.9	QM
084	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
086	D	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
087	D	Door	Rgt	U Ctr	I	Wood	White	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 010 UpperBedB/C									
090	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
100	A	Closet	Rgt	Door	I	Wood	White	-0.5	QM
101	A	Closet	Rgt	Shelf	I	Wood	White	-0.6	QM
091	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
092	C	Wall	L Ctr		I	Drywall	White	0.1	QM
094	C	Ceiling			I	Drywall	White	-0.2	QM
098	C	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
099	C	Window	Ctr	Sash	I	Wood	White	-0.4	QM
093	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
095	D	Baseboard	Ctr		I	Wood	White	-0.9	QM
096	D	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
097	D	Door	Rgt	U Ctr	I	Wood	White	-0.5	QM
Interior Room 011 UpperBedC/D									
102	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
108	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
109	A	Door	Rgt	U Ctr	I	Wood	White	-1.0	QM
112	A	Closet	Lft	Door	I	Wood	White	-0.5	QM
113	A	Closet	Lft	Shelf Sup.	I	Wood	White	0.0	QM
103	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
107	B	Baseboard	Ctr		I	Wood	White	-0.5	QM
106	B	Ceiling			I	Drywall	White	-0.5	QM
104	C	Wall	L Ctr		I	Drywall	White	-0.7	QM
110	C	Window	Ctr	Rgt casing	I	Wood	White	-0.9	QM
111	C	Window	Ctr	Sash	I	Wood	White	-0.3	QM
105	D	Wall	L Ctr		I	Drywall	White	-0.3	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	381 Mariner Court- Interior
Report No.	09/04/13 12:56	
Total Reading Sets:	113	
Job Started:	09/04/13 12:56	
Job Finished:	09/04/13 13:29	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Attic Casing	1	0	<0%>	1	<100%>	0	<0%>
Baseboard	10	0	<0%>	10	<100%>	0	<0%>
Bathtub	1	1	<100%>	0	<0%>	0	<0%>
Cabinet	4	0	<0%>	4	<100%>	0	<0%>
Ceiling	11	0	<0%>	11	<100%>	0	<0%>
Closet Door	4	0	<0%>	4	<100%>	0	<0%>
Closet Door Casing	1	0	<0%>	1	<100%>	0	<0%>
Closet Shelf	3	0	<0%>	3	<100%>	0	<0%>
Closet Shelf Sup.	1	0	<0%>	1	<100%>	0	<0%>
Door Lft casing	1	0	<0%>	1	<100%>	0	<0%>
Door Lft jamb	1	0	<0%>	1	<100%>	0	<0%>
Door Rgt casing	6	0	<0%>	6	<100%>	0	<0%>
Door Rgt jamb	2	0	<0%>	2	<100%>	0	<0%>
Door U Ctr	8	0	<0%>	8	<100%>	0	<0%>
Door U Lft	1	0	<0%>	1	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	44	0	<0%>	44	<100%>	0	<0%>
Window Lft casing	1	0	<0%>	1	<100%>	0	<0%>
Window Rgt casing	4	0	<0%>	4	<100%>	0	<0%>
Window Sash	5	0	<0%>	5	<100%>	0	<0%>
Inspection Totals:	113	1	< 1%>	112	< 99%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 13:26

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
342 Pelican Street- Interior

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ Date: 9/13/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	342 Pelican Street- Interior
Report No.	09/04/13 13:26	
Total Readings:	135 Actionable: 2	
Job Started:	09/04/13 13:26	
Job Finished:	09/04/13 14:06	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 007 MasterBath									
080	C	Wall	L Ctr		I	Ceramic	Tan	5.4	QM
Interior Room 010 UpperBath									
122	C	Wall	L Lft		I	Ceramic	Tan	6.2	QM

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	342 Pelican Street- Interior
Report No.	09/04/13 13:26	
Total Readings:	135	
Job Started:	09/04/13 13:26	
Job Finished:	09/04/13 14:06	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
5	001	Hall/Stairs	C	Ceiling			I	Drywall	White	0.0	QM
6	001	Hall/Stairs	C	Baseboard	Ctr		I	Wood	White	0.1	QM
7	001	Hall/Stairs	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
8	001	Hall/Stairs	A	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
9	001	Hall/Stairs	A	Door	Rgt	U Ctr	I	Metal	White	-0.1	QM
10	001	Hall/Stairs	A	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
11	001	Hall/Stairs	A	Window	Lft	Sill	I	Wood	White	-0.1	QM
12	001	Hall/Stairs	C	Stairs	Ctr	Stringer	I	Wood	White	-0.1	QM
13	001	Hall/Stairs	C	Stairs	Ctr	Risers	I	Wood	White	-0.2	QM
14	001	Hall/Stairs	D	Stairs	Ctr	Wall	I	Wood	White	-0.1	QM
15	001	Hall/Stairs	B	Stairs	Ctr	Treads	I	Wood	Varnish	0.0	QM
16	001	Hall/Stairs	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.2	QM
17	001	Hall/Stairs	B	Door	Ctr	Lft casing	I	Wood	White	0.0	QM
18	001	Hall/Stairs	B	Door	Ctr	Lft jamb	I	Wood	White	0.1	QM
19	001	Hall/Stairs	B	Door	Ctr	L Ctr	I	Wood	White	0.1	QM
20	002	Bathroom	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
21	002	Bathroom	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
22	002	Bathroom	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
23	002	Bathroom	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
24	002	Bathroom	A	Ceiling			I	Drywall	White	-0.1	QM
25	002	Bathroom	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
26	002	Bathroom	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
27	002	Bathroom	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
28	002	Bathroom	D	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
29	002	Bathroom	A	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
30	002	Bathroom	B	Cabinet	Rgt		I	Wood	Varnish	0.0	QM
31	003	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
32	003	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
33	003	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
34	003	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
35	003	Living/Din	C	Ceiling			I	Drywall	White	-0.1	QM
36	003	Living/Din	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
37	003	Living/Din	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
38	003	Living/Din	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
39	003	Living/Din	C	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
40	003	Living/Din	C	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
41	003	Living/Din	C	Window	Lft	Sash	I	Vinyl	White	-0.1	QM
42	003	Living/Din	C	Window	Lft	Sill	I	Wood	White	0.0	QM
43	004	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
44	004	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
45	004	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
46	004	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
47	004	Kitchen	A	Ceiling			I	Drywall	White	-0.2	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Kitchen	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
49	004	Kitchen	D	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
50	005	Bedroom D/A	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
51	005	Bedroom D/A	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
52	005	Bedroom D/A	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
53	005	Bedroom D/A	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
54	005	Bedroom D/A	C	Ceiling			I	Drywall	White	-0.1	QM
55	005	Bedroom D/A	C	Baseboard	Ctr		I	Wood	White	0.0	QM
56	005	Bedroom D/A	B	Door	Rgt	Rgt casing	I	Wood	White	0.1	QM
57	005	Bedroom D/A	B	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
58	005	Bedroom D/A	B	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
59	005	Bedroom D/A	A	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
60	005	Bedroom D/A	A	Window	Ctr	Sash	I	Wood	White	-0.1	QM
61	005	Bedroom D/A	A	Window	Ctr	Sill	I	Wood	White	0.0	QM
62	006	UpperBedD/A	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
63	006	UpperBedD/A	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
64	006	UpperBedD/A	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
65	006	UpperBedD/A	D	Wall	L Ctr		I	Drywall	White	0.0	QM
66	006	UpperBedD/A	C	Ceiling			I	Drywall	White	-0.1	QM
67	006	UpperBedD/A	C	Baseboard	Ctr		I	Wood	White	0.2	QM
68	006	UpperBedD/A	B	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
69	006	UpperBedD/A	B	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
70	006	UpperBedD/A	B	Door	Lft	U Ctr	I	Wood	White	0.0	QM
71	006	UpperBedD/A	A	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
72	006	UpperBedD/A	A	Window	Rgt	Sash	I	Wood	White	0.0	QM
73	006	UpperBedD/A	A	Window	Rgt	Sill	I	Wood	White	-0.2	QM
74	006	UpperBedD/A	B	Closet	Lft	Shelf	I	Wood	White	0.0	QM
75	007	MasterBath	A	Wall	U Ctr		I	Drywall	White	-0.2	QM
76	007	MasterBath	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
77	007	MasterBath	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
78	007	MasterBath	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
79	007	MasterBath	C	Ceiling			I	Drywall	White	-0.2	QM
80	007	MasterBath	C	Wall	L Ctr		I	Ceramic	Tan	5.4	QM
81	007	MasterBath	A	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
82	007	MasterBath	A	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
83	007	MasterBath	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
84	007	MasterBath	C	Bathtub	Ctr		I	Porcelain	White	-0.2	QM
85	007	MasterBath	B	Cabinet	Lft		I	Wood	Varnish	-0.2	QM
86	008	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
87	008	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
88	008	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
89	008	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
90	008	UpperBedB/C	A	Ceiling			I	Drywall	White	-0.1	QM
91	008	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
92	008	UpperBedB/C	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
93	008	UpperBedB/C	A	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
94	008	UpperBedB/C	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
95	008	UpperBedB/C	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
96	008	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
97	008	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
98	008	UpperBedB/C	A	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM
99	008	UpperBedB/C	A	Closet	Rgt	Door	I	Wood	White	0.0	QM
100	009	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	0.0	QM
101	009	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
102	009	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	0.0	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	009	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	0.0	QM
104	009	UpperBedC/D	C	Ceiling			I	Drywall	White	0.0	QM
105	009	UpperBedC/D	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
106	009	UpperBedC/D	B	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
107	009	UpperBedC/D	B	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
108	009	UpperBedC/D	B	Door	Lft	U Lft	I	Wood	White	0.2	QM
109	009	UpperBedC/D	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
110	009	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
111	009	UpperBedC/D	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
112	009	UpperBedC/D	A	Closet	Lft	Door	I	Wood	White	0.0	QM
113	010	UpperBath	A	Wall	U Ctr		I	Drywall	White	0.0	QM
114	010	UpperBath	B	Wall	U Ctr		I	Drywall	White	0.2	QM
115	010	UpperBath	C	Wall	U Ctr		I	Drywall	White	0.2	QM
116	010	UpperBath	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
117	010	UpperBath	C	Ceiling			I	Drywall	White	0.0	QM
118	010	UpperBath	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
119	010	UpperBath	B	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
120	010	UpperBath	B	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
121	010	UpperBath	B	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
122	010	UpperBath	C	Wall	L Lft		I	Ceramic	Tan	6.2	QM
123	010	UpperBath	D	Cabinet	Lft		I	Wood	Varnish	-0.2	QM
124	011	UpperHall	A	Wall	L Ctr		I	Drywall	White	0.0	QM
125	011	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
126	011	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
127	011	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
128	011	UpperHall	A	Ceiling			I	Drywall	White	-0.1	QM
129	011	UpperHall	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
130	011	UpperHall	B	Closet	Ctr	Door	I	Wood	White	-0.1	QM
131	011	UpperHall	B	Closet	Ctr	Door Casing	I	Wood	White	-0.2	QM
132	011	UpperHall	B	Closet	Ctr	Door Jamb	I	Wood	White	-0.1	QM
133	011	UpperHall	B	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
134	011	UpperHall	A	AccessHatch	Ctr		I	Wood	White	-0.2	QM
135	011	UpperHall	A	Attic Casing	Ctr		I	Wood	White	-0.2	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	342 Pelican Street- Interior
Report No.	09/04/13 13:26	
Total Readings:	135	
Job Started:	09/04/13 13:26	
Job Finished:	09/04/13 14:06	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
010	A	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
011	A	Window	Lft	Sill	I	Wood	White	-0.1	QM
008	A	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
007	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
009	A	Door	Rgt	U Ctr	I	Metal	White	-0.1	QM
016	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.2	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
017	B	Door	Ctr	Lft casing	I	Wood	White	0.0	QM
018	B	Door	Ctr	Lft jamb	I	Wood	White	0.1	QM
019	B	Door	Ctr	L Ctr	I	Wood	White	0.1	QM
015	B	Stairs	Ctr	Treads	I	Wood	Varnish	0.0	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
006	C	Baseboard	Ctr		I	Wood	White	0.1	QM
005	C	Ceiling			I	Drywall	White	0.0	QM
013	C	Stairs	Ctr	Risers	I	Wood	White	-0.2	QM
012	C	Stairs	Ctr	Stringer	I	Wood	White	-0.1	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
014	D	Stairs	Ctr	Wall	I	Wood	White	-0.1	QM
Interior Room 002 Bathroom									
020	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
024	A	Ceiling			I	Drywall	White	-0.1	QM
029	A	Cabinet	Ctr		I	Wood	Varnish	-0.2	QM
021	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
030	B	Cabinet	Rgt		I	Wood	Varnish	0.0	QM
022	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
025	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
023	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
027	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
026	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
028	D	Door	Lft	U Ctr	I	Wood	White	-0.2	QM
Interior Room 003 Living/Din									
031	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
032	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
033	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
036	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
035	C	Ceiling			I	Drywall	White	-0.1	QM
040	C	Window	Lft	Rgt casing	I	Wood	White	-0.1	QM
041	C	Window	Lft	Sash	I	Vinyl	White	-0.1	QM
042	C	Window	Lft	Sill	I	Wood	White	0.0	QM
038	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
037	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
039	C	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
034	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 004 Kitchen									
043	A	Wall	L Ctr		I	Drywall	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
047	A	Ceiling			I	Drywall	White	-0.2	QM
044	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
045	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
048	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
046	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
049	D	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
Interior Room 005 Bedroom D/A									
050	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
059	A	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
060	A	Window	Ctr	Sash	I	Wood	White	-0.1	QM
061	A	Window	Ctr	Sill	I	Wood	White	0.0	QM
051	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
057	B	Door	Rgt	Rgt jamb	I	Wood	White	0.0	QM
056	B	Door	Rgt	Rgt casing	I	Wood	White	0.1	QM
058	B	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
052	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
055	C	Baseboard	Ctr		I	Wood	White	0.0	QM
054	C	Ceiling			I	Drywall	White	-0.1	QM
053	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 006 UpperBedD/A									
062	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
071	A	Window	Rgt	Rgt casing	I	Wood	White	-0.1	QM
072	A	Window	Rgt	Sash	I	Wood	White	0.0	QM
073	A	Window	Rgt	Sill	I	Wood	White	-0.2	QM
063	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
069	B	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
068	B	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
070	B	Door	Lft	U Ctr	I	Wood	White	0.0	QM
074	B	Closet	Lft	Shelf	I	Wood	White	0.0	QM
064	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
067	C	Baseboard	Ctr		I	Wood	White	0.2	QM
066	C	Ceiling			I	Drywall	White	-0.1	QM
065	D	Wall	L Ctr		I	Drywall	White	0.0	QM
Interior Room 007 MasterBath									
075	A	Wall	U Ctr		I	Drywall	White	-0.2	QM
082	A	Door	Lft	Rgt jamb	I	Wood	White	-0.3	QM
081	A	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
083	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
076	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
085	B	Cabinet	Lft		I	Wood	Varnish	-0.2	QM
080	C	Wall	L Ctr		I	Ceramic	Tan	5.4	QM
077	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
079	C	Ceiling			I	Drywall	White	-0.2	QM
084	C	Bathtub	Ctr		I	Porcelain	White	-0.2	QM
078	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
Interior Room 008 UpperBedB/C									
086	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
090	A	Ceiling			I	Drywall	White	-0.1	QM
093	A	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
092	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
094	A	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
099	A	Closet	Rgt	Door	I	Wood	White	0.0	QM
098	A	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
087	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
088	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
091	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
095	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
096	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
097	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
089	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Interior Room 009 UpperBedC/D									
100	A	Wall	L Ctr		I	Drywall	White	0.0	QM
112	A	Closet	Lft	Door	I	Wood	White	0.0	QM
101	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
107	B	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
106	B	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
108	B	Door	Lft	U Lft	I	Wood	White	0.2	QM
102	C	Wall	L Ctr		I	Drywall	White	0.0	QM
105	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
104	C	Ceiling			I	Drywall	White	0.0	QM
109	C	Window	Ctr	Rgt casing	I	Wood	White	0.0	QM
110	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
111	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
103	D	Wall	L Ctr		I	Drywall	White	0.0	QM
Interior Room 010 UpperBath									
113	A	Wall	U Ctr		I	Drywall	White	0.0	QM
114	B	Wall	U Ctr		I	Drywall	White	0.2	QM
120	B	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
119	B	Door	Ctr	Rgt casing	I	Wood	White	-0.2	QM
121	B	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
122	C	Wall	L Lft		I	Ceramic	Tan	6.2	QM
115	C	Wall	U Ctr		I	Drywall	White	0.2	QM
118	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
117	C	Ceiling			I	Drywall	White	0.0	QM
116	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
123	D	Cabinet	Lft		I	Wood	Varnish	-0.2	QM
Interior Room 011 UpperHall									
124	A	Wall	L Ctr		I	Drywall	White	0.0	QM
128	A	Ceiling			I	Drywall	White	-0.1	QM
134	A	AccessHatch	Ctr		I	Wood	White	-0.2	QM
135	A	Attic Casing	Ctr		I	Wood	White	-0.2	QM
125	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
130	B	Closet	Ctr	Door	I	Wood	White	-0.1	QM
131	B	Closet	Ctr	Door Casing	I	Wood	White	-0.2	QM
132	B	Closet	Ctr	Door Jamb	I	Wood	White	-0.1	QM
133	B	Closet	Ctr	Shelf	I	Wood	White	-0.2	QM
126	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
129	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
127	D	Wall	L Ctr		I	Drywall	White	-0.1	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	342 Pelican Street- Interior
Report No.	09/04/13 13:26	
Total Reading Sets:	135	
Job Started:	09/04/13 13:26	
Job Finished:	09/04/13 14:06	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
AccessHatch	1	0	<0%>	1	<100%>	0	<0%>
Attic Casing	1	0	<0%>	1	<100%>	0	<0%>
Baseboard	10	0	<0%>	10	<100%>	0	<0%>
Bathtub	1	0	<0%>	1	<100%>	0	<0%>
Cabinet	5	0	<0%>	5	<100%>	0	<0%>
Ceiling	11	0	<0%>	11	<100%>	0	<0%>
Closet Door	3	0	<0%>	3	<100%>	0	<0%>
Closet Door Casing	1	0	<0%>	1	<100%>	0	<0%>
Closet Door Jamb	1	0	<0%>	1	<100%>	0	<0%>
Closet Shelf	3	0	<0%>	3	<100%>	0	<0%>
Door L Ctr	1	0	<0%>	1	<100%>	0	<0%>
Door Lft casing	1	0	<0%>	1	<100%>	0	<0%>
Door Lft jamb	1	0	<0%>	1	<100%>	0	<0%>
Door Rgt casing	9	0	<0%>	9	<100%>	0	<0%>
Door Rgt jamb	9	0	<0%>	9	<100%>	0	<0%>
Door U Ctr	8	0	<0%>	8	<100%>	0	<0%>
Door U Lft	1	0	<0%>	1	<100%>	0	<0%>
Stairs Railing cap	1	0	<0%>	1	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	46	2	<4%>	44	<96%>	0	<0%>
Window Rgt casing	6	0	<0%>	6	<100%>	0	<0%>
Window Sash	5	0	<0%>	5	<100%>	0	<0%>
Window Sill	6	0	<0%>	6	<100%>	0	<0%>
Inspection Totals:	135	2	< 1%>	133	< 99%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 14:09

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
248 Albatross Street- Interior

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ **Date:** 9/13/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	248 Albatross Street- Interior
Report No.	09/04/13 14:09	
Total Readings:	138 Actionable: 2	
Job Started:	09/04/13 14:09	
Job Finished:	09/04/13 14:58	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 007 MasterBath									
078	C	Wall	L Ctr		I	Ceramic	Tan	6.1	QM
Interior Room 008 UpperBath									
089	C	Wall	L Lft		I	Ceramic	Tan	6.8	QM
Calibration Readings									

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	248 Albatross Street- Interior
Report No.	09/04/13 14:09	
Total Readings:	138	
Job Started:	09/04/13 14:09	
Job Finished:	09/04/13 14:58	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	0.0	QM
5	001	Hall/Stairs	C	Ceiling			I	Drywall	White	0.0	QM
6	001	Hall/Stairs	C	Baseboard	Ctr		I	Wood	White	0.0	QM
7	001	Hall/Stairs	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
8	001	Hall/Stairs	A	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
9	001	Hall/Stairs	A	Door	Lft	U Ctr	I	Metal	White	-0.1	QM
10	001	Hall/Stairs	A	Window	Rgt	Rgt casing	I	Wood	White	0.0	QM
11	001	Hall/Stairs	A	Window	Rgt	Sill	I	Wood	White	-0.1	QM
12	001	Hall/Stairs	C	Stairs	Ctr	Stringer	I	Wood	White	-0.2	QM
13	001	Hall/Stairs	C	Stairs	Ctr	Risers	I	Wood	White	0.0	QM
14	001	Hall/Stairs	B	Stairs	Ctr	Wall	I	Wood	White	0.0	QM
15	001	Hall/Stairs	D	Stairs	Ctr	Treads	I	Wood	Varnish	0.0	QM
16	001	Hall/Stairs	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.1	QM
17	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	0.0	QM
18	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
19	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
20	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	0.0	QM
21	002	Bedroom A/B	C	Ceiling			I	Drywall	White	0.0	QM
22	002	Bedroom A/B	C	Baseboard	Ctr		I	Wood	White	0.1	QM
23	002	Bedroom A/B	D	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
24	002	Bedroom A/B	D	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
25	002	Bedroom A/B	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
26	002	Bedroom A/B	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
27	002	Bedroom A/B	A	Window	Ctr	Sash	I	Wood	White	-0.1	QM
28	002	Bedroom A/B	A	Window	Ctr	Sill	I	Wood	White	-0.1	QM
29	003	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
30	003	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
31	003	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
32	003	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
33	003	Kitchen	A	Ceiling			I	Drywall	White	-0.2	QM
34	003	Kitchen	C	Baseboard	Ctr		I	Vinyl	Black	0.1	QM
35	003	Kitchen	B	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
36	004	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
37	004	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
38	004	Living/Din	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
39	004	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
40	004	Living/Din	A	Ceiling			I	Drywall	White	-0.1	QM
41	004	Living/Din	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
42	004	Living/Din	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
43	004	Living/Din	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
44	004	Living/Din	C	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
45	004	Living/Din	C	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
46	004	Living/Din	C	Window	Rgt	Sash	I	Vinyl	White	-0.2	QM
47	004	Living/Din	C	Window	Rgt	Sill	I	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Living/Din	C	Mini Blinds	Rgt		I	Vinyl	White	-0.1	QM
49	005	Bathroom	A	Wall	L Ctr		I	Drywall	White	0.0	QM
50	005	Bathroom	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
51	005	Bathroom	C	Wall	L Ctr		I	Drywall	White	0.0	QM
52	005	Bathroom	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
53	005	Bathroom	C	Ceiling			I	Drywall	White	-0.1	QM
54	005	Bathroom	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
55	005	Bathroom	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
56	005	Bathroom	B	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
57	005	Bathroom	B	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
58	005	Bathroom	D	Cabinet	Lft		I	Wood	Varnish	-0.1	QM
59	005	Bathroom	A	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
60	006	UpperBedA/B	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
61	006	UpperBedA/B	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
62	006	UpperBedA/B	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
63	006	UpperBedA/B	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
64	006	UpperBedA/B	C	Ceiling			I	Drywall	White	-0.1	QM
65	006	UpperBedA/B	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
66	006	UpperBedA/B	D	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
67	006	UpperBedA/B	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
68	006	UpperBedA/B	D	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
69	006	UpperBedA/B	A	Window	Lft	Rgt casing	I	Wood	White	0.0	QM
70	006	UpperBedA/B	A	Window	Lft	Sash	I	Wood	White	-0.1	QM
71	006	UpperBedA/B	A	Window	Lft	Sill	I	Wood	White	-0.2	QM
72	006	UpperBedA/B	A	Mini Blinds	Lft		I	Vinyl	White	-0.1	QM
73	007	MasterBath	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
74	007	MasterBath	B	Wall	U Ctr		I	Drywall	White	0.1	QM
75	007	MasterBath	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
76	007	MasterBath	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
77	007	MasterBath	C	Ceiling			I	Drywall	White	-0.1	QM
78	007	MasterBath	C	Wall	L Ctr		I	Ceramic	Tan	6.1	QM
79	007	MasterBath	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
80	007	MasterBath	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
81	007	MasterBath	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
82	007	MasterBath	D	Sink	Rgt		I	Porcelain	White	-0.1	QM
83	007	MasterBath	D	Cabinet	Rgt		I	Wood	White	-0.3	QM
84	008	UpperBath	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
85	008	UpperBath	B	Wall	U Ctr		I	Drywall	White	0.0	QM
86	008	UpperBath	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
87	008	UpperBath	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
88	008	UpperBath	C	Ceiling			I	Drywall	White	-0.2	QM
89	008	UpperBath	C	Wall	L Lft		I	Ceramic	Tan	6.8	QM
90	008	UpperBath	D	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
91	008	UpperBath	D	Door	Ctr	Rgt jamb	I	Wood	White	0.0	QM
92	008	UpperBath	D	Door	Ctr	U Ctr	I	Wood	White	0.0	QM
93	008	UpperBath	B	Sink	Rgt		I	Porcelain	White	-0.1	QM
94	008	UpperBath	B	Cabinet	Rgt		I	Wood	White	-0.1	QM
95	009	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
96	009	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
97	009	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
98	009	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
99	009	UpperBedB/C	A	Ceiling			I	Drywall	White	-0.1	QM
100	009	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
101	009	UpperBedB/C	D	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
102	009	UpperBedB/C	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	009	UpperBedB/C	D	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
104	009	UpperBedB/C	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
105	009	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
106	009	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	-0.2	QM
107	009	UpperBedB/C	A	Closet	Rgt	Door	I	Wood	White	-0.1	QM
108	010	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
109	010	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
110	010	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
111	010	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
112	010	UpperBedC/D	C	Ceiling			I	Drywall	White	-0.1	QM
113	010	UpperBedC/D	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
114	010	UpperBedC/D	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
115	010	UpperBedC/D	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
116	010	UpperBedC/D	A	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
117	010	UpperBedC/D	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
118	010	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
119	010	UpperBedC/D	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
120	010	UpperBedC/D	A	Closet	Lft	Shelf	I	Wood	White	-0.1	QM
121	011	UpperHall	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
122	011	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
123	011	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
124	011	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
125	011	UpperHall	C	Ceiling			I	Drywall	White	-0.1	QM
126	011	UpperHall	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
127	011	UpperHall	B	Door	Ctr	Rgt casing	I	Wood	White	0.1	QM
128	011	UpperHall	B	Door	Ctr	Rgt jamb	I	Wood	White	0.2	QM
129	011	UpperHall	B	Door	Ctr	U Ctr	I	Wood	White	0.0	QM
130	011	UpperHall	B	DoorStop	Ctr		I	Wood	Black	-0.1	QM
131	011	UpperHall	A	AccessHatch	Ctr		I	Wood	White	-0.2	QM
132	011	UpperHall	A	Attic Casing	Ctr		I	Wood	White	0.0	QM
133		CALIBRATION								1.0	QM
134		CALIBRATION								1.0	QM
135		CALIBRATION								1.0	QM
136		CALIBRATION								-0.2	QM
137		CALIBRATION								-0.1	QM
138		CALIBRATION								-0.1	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	248 Albatross Street- Interior
Report No.	09/04/13 14:09	
Total Readings:	138	
Job Started:	09/04/13 14:09	
Job Finished:	09/04/13 14:58	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
010	A	Window	Rgt	Rgt casing	I	Wood	White	0.0	QM
011	A	Window	Rgt	Sill	I	Wood	White	-0.1	QM
008	A	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
007	A	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
009	A	Door	Lft	U Ctr	I	Metal	White	-0.1	QM
016	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.1	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
014	B	Stairs	Ctr	Wall	I	Wood	White	0.0	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
006	C	Baseboard	Ctr		I	Wood	White	0.0	QM
005	C	Ceiling			I	Drywall	White	0.0	QM
013	C	Stairs	Ctr	Risers	I	Wood	White	0.0	QM
012	C	Stairs	Ctr	Stringer	I	Wood	White	-0.2	QM
004	D	Wall	L Ctr		I	Drywall	White	0.0	QM
015	D	Stairs	Ctr	Treads	I	Wood	Varnish	0.0	QM
Interior Room 002 Bedroom A/B									
017	A	Wall	L Ctr		I	Drywall	White	0.0	QM
026	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
027	A	Window	Ctr	Sash	I	Wood	White	-0.1	QM
028	A	Window	Ctr	Sill	I	Wood	White	-0.1	QM
018	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
019	C	Wall	L Ctr		I	Drywall	White	-0.3	QM
022	C	Baseboard	Ctr		I	Wood	White	0.1	QM
021	C	Ceiling			I	Drywall	White	0.0	QM
020	D	Wall	L Ctr		I	Drywall	White	0.0	QM
024	D	Door	Lft	Rgt jamb	I	Wood	White	0.0	QM
023	D	Door	Lft	Rgt casing	I	Wood	White	-0.2	QM
025	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
Interior Room 003 Kitchen									
029	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
033	A	Ceiling			I	Drywall	White	-0.2	QM
030	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
035	B	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
031	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
034	C	Baseboard	Ctr		I	Vinyl	Black	0.1	QM
032	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 004 Living/Din									
036	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
040	A	Ceiling			I	Drywall	White	-0.1	QM
037	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
038	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
041	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
045	C	Window	Rgt	Rgt casing	I	Wood	White	-0.2	QM
046	C	Window	Rgt	Sash	I	Vinyl	White	-0.2	QM
047	C	Window	Rgt	Sill	I	Wood	White	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
043	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
042	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
044	C	Door	Ctr	U Ctr	I	Metal	White	-0.1	QM
048	C	Mini Blinds	Rgt		I	Vinyl	White	-0.1	QM
039	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 005 Bathroom									
049	A	Wall	L Ctr		I	Drywall	White	0.0	QM
059	A	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
050	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
056	B	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
055	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
057	B	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
051	C	Wall	L Ctr		I	Drywall	White	0.0	QM
054	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
053	C	Ceiling			I	Drywall	White	-0.1	QM
052	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
058	D	Cabinet	Lft		I	Wood	Varnish	-0.1	QM
Interior Room 006 UpperBedA/B									
060	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
069	A	Window	Lft	Rgt casing	I	Wood	White	0.0	QM
070	A	Window	Lft	Sash	I	Wood	White	-0.1	QM
071	A	Window	Lft	Sill	I	Wood	White	-0.2	QM
072	A	Mini Blinds	Lft		I	Vinyl	White	-0.1	QM
061	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
062	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
065	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
064	C	Ceiling			I	Drywall	White	-0.1	QM
063	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
067	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
066	D	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
068	D	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
Interior Room 007 MasterBath									
073	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
080	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
079	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
081	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
074	B	Wall	U Ctr		I	Drywall	White	0.1	QM
078	C	Wall	L Ctr		I	Ceramic	Tan	6.1	QM
075	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
077	C	Ceiling			I	Drywall	White	-0.1	QM
076	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
082	D	Sink	Rgt		I	Porcelain	White	-0.1	QM
083	D	Cabinet	Rgt		I	Wood	White	-0.3	QM
Interior Room 008 UpperBath									
084	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
085	B	Wall	U Ctr		I	Drywall	White	0.0	QM
093	B	Sink	Rgt		I	Porcelain	White	-0.1	QM
094	B	Cabinet	Rgt		I	Wood	White	-0.1	QM
089	C	Wall	L Lft		I	Ceramic	Tan	6.8	QM
086	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
088	C	Ceiling			I	Drywall	White	-0.2	QM
087	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
091	D	Door	Ctr	Rgt jamb	I	Wood	White	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
090	D	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
092	D	Door	Ctr	U Ctr	I	Wood	White	0.0	QM
Interior Room 009 UpperBedB/C									
095	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
099	A	Ceiling			I	Drywall	White	-0.1	QM
107	A	Closet	Rgt	Door	I	Wood	White	-0.1	QM
096	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
097	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
100	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
104	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
105	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
106	C	Window	Ctr	Sill	I	Wood	White	-0.2	QM
098	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
102	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
101	D	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
103	D	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
Interior Room 010 UpperBedC/D									
108	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
115	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
114	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
116	A	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
120	A	Closet	Lft	Shelf	I	Wood	White	-0.1	QM
109	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
110	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
113	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
112	C	Ceiling			I	Drywall	White	-0.1	QM
117	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
118	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
119	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
111	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 011 UpperHall									
121	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
131	A	AccessHatch	Ctr		I	Wood	White	-0.2	QM
132	A	Attic Casing	Ctr		I	Wood	White	0.0	QM
122	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
128	B	Door	Ctr	Rgt jamb	I	Wood	White	0.2	QM
127	B	Door	Ctr	Rgt casing	I	Wood	White	0.1	QM
129	B	Door	Ctr	U Ctr	I	Wood	White	0.0	QM
130	B	DoorStop	Ctr		I	Wood	Black	-0.1	QM
123	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
126	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
125	C	Ceiling			I	Drywall	White	-0.1	QM
124	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
Calibration Readings									
133								1.0	QM
134								1.0	QM
135								1.0	QM
136								-0.2	QM
137								-0.1	QM
138								-0.1	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	248 Albatross Street- Interior
Report No.	09/04/13 14:09	
Total Reading Sets:	132	
Job Started:	09/04/13 14:09	
Job Finished:	09/04/13 14:58	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
AccessHatch	1	0	<0%>	1	<100%>	0	<0%>
Attic Casing	1	0	<0%>	1	<100%>	0	<0%>
Baseboard	9	0	<0%>	9	<100%>	0	<0%>
Cabinet	5	0	<0%>	5	<100%>	0	<0%>
Ceiling	11	0	<0%>	11	<100%>	0	<0%>
Closet Door	1	0	<0%>	1	<100%>	0	<0%>
Closet Shelf	1	0	<0%>	1	<100%>	0	<0%>
Door Rgt casing	10	0	<0%>	10	<100%>	0	<0%>
Door Rgt jamb	10	0	<0%>	10	<100%>	0	<0%>
Door U Ctr	10	0	<0%>	10	<100%>	0	<0%>
DoorStop	1	0	<0%>	1	<100%>	0	<0%>
Mini Blinds	2	0	<0%>	2	<100%>	0	<0%>
Sink	2	0	<0%>	2	<100%>	0	<0%>
Stairs Railing cap	1	0	<0%>	1	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	46	2	<4%>	44	<96%>	0	<0%>
Window Rgt casing	6	0	<0%>	6	<100%>	0	<0%>
Window Sash	5	0	<0%>	5	<100%>	0	<0%>
Window Sill	6	0	<0%>	6	<100%>	0	<0%>
Inspection Totals:	132	2	< 2%>	130	< 98%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 15:11

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
246 Albatross Street- Interior

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____ **Date:** 9/13/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	246 Albatross Street- Interior
Report No.	09/04/13 15:11	
Total Readings:	142 Actionable: 2	
Job Started:	09/04/13 15:11	
Job Finished:	09/04/13 15:56	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 010 UpperBath									
108	A	Wall	L Lft		I	Ceramic	Tan	3.8	QM
Interior Room 012 MasterBath									
131	A	Wall	L Lft		I	Ceramic	Tan	5.3	QM
Calibration Readings									

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	246 Albatross Street- Interior
Report No.	09/04/13 15:11	
Total Readings:	142	
Job Started:	09/04/13 15:11	
Job Finished:	09/04/13 15:56	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	0.0	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	0.0	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
5	001	Hall/Stairs	C	Ceiling			I	Drywall	White	-0.3	QM
6	001	Hall/Stairs	D	Baseboard	Ctr		I	Wood	White	-0.1	QM
7	001	Hall/Stairs	A	Door	Ctr	U Ctr	I	Metal	White	-0.3	QM
8	001	Hall/Stairs	A	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
9	001	Hall/Stairs	A	Door	Ctr	Lft jamb	P	Wood	White	-0.3	QM
10	001	Hall/Stairs	B	Closet	Ctr	Door	I	Wood	White	-0.2	QM
11	001	Hall/Stairs	B	Closet	Ctr	Door Casing	I	Wood	White	-0.1	QM
12	001	Hall/Stairs	B	Closet	Ctr	Shelf	I	Wood	White	-0.4	QM
13	001	Hall/Stairs	B	Stairs	Rgt	Risers	I	Wood	White	-0.5	QM
14	001	Hall/Stairs	B	Stairs	Rgt	Stringer	I	Wood	White	-0.1	QM
15	001	Hall/Stairs	B	Stairs	Rgt	Treads	I	Wood	Varnish	-0.3	QM
16	002	Bathroom	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
17	002	Bathroom	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
18	002	Bathroom	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
19	002	Bathroom	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
20	002	Bathroom	A	Ceiling			I	Drywall	White	-0.1	QM
21	002	Bathroom	A	Baseboard	Ctr		P	Wood	White	-0.2	QM
22	002	Bathroom	D	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
23	002	Bathroom	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
24	002	Bathroom	A	Closet	Ctr	Shelf	I	Wood	White	-0.3	QM
25	002	Bathroom	B	Cabinet	Rgt		I	Wood	White	0.0	QM
26	003	Living/Din	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
27	003	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
28	003	Living/Din	C	Wall	L Ctr		I	Drywall	White	0.0	QM
29	003	Living/Din	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
30	003	Living/Din	C	Ceiling			I	Drywall	White	0.0	QM
31	003	Living/Din	C	Baseboard	Rgt		I	Wood	White	-0.1	QM
32	003	Living/Din	C	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
33	003	Living/Din	C	Door	Rgt	U Ctr	I	Metal	White	-0.3	QM
34	003	Living/Din	C	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
35	004	Kitchen	A	Wall	L Ctr		I	Drywall	White	-1.1	QM
36	004	Kitchen	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
37	004	Kitchen	C	Wall	U Ctr		I	Drywall	White	0.0	QM
38	004	Kitchen	D	Wall	U Ctr		I	Drywall	White	-0.5	QM
39	004	Kitchen	C	Ceiling			I	Drywall	White	0.1	QM
40	004	Kitchen	B	Baseboard	Ctr		I	Wood	White	-0.1	QM
41	004	Kitchen	A	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
42	005	Bedroom D/A	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
43	005	Bedroom D/A	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
44	005	Bedroom D/A	C	Wall	L Ctr		I	Drywall	White	0.0	QM
45	005	Bedroom D/A	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
46	005	Bedroom D/A	C	Ceiling			I	Drywall	White	-0.3	QM
47	005	Bedroom D/A	D	Baseboard	Ctr		I	Wood	White	-0.3	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	005	Bedroom D/A	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
49	005	Bedroom D/A	B	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
50	005	Bedroom D/A	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
51	005	Bedroom D/A	A	Window	Ctr	Sill	I	Wood	White	0.0	QM
52	005	Bedroom D/A	A	Mini Blinds	Ctr		I	Vinyl	White	-0.4	QM
53	006	UpperHall	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
54	006	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
55	006	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
56	006	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
57	006	UpperHall	C	Ceiling			I	Drywall	White	-0.6	QM
58	006	UpperHall	A	Baseboard	Ctr		I	Wood	White	-0.3	QM
59	006	UpperHall	B	Closet	Rgt	Door Casing	I	Wood	White	-0.3	QM
60	006	UpperHall	B	Closet	Rgt	Door	I	Wood	White	-0.1	QM
61	006	UpperHall	B	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM
62	006	UpperHall	B	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.1	QM
63	006	UpperHall	B	Stairs	Lft	Wall	I	Wood	White	0.0	QM
64	006	UpperHall	A	AccessHatch	Ctr		I	Wood	White	0.1	QM
65	006	UpperHall	A	Attic Casing	Ctr		I	Wood	White	0.0	QM
66	007	UpperBedA/B	A	Wall	L Ctr		I	Drywall	White	0.1	QM
67	007	UpperBedA/B	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
68	007	UpperBedA/B	C	Wall	L Ctr		I	Drywall	White	0.0	QM
69	007	UpperBedA/B	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
70	007	UpperBedA/B	C	Ceiling			I	Drywall	White	-0.2	QM
71	007	UpperBedA/B	D	Baseboard	Ctr		I	Wood	White	0.0	QM
72	007	UpperBedA/B	D	Door	Lft	Rgt casing	I	Wood	Cream	-0.5	QM
73	007	UpperBedA/B	D	Door	Lft	U Ctr	I	Wood	White	-0.5	QM
74	007	UpperBedA/B	A	Window	Lft	Rgt casing	I	Wood	Green	-0.4	QM
75	007	UpperBedA/B	A	Window	Lft	Sash	I	Wood	White	0.1	QM
76	007	UpperBedA/B	A	Window	Lft	Sill	I	Wood	Green	-0.2	QM
77	007	UpperBedA/B	A	Closet	Rgt	Door	I	Wood	White	-0.1	QM
78	007	UpperBedA/B	A	Closet	Rgt	Shelf	I	Wood	White	-0.2	QM
79	008	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	0.0	QM
80	008	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
81	008	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
82	008	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
83	008	UpperBedB/C	C	Ceiling			I	Drywall	White	0.0	QM
84	008	UpperBedB/C	D	Baseboard	Ctr		I	Wood	White	-0.1	QM
85	008	UpperBedB/C	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.4	QM
86	008	UpperBedB/C	D	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
87	008	UpperBedB/C	C	Window	Rgt	Sash	I	Wood	White	-0.4	QM
88	008	UpperBedB/C	C	Window	Rgt	Sill	I	Wood	White	-0.1	QM
89	008	UpperBedB/C	A	Closet	Rgt	Door	I	Wood	White	-0.3	QM
90	008	UpperBedB/C	A	Closet	Rgt	Shelf	I	Wood	White	-0.3	QM
91	009	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	0.0	QM
92	009	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
93	009	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
94	009	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
95	009	UpperBedC/D	C	Ceiling			I	Drywall	White	-0.3	QM
96	009	UpperBedC/D	A	Baseboard	Ctr		I	Wood	White	-0.3	QM
97	009	UpperBedC/D	B	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
98	009	UpperBedC/D	B	Door	Lft	U Ctr	I	Wood	White	0.0	QM
99	009	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
100	009	UpperBedC/D	C	Window	Ctr	Sill	I	Wood	White	-0.7	QM
101	009	UpperBedC/D	B	Closet	Rgt	Door	I	Wood	White	-0.2	QM
102	009	UpperBedC/D	B	Closet	Rgt	Shelf	I	Wood	White	-0.6	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	010	UpperBath	A	Wall	U Ctr		I	Drywall	White	-0.5	QM
104	010	UpperBath	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
105	010	UpperBath	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
106	010	UpperBath	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
107	010	UpperBath	C	Ceiling			I	Drywall	White	-0.2	QM
108	010	UpperBath	A	Wall	L Lft		I	Ceramic	Tan	3.8	QM
109	010	UpperBath	B	Door	Rgt	Rgt casing	I	Wood	White	-0.6	QM
110	010	UpperBath	B	Door	Rgt	U Ctr	I	Wood	White	-0.6	QM
111	010	UpperBath	D	Cabinet	Lft		I	Wood	White	-0.4	QM
112	010	UpperBath	D	Sink	Lft		I	Porcelain	White	-0.5	QM
113	010	UpperBath	A	Bathtub	Ctr		I	Porcelain	White	-0.8	QM
114	011	UpperBedD/A	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
115	011	UpperBedD/A	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
116	011	UpperBedD/A	C	Wall	L Ctr		I	Drywall	White	-0.7	QM
117	011	UpperBedD/A	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
118	011	UpperBedD/A	C	Ceiling			I	Drywall	White	-0.5	QM
119	011	UpperBedD/A	A	Baseboard	Ctr		I	Wood	White	0.0	QM
120	011	UpperBedD/A	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
121	011	UpperBedD/A	B	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
122	011	UpperBedD/A	A	Window	Ctr	Sash	I	Wood	White	-0.5	QM
123	011	UpperBedD/A	A	Window	Ctr	Sill	I	Wood	White	-0.1	QM
124	011	UpperBedD/A	B	Closet	Lft	Door	I	Wood	White	-0.3	QM
125	011	UpperBedD/A	B	Closet	Lft	Shelf	I	Wood	White	-0.1	QM
126	012	MasterBath	A	Wall	U Ctr		I	Drywall	White	-0.5	QM
127	012	MasterBath	B	Wall	U Ctr		I	Drywall	White	-0.9	QM
128	012	MasterBath	C	Wall	U Ctr		I	Drywall	White	-0.3	QM
129	012	MasterBath	D	Wall	U Ctr		I	Drywall	White	-0.3	QM
130	012	MasterBath	C	Ceiling			I	Drywall	White	-0.1	QM
131	012	MasterBath	A	Wall	L Lft		I	Ceramic	Tan	5.3	QM
132	012	MasterBath	A	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM
133	012	MasterBath	A	Door	Lft	U Ctr	I	Wood	White	-0.4	QM
134	012	MasterBath	B	Cabinet	Lft		I	Wood	White	-0.5	QM
135	012	MasterBath	B	Sink	Lft		I	Porcelain	White	-0.4	QM
136	012	MasterBath	C	Bathtub	Ctr		I	Porcelain	White	-0.5	QM
137		CALIBRATION								1.0	QM
138		CALIBRATION								1.0	QM
139		CALIBRATION								1.0	QM
140		CALIBRATION								-0.3	QM
141		CALIBRATION								-0.1	QM
142		CALIBRATION								-0.3	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	246 Albatross Street- Interior
Report No.	09/04/13 15:11	
Total Readings:	142	
Job Started:	09/04/13 15:11	
Job Finished:	09/04/13 15:56	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	0.0	QM
008	A	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
009	A	Door	Ctr	Lft jamb	P	Wood	White	-0.3	QM
007	A	Door	Ctr	U Ctr	I	Metal	White	-0.3	QM
002	B	Wall	L Ctr		I	Drywall	White	0.0	QM
015	B	Stairs	Rgt	Treads	I	Wood	Varnish	-0.3	QM
013	B	Stairs	Rgt	Risers	I	Wood	White	-0.5	QM
014	B	Stairs	Rgt	Stringer	I	Wood	White	-0.1	QM
010	B	Closet	Ctr	Door	I	Wood	White	-0.2	QM
011	B	Closet	Ctr	Door Casing	I	Wood	White	-0.1	QM
012	B	Closet	Ctr	Shelf	I	Wood	White	-0.4	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
005	C	Ceiling			I	Drywall	White	-0.3	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
006	D	Baseboard	Ctr		I	Wood	White	-0.1	QM
Interior Room 002 Bathroom									
016	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
021	A	Baseboard	Ctr		P	Wood	White	-0.2	QM
020	A	Ceiling			I	Drywall	White	-0.1	QM
024	A	Closet	Ctr	Shelf	I	Wood	White	-0.3	QM
017	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
025	B	Cabinet	Rgt		I	Wood	White	0.0	QM
018	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
019	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
022	D	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
023	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
Interior Room 003 Living/Din									
026	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
027	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
028	C	Wall	L Ctr		I	Drywall	White	0.0	QM
031	C	Baseboard	Rgt		I	Wood	White	-0.1	QM
030	C	Ceiling			I	Drywall	White	0.0	QM
034	C	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
032	C	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
033	C	Door	Rgt	U Ctr	I	Metal	White	-0.3	QM
029	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 004 Kitchen									
035	A	Wall	L Ctr		I	Drywall	White	-1.1	QM
041	A	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
036	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
040	B	Baseboard	Ctr		I	Wood	White	-0.1	QM
037	C	Wall	U Ctr		I	Drywall	White	0.0	QM
039	C	Ceiling			I	Drywall	White	0.1	QM
038	D	Wall	U Ctr		I	Drywall	White	-0.5	QM
Interior Room 005 Bedroom D/A									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
042	A	Wall	L Ctr		I	Drywall	White	-0.5	QM
050	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
051	A	Window	Ctr	Sill	I	Wood	White	0.0	QM
052	A	Mini Blinds	Ctr		I	Vinyl	White	-0.4	QM
043	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
048	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
049	B	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
044	C	Wall	L Ctr		I	Drywall	White	0.0	QM
046	C	Ceiling			I	Drywall	White	-0.3	QM
045	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
047	D	Baseboard	Ctr		I	Wood	White	-0.3	QM
Interior Room 006 UpperHall									
053	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
058	A	Baseboard	Ctr		I	Wood	White	-0.3	QM
064	A	AccessHatch	Ctr		I	Wood	White	0.1	QM
065	A	Attic Casing	Ctr		I	Wood	White	0.0	QM
054	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
063	B	Stairs	Lft	Wall	I	Wood	White	0.0	QM
060	B	Closet	Rgt	Door	I	Wood	White	-0.1	QM
059	B	Closet	Rgt	Door Casing	I	Wood	White	-0.3	QM
062	B	Closet	Rgt	Shelf Sup.	I	Wood	White	-0.1	QM
061	B	Closet	Rgt	Shelf	I	Wood	White	-0.1	QM
055	C	Wall	L Ctr		I	Drywall	White	-0.5	QM
057	C	Ceiling			I	Drywall	White	-0.6	QM
056	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 007 UpperBedA/B									
066	A	Wall	L Ctr		I	Drywall	White	0.1	QM
074	A	Window	Lft	Rgt casing	I	Wood	Green	-0.4	QM
075	A	Window	Lft	Sash	I	Wood	White	0.1	QM
076	A	Window	Lft	Sill	I	Wood	Green	-0.2	QM
077	A	Closet	Rgt	Door	I	Wood	White	-0.1	QM
078	A	Closet	Rgt	Shelf	I	Wood	White	-0.2	QM
067	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
068	C	Wall	L Ctr		I	Drywall	White	0.0	QM
070	C	Ceiling			I	Drywall	White	-0.2	QM
069	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
071	D	Baseboard	Ctr		I	Wood	White	0.0	QM
072	D	Door	Lft	Rgt casing	I	Wood	Cream	-0.5	QM
073	D	Door	Lft	U Ctr	I	Wood	White	-0.5	QM
Interior Room 008 UpperBedB/C									
079	A	Wall	L Ctr		I	Drywall	White	0.0	QM
089	A	Closet	Rgt	Door	I	Wood	White	-0.3	QM
090	A	Closet	Rgt	Shelf	I	Wood	White	-0.3	QM
080	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
081	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
083	C	Ceiling			I	Drywall	White	0.0	QM
087	C	Window	Rgt	Sash	I	Wood	White	-0.4	QM
088	C	Window	Rgt	Sill	I	Wood	White	-0.1	QM
082	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
084	D	Baseboard	Ctr		I	Wood	White	-0.1	QM
085	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.4	QM
086	D	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
Interior Room 009 UpperBedC/D									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
091	A	Wall	L Ctr		I	Drywall	White	0.0	QM
096	A	Baseboard	Ctr		I	Wood	White	-0.3	QM
092	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
097	B	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
098	B	Door	Lft	U Ctr	I	Wood	White	0.0	QM
101	B	Closet	Rgt	Door	I	Wood	White	-0.2	QM
102	B	Closet	Rgt	Shelf	I	Wood	White	-0.6	QM
093	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
095	C	Ceiling			I	Drywall	White	-0.3	QM
099	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
100	C	Window	Ctr	Sill	I	Wood	White	-0.7	QM
094	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
Interior Room 010 UpperBath									
108	A	Wall	L Lft		I	Ceramic	Tan	3.8	QM
103	A	Wall	U Ctr		I	Drywall	White	-0.5	QM
113	A	Bathtub	Ctr		I	Porcelain	White	-0.8	QM
104	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
109	B	Door	Rgt	Rgt casing	I	Wood	White	-0.6	QM
110	B	Door	Rgt	U Ctr	I	Wood	White	-0.6	QM
105	C	Wall	U Ctr		I	Drywall	White	-0.1	QM
107	C	Ceiling			I	Drywall	White	-0.2	QM
106	D	Wall	U Ctr		I	Drywall	White	-0.1	QM
111	D	Cabinet	Lft		I	Wood	White	-0.4	QM
112	D	Sink	Lft		I	Porcelain	White	-0.5	QM
Interior Room 011 UpperBedD/A									
114	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
119	A	Baseboard	Ctr		I	Wood	White	0.0	QM
122	A	Window	Ctr	Sash	I	Wood	White	-0.5	QM
123	A	Window	Ctr	Sill	I	Wood	White	-0.1	QM
115	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
120	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
121	B	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
124	B	Closet	Lft	Door	I	Wood	White	-0.3	QM
125	B	Closet	Lft	Shelf	I	Wood	White	-0.1	QM
116	C	Wall	L Ctr		I	Drywall	White	-0.7	QM
118	C	Ceiling			I	Drywall	White	-0.5	QM
117	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 012 MasterBath									
131	A	Wall	L Lft		I	Ceramic	Tan	5.3	QM
126	A	Wall	U Ctr		I	Drywall	White	-0.5	QM
132	A	Door	Lft	Rgt jamb	I	Wood	White	-0.4	QM
133	A	Door	Lft	U Ctr	I	Wood	White	-0.4	QM
127	B	Wall	U Ctr		I	Drywall	White	-0.9	QM
134	B	Cabinet	Lft		I	Wood	White	-0.5	QM
135	B	Sink	Lft		I	Porcelain	White	-0.4	QM
128	C	Wall	U Ctr		I	Drywall	White	-0.3	QM
130	C	Ceiling			I	Drywall	White	-0.1	QM
136	C	Bathtub	Ctr		I	Porcelain	White	-0.5	QM
129	D	Wall	U Ctr		I	Drywall	White	-0.3	QM
Calibration Readings									
137								1.0	QM
138								1.0	QM
139								1.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
140								-0.3	QM
141								-0.1	QM
142								-0.3	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	246 Albatross Street- Interior
Report No.	09/04/13 15:11	
Total Reading Sets:	136	
Job Started:	09/04/13 15:11	
Job Finished:	09/04/13 15:56	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
AccessHatch	1	0	<0%>	1	<100%>	0	<0%>
Attic Casing	1	0	<0%>	1	<100%>	0	<0%>
Baseboard	10	0	<0%>	10	<100%>	0	<0%>
Bathtub	2	0	<0%>	2	<100%>	0	<0%>
Cabinet	4	0	<0%>	4	<100%>	0	<0%>
Ceiling	12	0	<0%>	12	<100%>	0	<0%>
Closet Door	6	0	<0%>	6	<100%>	0	<0%>
Closet Door Casing	2	0	<0%>	2	<100%>	0	<0%>
Closet Shelf	7	0	<0%>	7	<100%>	0	<0%>
Closet Shelf Sup.	1	0	<0%>	1	<100%>	0	<0%>
Door Lft jamb	1	0	<0%>	1	<100%>	0	<0%>
Door Rgt casing	7	0	<0%>	7	<100%>	0	<0%>
Door Rgt jamb	3	0	<0%>	3	<100%>	0	<0%>
Door U Ctr	10	0	<0%>	10	<100%>	0	<0%>
Mini Blinds	1	0	<0%>	1	<100%>	0	<0%>
Sink	2	0	<0%>	2	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	50	2	<4%>	48	<96%>	0	<0%>
Window Rgt casing	3	0	<0%>	3	<100%>	0	<0%>
Window Sash	4	0	<0%>	4	<100%>	0	<0%>
Window Sill	5	0	<0%>	5	<100%>	0	<0%>
Inspection Totals:	136	2	< 1%>	134	< 99%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/04/13 11:13

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
274 Gulfstream Drive- Interior

INSPECTION DATE: 09/04/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 03212

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120173

SIGNED: _____ **Date:** 9/13/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	274 Gulfstream Drive- Interior
Report No.	09/04/13 11:13	
Total Readings:	144 Actionable: 2	
Job Started:	09/04/13 11:13	
Job Finished:	09/04/13 11:56	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 007 MasterBath									
083	C	Wall	L Ctr		I	Ceramic	White	4.9	QM
Interior Room 008 UpperBath									
095	C	Wall	L Ctr		I	Ceramic	Tan	5.9	QM
Calibration Readings									

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	274 Gulfstream Drive- Interior
Report No.	09/04/13 11:13	
Total Readings:	144	
Job Started:	09/04/13 11:13	
Job Finished:	09/04/13 11:56	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	0.0	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	0.0	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	0.1	QM
5	001	Hall/Stairs	C	Ceiling			I	Drywall	White	-0.6	QM
6	001	Hall/Stairs	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
7	001	Hall/Stairs	A	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
8	001	Hall/Stairs	A	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
9	001	Hall/Stairs	A	Door	Lft	U Ctr	I	Wood	White	0.2	QM
10	001	Hall/Stairs	A	Window	Rgt	Rgt casing	I	Wood	White	0.0	QM
11	001	Hall/Stairs	A	Window	Rgt	Sill	I	Wood	White	-0.1	QM
12	001	Hall/Stairs	D	Closet	Ctr	Shelf	I	Wood	White	0.0	QM
13	001	Hall/Stairs	C	Closet	Ctr	Shelf Sup.	I	Wood	White	0.0	QM
14	001	Hall/Stairs	C	Stairs	Ctr	Stringer	I	Wood	White	-0.4	QM
15	001	Hall/Stairs	D	Stairs	Ctr	Risers	I	Wood	White	0.0	QM
16	001	Hall/Stairs	D	Stairs	Ctr	Wall	I	Wood	White	-0.4	QM
17	001	Hall/Stairs	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.2	QM
18	001	Hall/Stairs	D	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.3	QM
19	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
20	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
21	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	0.0	QM
22	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
23	002	Bedroom A/B	C	Ceiling			I	Drywall	White	0.2	QM
24	002	Bedroom A/B	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
25	002	Bedroom A/B	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
26	002	Bedroom A/B	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
27	002	Bedroom A/B	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
28	002	Bedroom A/B	A	Window	Ctr	Sash	I	Wood	White	-0.6	QM
29	002	Bedroom A/B	A	Window	Ctr	Sill	I	Wood	White	-0.2	QM
30	002	Bedroom A/B	C	Baseboard	Ctr		I	Wood	White	-1.0	QM
31	002	Bedroom A/B On floor	C	Mini Blinds	Ctr		I	Vinyl	White	-0.1	QM
32	003	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
33	003	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
34	003	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
35	003	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
36	003	Kitchen	A	Ceiling			I	Drywall	White	-0.2	QM
37	003	Kitchen	C	Baseboard	Ctr		I	Wood	White	0.2	QM
38	003	Kitchen	B	Cabinet	Ctr		I	Wood	Varnish	0.2	QM
39	004	Living/Din	A	Wall	L Ctr		I	Drywall	White	0.0	QM
40	004	Living/Din	B	Wall	L Ctr		I	Drywall	White	0.0	QM
41	004	Living/Din	C	Wall	L Ctr		I	Drywall	White	0.1	QM
42	004	Living/Din	D	Wall	L Ctr		I	Drywall	White	0.0	QM
43	004	Living/Din	C	Ceiling			I	Drywall	White	0.0	QM
44	004	Living/Din	C	Baseboard	Ctr		I	Wood	White	0.0	QM
45	004	Living/Din	C	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
46	004	Living/Din	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.3	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
47	004	Living/Din	C	Door	Ctr	U Ctr	I	Metal	White	0.1	QM
48	004	Living/Din	C	Window	Ctr	Rgt casing	I	Wood	White	0.3	QM
49	004	Living/Din	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
50	004	Living/Din	C	Window	Ctr	Sill	I	Wood	White	0.0	QM
51	004	Living/Din	C	Mini Blinds	Ctr		I	Vinyl	White	-0.3	QM
52	005	Bedroom D/A	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
53	005	Bedroom D/A	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
54	005	Bedroom D/A	C	Wall	L Ctr		I	Drywall	White	0.0	QM
55	005	Bedroom D/A	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
56	005	Bedroom D/A	C	Ceiling			I	Drywall	White	0.0	QM
57	005	Bedroom D/A	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
58	005	Bedroom D/A	B	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
59	005	Bedroom D/A	B	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
60	005	Bedroom D/A	B	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
61	005	Bedroom D/A	D	Cabinet	Lft		I	Wood	Varnish	0.1	QM
62	005	Bedroom D/A	A	Cabinet	Ctr		I	Wood	Varnish	-0.4	QM
63	006	UpperBedA/B	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
64	006	UpperBedA/B	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
65	006	UpperBedA/B	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
66	006	UpperBedA/B	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
67	006	UpperBedA/B	A	Ceiling			I	Drywall	White	0.0	QM
68	006	UpperBedA/B	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
69	006	UpperBedA/B	D	Closet	Rgt	Door	I	Wood	White	-0.2	QM
70	006	UpperBedA/B	D	Closet	Rgt	Door Casing	I	Wood	White	-0.4	QM
71	006	UpperBedA/B	D	Closet	Rgt	Door Jamb	I	Wood	White	-0.1	QM
72	006	UpperBedA/B	A	Window	Lft	Rgt casing	I	Wood	White	-0.5	QM
73	006	UpperBedA/B	A	Window	Lft	Sash	I	Wood	White	-0.3	QM
74	006	UpperBedA/B	A	Window	Lft	Sill	I	Wood	White	-0.3	QM
75	006	UpperBedA/B	A	Mini Blinds	Lft		I	Vinyl	White	-0.3	QM
76	006	UpperBedA/B	D	Closet	Ctr	Shelf	I	Wood	White	0.2	QM
77	006	UpperBedA/B	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.2	QM
78	007	MasterBath	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
79	007	MasterBath	B	Wall	U Ctr		I	Drywall	White	-0.8	QM
80	007	MasterBath	C	Wall	U Ctr		I	Drywall	White	-0.4	QM
81	007	MasterBath	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
82	007	MasterBath	C	Ceiling			I	Drywall	White	0.2	QM
83	007	MasterBath	C	Wall	L Ctr		I	Ceramic	White	4.9	QM
84	007	MasterBath	A	Door	Rgt	Rgt casing	I	Wood	White	0.2	QM
85	007	MasterBath	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.5	QM
86	007	MasterBath	A	Door	Rgt	U Ctr	I	Wood	White	-0.6	QM
87	007	MasterBath	C	Bathtub	Ctr		I	Porcelain	White	-0.3	QM
88	007	MasterBath	D	Sink	Rgt		I	Porcelain	White	-0.4	QM
89	007	MasterBath	D	Cabinet	Rgt		I	Wood	White	-0.1	QM
90	008	UpperBath	A	Wall	U Rgt		I	Drywall	White	-0.4	QM
91	008	UpperBath	B	Wall	U Ctr		I	Drywall	White	-0.9	QM
92	008	UpperBath	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
93	008	UpperBath	D	Wall	U Ctr		I	Drywall	White	-0.6	QM
94	008	UpperBath	A	Ceiling			I	Drywall	White	-0.2	QM
95	008	UpperBath	C	Wall	L Ctr		I	Ceramic	Tan	5.9	QM
96	008	UpperBath	D	Door	Lft	Rgt casing	I	Wood	White	0.3	QM
97	008	UpperBath	D	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
98	008	UpperBath	D	Door	Lft	U Ctr	I	Wood	White	0.0	QM
99	008	UpperBath	B	Cabinet	Rgt		I	Wood	White	0.2	QM
100	009	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
101	009	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
102	009	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
103	009	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
104	009	UpperBedB/C	C	Ceiling			I	Drywall	White	-0.2	QM
105	009	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
106	009	UpperBedB/C	D	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
107	009	UpperBedB/C	D	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
108	009	UpperBedB/C	D	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
109	009	UpperBedB/C	C	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
110	009	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	0.1	QM
111	009	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	-0.3	QM
112	009	UpperBedB/C	A	Closet	Rgt	Shelf	I	Wood	White	-0.3	QM
113	009	UpperBedB/C	A	Closet	Rgt	Shelf Sup.	I	Wood	White	0.0	QM
114	009	UpperBedB/C	A	Closet	Rgt	Door	I	Wood	White	-0.3	QM
115	010	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
116	010	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
117	010	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
118	010	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	0.0	QM
119	010	UpperBedC/D	C	Ceiling			I	Drywall	White	0.0	QM
120	010	UpperBedC/D	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
121	010	UpperBedC/D	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
122	010	UpperBedC/D	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
123	010	UpperBedC/D	A	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
124	010	UpperBedC/D	C	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
125	010	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
126	010	UpperBedC/D	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
127	010	UpperBedC/D	C	Mini Blinds	Ctr		I	Vinyl	White	-0.5	QM
128	011	UpperHall	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
129	011	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
130	011	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
131	011	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
132	011	UpperHall	A	Ceiling			I	Drywall	White	-0.5	QM
133	011	UpperHall	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
134	011	UpperHall	D	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
135	011	UpperHall	D	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
136	011	UpperHall	D	Door	Ctr	U Lft	I	Wood	White	-0.1	QM
137	011	UpperHall	D	Closet	Ctr	Shelf	I	Wood	White	-0.8	QM
138	011	UpperHall	B	DoorStop	Ctr		I	Wood	Black	0.0	QM
139		CALIBRATION								1.0	QM
140		CALIBRATION								1.0	QM
141		CALIBRATION								1.0	QM
142		CALIBRATION								-0.1	QM
143		CALIBRATION								-0.2	QM
144		CALIBRATION								-0.1	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	274 Gulfstream Drive- Interior
Report No.	09/04/13 11:13	
Total Readings:	144	
Job Started:	09/04/13 11:13	
Job Finished:	09/04/13 11:56	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	0.0	QM
010	A	Window	Rgt	Rgt casing	I	Wood	White	0.0	QM
011	A	Window	Rgt	Sill	I	Wood	White	-0.1	QM
008	A	Door	Lft	Rgt jamb	I	Wood	White	-0.2	QM
007	A	Door	Lft	Rgt casing	I	Wood	White	0.0	QM
009	A	Door	Lft	U Ctr	I	Wood	White	0.2	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
003	C	Wall	L Ctr		I	Drywall	White	0.0	QM
006	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
005	C	Ceiling			I	Drywall	White	-0.6	QM
014	C	Stairs	Ctr	Stringer	I	Wood	White	-0.4	QM
013	C	Closet	Ctr	Shelf Sup.	I	Wood	White	0.0	QM
004	D	Wall	L Ctr		I	Drywall	White	0.1	QM
016	D	Stairs	Ctr	Wall	I	Wood	White	-0.4	QM
017	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.2	QM
015	D	Stairs	Ctr	Risers	I	Wood	White	0.0	QM
018	D	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.3	QM
012	D	Closet	Ctr	Shelf	I	Wood	White	0.0	QM
Interior Room 002 Bedroom A/B									
019	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
027	A	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
028	A	Window	Ctr	Sash	I	Wood	White	-0.6	QM
029	A	Window	Ctr	Sill	I	Wood	White	-0.2	QM
020	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
021	C	Wall	L Ctr		I	Drywall	White	0.0	QM
030	C	Baseboard	Ctr		I	Wood	White	-1.0	QM
023	C	Ceiling			I	Drywall	White	0.2	QM
031	C	Mini Blinds	Ctr		I	Vinyl	White	-0.1	QM
	On floor								
022	D	Wall	L Ctr		I	Drywall	White	-0.3	QM
025	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
024	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
026	D	Door	Lft	U Ctr	I	Wood	White	-0.1	QM
Interior Room 003 Kitchen									
032	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
036	A	Ceiling			I	Drywall	White	-0.2	QM
033	B	Wall	L Ctr		I	Drywall	White	-0.4	QM
038	B	Cabinet	Ctr		I	Wood	Varnish	0.2	QM
034	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
037	C	Baseboard	Ctr		I	Wood	White	0.2	QM
035	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
Interior Room 004 Living/Din									
039	A	Wall	L Ctr		I	Drywall	White	0.0	QM
040	B	Wall	L Ctr		I	Drywall	White	0.0	QM
041	C	Wall	L Ctr		I	Drywall	White	0.1	QM
044	C	Baseboard	Ctr		I	Wood	White	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
043	C	Ceiling			I	Drywall	White	0.0	QM
048	C	Window	Ctr	Rgt casing	I	Wood	White	0.3	QM
049	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
050	C	Window	Ctr	Sill	I	Wood	White	0.0	QM
046	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.3	QM
045	C	Door	Ctr	Rgt casing	I	Wood	White	0.0	QM
047	C	Door	Ctr	U Ctr	I	Metal	White	0.1	QM
051	C	Mini Blinds	Ctr		I	Vinyl	White	-0.3	QM
042	D	Wall	L Ctr		I	Drywall	White	0.0	QM
Interior Room 005 Bedroom D/A									
052	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
062	A	Cabinet	Ctr		I	Wood	Varnish	-0.4	QM
053	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
059	B	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
058	B	Door	Rgt	Rgt casing	I	Wood	White	-0.3	QM
060	B	Door	Rgt	U Ctr	I	Wood	White	-0.3	QM
054	C	Wall	L Ctr		I	Drywall	White	0.0	QM
057	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
056	C	Ceiling			I	Drywall	White	0.0	QM
055	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
061	D	Cabinet	Lft		I	Wood	Varnish	0.1	QM
Interior Room 006 UpperBedA/B									
063	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
067	A	Ceiling			I	Drywall	White	0.0	QM
072	A	Window	Lft	Rgt casing	I	Wood	White	-0.5	QM
073	A	Window	Lft	Sash	I	Wood	White	-0.3	QM
074	A	Window	Lft	Sill	I	Wood	White	-0.3	QM
075	A	Mini Blinds	Lft		I	Vinyl	White	-0.3	QM
064	B	Wall	L Ctr		I	Drywall	White	-0.2	QM
065	C	Wall	L Ctr		I	Drywall	White	-0.4	QM
068	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
066	D	Wall	L Ctr		I	Drywall	White	-0.4	QM
077	D	Closet	Ctr	Shelf Sup.	I	Wood	White	-0.2	QM
076	D	Closet	Ctr	Shelf	I	Wood	White	0.2	QM
069	D	Closet	Rgt	Door	I	Wood	White	-0.2	QM
070	D	Closet	Rgt	Door Casing	I	Wood	White	-0.4	QM
071	D	Closet	Rgt	Door Jamb	I	Wood	White	-0.1	QM
Interior Room 007 MasterBath									
078	A	Wall	U Ctr		I	Drywall	White	-0.3	QM
085	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.5	QM
084	A	Door	Rgt	Rgt casing	I	Wood	White	0.2	QM
086	A	Door	Rgt	U Ctr	I	Wood	White	-0.6	QM
079	B	Wall	U Ctr		I	Drywall	White	-0.8	QM
083	C	Wall	L Ctr		I	Ceramic	White	4.9	QM
080	C	Wall	U Ctr		I	Drywall	White	-0.4	QM
082	C	Ceiling			I	Drywall	White	0.2	QM
087	C	Bathtub	Ctr		I	Porcelain	White	-0.3	QM
081	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
088	D	Sink	Rgt		I	Porcelain	White	-0.4	QM
089	D	Cabinet	Rgt		I	Wood	White	-0.1	QM
Interior Room 008 UpperBath									
090	A	Wall	U Rgt		I	Drywall	White	-0.4	QM
094	A	Ceiling			I	Drywall	White	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
091	B	Wall	U Ctr		I	Drywall	White	-0.9	QM
099	B	Cabinet	Rgt		I	Wood	White	0.2	QM
095	C	Wall	L Ctr		I	Ceramic	Tan	5.9	QM
092	C	Wall	U Ctr		I	Drywall	White	-0.2	QM
093	D	Wall	U Ctr		I	Drywall	White	-0.6	QM
097	D	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
096	D	Door	Lft	Rgt casing	I	Wood	White	0.3	QM
098	D	Door	Lft	U Ctr	I	Wood	White	0.0	QM
Interior Room 009 UpperBedB/C									
100	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
114	A	Closet	Rgt	Door	I	Wood	White	-0.3	QM
113	A	Closet	Rgt	Shelf Sup.	I	Wood	White	0.0	QM
112	A	Closet	Rgt	Shelf	I	Wood	White	-0.3	QM
101	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
102	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
105	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
104	C	Ceiling			I	Drywall	White	-0.2	QM
109	C	Window	Ctr	Rgt casing	I	Wood	White	-0.4	QM
110	C	Window	Ctr	Sash	I	Wood	White	0.1	QM
111	C	Window	Ctr	Sill	I	Wood	White	-0.3	QM
103	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
107	D	Door	Rgt	Rgt jamb	I	Wood	White	0.1	QM
106	D	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
108	D	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
Interior Room 010 UpperBedC/D									
115	A	Wall	L Ctr		I	Drywall	White	-0.4	QM
122	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.3	QM
121	A	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
123	A	Door	Rgt	U Ctr	I	Wood	White	-0.2	QM
116	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
117	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
120	C	Baseboard	Ctr		I	Wood	White	-0.3	QM
119	C	Ceiling			I	Drywall	White	0.0	QM
124	C	Window	Ctr	Rgt casing	I	Wood	White	-0.3	QM
125	C	Window	Ctr	Sash	I	Wood	White	0.0	QM
126	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
127	C	Mini Blinds	Ctr		I	Vinyl	White	-0.5	QM
118	D	Wall	L Ctr		I	Drywall	White	0.0	QM
Interior Room 011 UpperHall									
128	A	Wall	L Ctr		I	Drywall	White	-0.3	QM
132	A	Ceiling			I	Drywall	White	-0.5	QM
129	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
138	B	DoorStop	Ctr		I	Wood	Black	0.0	QM
130	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
133	C	Baseboard	Ctr		I	Wood	White	-0.4	QM
131	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
135	D	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
134	D	Door	Ctr	Rgt casing	I	Wood	White	-0.3	QM
136	D	Door	Ctr	U Lft	I	Wood	White	-0.1	QM
137	D	Closet	Ctr	Shelf	I	Wood	White	-0.8	QM
Calibration Readings									
139								1.0	QM
140								1.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
141								1.0	QM
142								-0.1	QM
143								-0.2	QM
144								-0.1	QM

---- End of Readings ----

DISTRIBUTION REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/04/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	274 Gulfstream Drive- Interior
Report No.	09/04/13 11:13	
Total Reading Sets:	138	
Job Started:	09/04/13 11:13	
Job Finished:	09/04/13 11:56	

Structure	Total	Structure Distribution Positive		Negative		Inconclusive	
Baseboard	9	0	<0%>	9	<100%>	0	<0%>
Bathtub	1	0	<0%>	1	<100%>	0	<0%>
Cabinet	5	0	<0%>	5	<100%>	0	<0%>
Ceiling	11	0	<0%>	11	<100%>	0	<0%>
Closet Door	2	0	<0%>	2	<100%>	0	<0%>
Closet Door Casing	1	0	<0%>	1	<100%>	0	<0%>
Closet Door Jamb	1	0	<0%>	1	<100%>	0	<0%>
Closet Shelf	4	0	<0%>	4	<100%>	0	<0%>
Closet Shelf Sup.	3	0	<0%>	3	<100%>	0	<0%>
Door Rgt casing	9	0	<0%>	9	<100%>	0	<0%>
Door Rgt jamb	9	0	<0%>	9	<100%>	0	<0%>
Door U Ctr	8	0	<0%>	8	<100%>	0	<0%>
Door U Lft	1	0	<0%>	1	<100%>	0	<0%>
DoorStop	1	0	<0%>	1	<100%>	0	<0%>
Mini Blinds	4	0	<0%>	4	<100%>	0	<0%>
Sink	1	0	<0%>	1	<100%>	0	<0%>
Stairs Railing cap	1	0	<0%>	1	<100%>	0	<0%>
Stairs Risers	1	0	<0%>	1	<100%>	0	<0%>
Stairs Stringer	1	0	<0%>	1	<100%>	0	<0%>
Stairs Treads	1	0	<0%>	1	<100%>	0	<0%>
Stairs Wall	1	0	<0%>	1	<100%>	0	<0%>
Wall	46	2	<4%>	44	<96%>	0	<0%>
Window Rgt casing	6	0	<0%>	6	<100%>	0	<0%>
Window Sash	5	0	<0%>	5	<100%>	0	<0%>
Window Sill	6	0	<0%>	6	<100%>	0	<0%>
Inspection Totals:	138	2	< 1%>	136	< 99%>	0	< 0%>

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 09/05/13 09:24

INSPECTION FOR: AMEC
2 Robbins Road
Westford, MA 01886

PERFORMED AT: USCG Elizabeth City
Housing Units
208 Albatross Street- Interior

INSPECTION DATE: 09/05/13

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02372

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 120126

SIGNED: _____ **Date:** 9/13/2013

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/05/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	208 Albatross Street- Interior
Report No.	09/05/13 09:24	
Total Readings:	130 Actionable: 2	
Job Started:	09/05/13 09:24	
Job Finished:	09/05/13 09:59	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 007 MasterBath									
076	C	Wall	L Ctr		I	Ceramic	Tan	6.9	QM
Interior Room 008 UpperBath									
087	C	Wall	L Ctr		I	Ceramic	Tan	5.6	QM

---- End of Readings ----

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/05/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	208 Albatross Street- Interior
Report No.	09/05/13 09:24	
Total Readings:	130	
Job Started:	09/05/13 09:24	
Job Finished:	09/05/13 09:59	

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
1	001	Hall/Stairs	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
2	001	Hall/Stairs	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
3	001	Hall/Stairs	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
4	001	Hall/Stairs	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
5	001	Hall/Stairs	C	Ceiling			I	Drywall	White	-0.2	QM
6	001	Hall/Stairs	C	Baseboard	Ctr		I	Wood	White	0.0	QM
7	001	Hall/Stairs	A	Door	Lft	Rgt casing	I	Wood	White	0.1	QM
8	001	Hall/Stairs	A	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
9	001	Hall/Stairs	A	Door	Lft	U Ctr	I	Wood	White	0.1	QM
10	001	Hall/Stairs	A	Window	Rgt	Rgt casing	I	Wood	White	0.0	QM
11	001	Hall/Stairs	A	Window	Rgt	Sash	I	Wood	White	-0.2	QM
12	001	Hall/Stairs	A	Window	Rgt	Sill	I	Wood	White	-0.1	QM
13	001	Hall/Stairs	C	Stairs	Ctr	Stringer	I	Wood	White	-0.1	QM
14	001	Hall/Stairs	C	Stairs	Ctr	Risers	I	Wood	White	0.0	QM
15	001	Hall/Stairs	B	Stairs	Ctr	Wall	I	Wood	White	-0.1	QM
16	001	Hall/Stairs	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.1	QM
17	001	Hall/Stairs	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.1	QM
18	002	Bedroom A/B	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
19	002	Bedroom A/B	B	Wall	L Ctr		I	Drywall	White	0.1	QM
20	002	Bedroom A/B	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
21	002	Bedroom A/B	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
22	002	Bedroom A/B	A	Ceiling			I	Drywall	White	-0.1	QM
23	002	Bedroom A/B	C	Baseboard	Ctr		I	Wood	White	0.0	QM
24	002	Bedroom A/B	D	Door	Lft	Rgt casing	I	Wood	White	0.2	QM
25	002	Bedroom A/B	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
26	002	Bedroom A/B	D	Door	Lft	U Ctr	I	Wood	White	0.0	QM
27	002	Bedroom A/B	A	Window	Ctr	Rgt casing	I	Wood	White	0.1	QM
28	002	Bedroom A/B	A	Window	Ctr	Sash	I	Wood	White	0.0	QM
29	002	Bedroom A/B	A	Window	Ctr	Sill	I	Wood	White	-0.1	QM
30	003	Kitchen	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
31	003	Kitchen	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
32	003	Kitchen	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
33	003	Kitchen	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
34	003	Kitchen	A	Ceiling			I	Drywall	White	-0.1	QM
35	003	Kitchen	C	Baseboard	Ctr		I	Vinyl	Black	-0.3	QM
36	003	Kitchen	B	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
37	004	Living/Din	A	Wall	L Ctr		I	Drywall	White	0.0	QM
38	004	Living/Din	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
39	004	Living/Din	C	Wall	L Ctr		I	Drywall	White	0.0	QM
40	004	Living/Din	D	Wall	L Ctr		I	Drywall	White	0.0	QM
41	004	Living/Din	C	Ceiling			I	Drywall	White	0.0	QM
42	004	Living/Din	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
43	004	Living/Din	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
44	004	Living/Din	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
45	004	Living/Din	C	Door	Ctr	U Ctr	I	Metal	White	0.1	QM
46	004	Living/Din	C	Window	Rgt	Rgt casing	I	Wood	White	0.0	QM
47	004	Living/Din	C	Window	Rgt	Sash	I	Vinyl	White	-0.2	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
48	004	Living/Din	C	Window	Rgt	Sill	I	Wood	White	0.1	QM
49	005	Bathroom	A	Wall	L Ctr		I	Drywall	White	0.0	QM
50	005	Bathroom	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
51	005	Bathroom	C	Wall	L Ctr		I	Drywall	White	0.1	QM
52	005	Bathroom	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
53	005	Bathroom	C	Ceiling			I	Drywall	White	0.0	QM
54	005	Bathroom	C	Baseboard	Ctr		I	Wood	White	0.1	QM
55	005	Bathroom	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
56	005	Bathroom	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
57	005	Bathroom	B	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
58	005	Bathroom	D	Cabinet	Lft		I	Wood	Varnish	0.0	QM
59	006	UpperBedA/B	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
60	006	UpperBedA/B	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
61	006	UpperBedA/B	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
62	006	UpperBedA/B	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
63	006	UpperBedA/B	A	Ceiling			I	Drywall	White	0.1	QM
64	006	UpperBedA/B	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
65	006	UpperBedA/B	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
66	006	UpperBedA/B	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
67	006	UpperBedA/B	C	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
68	006	UpperBedA/B	A	Window	Lft	Rgt casing	I	Wood	White	0.0	QM
69	006	UpperBedA/B	A	Window	Lft	Sash	I	Wood	White	-0.2	QM
70	006	UpperBedA/B	A	Window	Lft	Sill	I	Wood	White	-0.1	QM
71	007	MasterBath	A	Wall	U Ctr		I	Drywall	White	0.0	QM
72	007	MasterBath	B	Wall	U Ctr		I	Drywall	White	-0.1	QM
73	007	MasterBath	C	Wall	U Ctr		I	Drywall	White	0.1	QM
74	007	MasterBath	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
75	007	MasterBath	C	Ceiling			I	Drywall	White	-0.1	QM
76	007	MasterBath	C	Wall	L Ctr		I	Ceramic	Tan	6.9	QM
77	007	MasterBath	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
78	007	MasterBath	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
79	007	MasterBath	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
80	007	MasterBath	D	Sink	Rgt		I	Porcelain	White	-0.1	QM
81	007	MasterBath	A	DoorStop	Rgt		I	Wood	Black	-0.2	QM
82	008	UpperBath	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
83	008	UpperBath	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
84	008	UpperBath	C	Wall	U Ctr		I	Drywall	White	0.0	QM
85	008	UpperBath	D	Wall	U Lft		I	Drywall	White	-0.1	QM
86	008	UpperBath	A	Ceiling			I	Drywall	White	0.0	QM
87	008	UpperBath	C	Wall	L Ctr		I	Ceramic	Tan	5.6	QM
88	008	UpperBath	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
89	008	UpperBath	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
90	008	UpperBath	D	Door	Lft	U Ctr	I	Wood	White	0.0	QM
91	008	UpperBath	B	Cabinet	Rgt		I	Wood	White	-0.1	QM
92	008	UpperBath	D	DoorStop	Lft		I	Wood	Black	-0.1	QM
93	009	UpperBedB/C	A	Wall	L Ctr		I	Drywall	White	0.0	QM
94	009	UpperBedB/C	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
95	009	UpperBedB/C	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
96	009	UpperBedB/C	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
97	009	UpperBedB/C	C	Ceiling			I	Drywall	White	-0.1	QM
98	009	UpperBedB/C	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
99	009	UpperBedB/C	D	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
100	009	UpperBedB/C	D	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
101	009	UpperBedB/C	D	Door	Rgt	U Ctr	I	Wood	White	0.0	QM
102	009	UpperBedB/C	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM

SEQUENTIAL REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Read No.	Rm No.	Room Name	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
103	009	UpperBedB/C	C	Window	Ctr	Sash	I	Wood	White	-0.1	QM
104	009	UpperBedB/C	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
105	009	UpperBedB/C	C	Mini Blinds	Ctr		I	Vinyl	White	-0.2	QM
106	009	UpperBedB/C	A	Closet	Rgt	Door	I	Wood	White	-0.2	QM
107	010	UpperBedC/D	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
108	010	UpperBedC/D	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
109	010	UpperBedC/D	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
110	010	UpperBedC/D	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
111	010	UpperBedC/D	C	Ceiling			I	Drywall	White	-0.2	QM
112	010	UpperBedC/D	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
113	010	UpperBedC/D	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
114	010	UpperBedC/D	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
115	010	UpperBedC/D	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
116	010	UpperBedC/D	C	Window	Ctr	Rgt casing	I	Wood	White	-0.1	QM
117	010	UpperBedC/D	C	Window	Ctr	Sash	I	Wood	White	-0.2	QM
118	010	UpperBedC/D	C	Window	Ctr	Sill	I	Wood	White	-0.1	QM
119	011	UpperHall	A	Wall	L Ctr		I	Drywall	White	-0.2	QM
120	011	UpperHall	B	Wall	L Ctr		I	Drywall	White	-0.3	QM
121	011	UpperHall	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
122	011	UpperHall	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
123	011	UpperHall	C	Ceiling			I	Drywall	White	-0.2	QM
124	011	UpperHall	C	Baseboard	Ctr		I	Wood	White	-0.2	QM
125	011	UpperHall	D	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
126	011	UpperHall	D	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
127	011	UpperHall	D	Door	Ctr	U Ctr	I	Wood	White	-0.1	QM
128	011	UpperHall	D	Closet	Ctr	Shelf	I	Wood	White	-0.1	QM
129	011	UpperHall	A	Attic Hatch	Ctr		I	Wood	White	-0.2	QM
130	011	UpperHall	A	Attic Casing	Ctr		I	Wood	White	-0.2	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Inspection Date:	09/05/13	USCG Elizabeth City
Report Date:	9/13/2013	Housing Units
Abatement Level:	1.0	208 Albatross Street- Interior
Report No.	09/05/13 09:24	
Total Readings:	130	
Job Started:	09/05/13 09:24	
Job Finished:	09/05/13 09:59	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Hall/Stairs									
001	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
010	A	Window	Rgt	Rgt casing	I	Wood	White	0.0	QM
011	A	Window	Rgt	Sash	I	Wood	White	-0.2	QM
012	A	Window	Rgt	Sill	I	Wood	White	-0.1	QM
008	A	Door	Lft	Rgt jamb	I	Wood	White	0.1	QM
007	A	Door	Lft	Rgt casing	I	Wood	White	0.1	QM
009	A	Door	Lft	U Ctr	I	Wood	White	0.1	QM
017	A	Stairs	Ctr	Railing cap	I	Wood	Varnish	-0.1	QM
002	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
015	B	Stairs	Ctr	Wall	I	Wood	White	-0.1	QM
003	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
006	C	Baseboard	Ctr		I	Wood	White	0.0	QM
005	C	Ceiling			I	Drywall	White	-0.2	QM
014	C	Stairs	Ctr	Risers	I	Wood	White	0.0	QM
013	C	Stairs	Ctr	Stringer	I	Wood	White	-0.1	QM
004	D	Wall	L Ctr		I	Drywall	White	-0.2	QM
016	D	Stairs	Ctr	Treads	I	Wood	Varnish	-0.1	QM
Interior Room 002 Bedroom A/B									
018	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
022	A	Ceiling			I	Drywall	White	-0.1	QM
027	A	Window	Ctr	Rgt casing	I	Wood	White	0.1	QM
028	A	Window	Ctr	Sash	I	Wood	White	0.0	QM
029	A	Window	Ctr	Sill	I	Wood	White	-0.1	QM
019	B	Wall	L Ctr		I	Drywall	White	0.1	QM
020	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
023	C	Baseboard	Ctr		I	Wood	White	0.0	QM
021	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
025	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
024	D	Door	Lft	Rgt casing	I	Wood	White	0.2	QM
026	D	Door	Lft	U Ctr	I	Wood	White	0.0	QM
Interior Room 003 Kitchen									
030	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
034	A	Ceiling			I	Drywall	White	-0.1	QM
031	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
036	B	Cabinet	Ctr		I	Wood	Varnish	-0.1	QM
032	C	Wall	L Ctr		I	Drywall	White	-0.2	QM
035	C	Baseboard	Ctr		I	Vinyl	Black	-0.3	QM
033	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 004 Living/Din									
037	A	Wall	L Ctr		I	Drywall	White	0.0	QM
038	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
039	C	Wall	L Ctr		I	Drywall	White	0.0	QM
042	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
041	C	Ceiling			I	Drywall	White	0.0	QM
046	C	Window	Rgt	Rgt casing	I	Wood	White	0.0	QM
047	C	Window	Rgt	Sash	I	Vinyl	White	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: AMEC

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
048	C	Window	Rgt	Sill	I	Wood	White	0.1	QM
044	C	Door	Ctr	Rgt jamb	I	Wood	White	-0.1	QM
043	C	Door	Ctr	Rgt casing	I	Wood	White	-0.1	QM
045	C	Door	Ctr	U Ctr	I	Metal	White	0.1	QM
040	D	Wall	L Ctr		I	Drywall	White	0.0	QM
Interior Room 005 Bathroom									
049	A	Wall	L Ctr		I	Drywall	White	0.0	QM
050	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
056	B	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
055	B	Door	Rgt	Rgt casing	I	Wood	White	-0.1	QM
057	B	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
051	C	Wall	L Ctr		I	Drywall	White	0.1	QM
054	C	Baseboard	Ctr		I	Wood	White	0.1	QM
053	C	Ceiling			I	Drywall	White	0.0	QM
052	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
058	D	Cabinet	Lft		I	Wood	Varnish	0.0	QM
Interior Room 006 UpperBedA/B									
059	A	Wall	L Ctr		I	Drywall	White	-0.1	QM
063	A	Ceiling			I	Drywall	White	0.1	QM
068	A	Window	Lft	Rgt casing	I	Wood	White	0.0	QM
069	A	Window	Lft	Sash	I	Wood	White	-0.2	QM
070	A	Window	Lft	Sill	I	Wood	White	-0.1	QM
060	B	Wall	L Ctr		I	Drywall	White	-0.1	QM
061	C	Wall	L Ctr		I	Drywall	White	-0.1	QM
064	C	Baseboard	Ctr		I	Wood	White	-0.1	QM
066	C	Door	Rgt	Rgt jamb	I	Wood	White	-0.2	QM
065	C	Door	Rgt	Rgt casing	I	Wood	White	0.0	QM
067	C	Door	Rgt	U Ctr	I	Wood	White	0.1	QM
062	D	Wall	L Ctr		I	Drywall	White	-0.1	QM
Interior Room 007 MasterBath									
071	A	Wall	U Ctr		I	Drywall	White	0.0	QM
078	A	Door	Rgt	Rgt jamb	I	Wood	White	-0.1	QM
077	A	Door	Rgt	Rgt casing	I	Wood	White	-0.2	QM
079	A	Door	Rgt	U Ctr	I	Wood	White	-0.1	QM
081	A	DoorStop	Rgt		I	Wood	Black	-0.2	QM
072	B	Wall	U Ctr		I	Drywall	White	-0.1	QM
076	C	Wall	L Ctr		I	Ceramic	Tan	6.9	QM
073	C	Wall	U Ctr		I	Drywall	White	0.1	QM
075	C	Ceiling			I	Drywall	White	-0.1	QM
074	D	Wall	U Ctr		I	Drywall	White	-0.2	QM
080	D	Sink	Rgt		I	Porcelain	White	-0.1	QM
Interior Room 008 UpperBath									
082	A	Wall	U Ctr		I	Drywall	White	-0.1	QM
086	A	Ceiling			I	Drywall	White	0.0	QM
083	B	Wall	U Ctr		I	Drywall	White	-0.2	QM
091	B	Cabinet	Rgt		I	Wood	White	-0.1	QM
087	C	Wall	L Ctr		I	Ceramic	Tan	5.6	QM
084	C	Wall	U Ctr		I	Drywall	White	0.0	QM
085	D	Wall	U Lft		I	Drywall	White	-0.1	QM
089	D	Door	Lft	Rgt jamb	I	Wood	White	-0.1	QM
088	D	Door	Lft	Rgt casing	I	Wood	White	-0.1	QM
090	D	Door	Lft	U Ctr	I	Wood	White	0.0	QM
092	D	DoorStop	Lft		I	Wood	Black	-0.1	QM